


PROline promag 53 **Electromagnetic Flow Measuring System**

Description of Device Functions

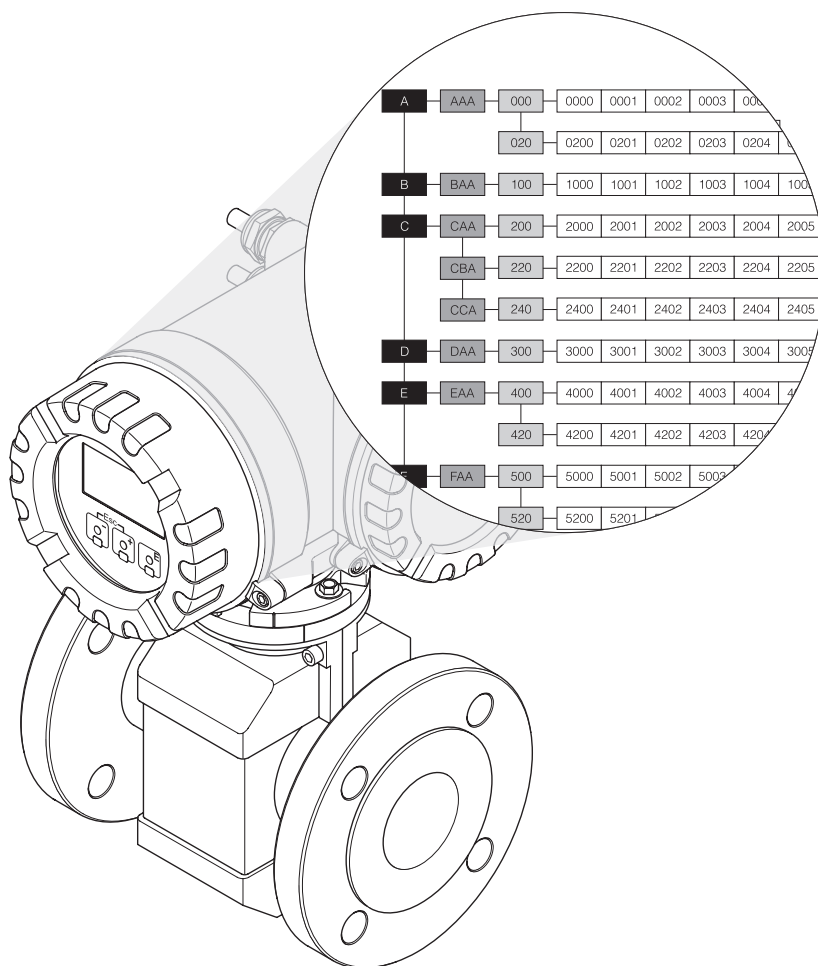

Contents

1	Notes on using this Manual	7
1.1	Using the table of contents to locate a function description	7
1.2	Using the graphic of the function matrix to locate a function description	7
1.3	Using the index of the function matrix to locate a function description	7
2	Function Matrix	8
2.1	General layout of the function matrix	8
2.1.1	Blocks (A, B, C, etc.)	8
2.1.2	Groups (AAA, AEA, CAA, etc.)	8
2.1.3	Function groups (000, 020, 060, etc.)	8
2.1.4	Functions (0000, 0001, 0002, etc.)	8
2.1.5	Codes identifying cells	9
2.2	Function matrix PROline Promag 53	10
3	Block MEASURED VARIABLES	11
3.1	Group MEASURING VALUES	12
3.2	Group SYSTEM UNITS	13
3.2.1	Function group CONFIGURATION	13
3.2.2	Function group ADDITIONAL CONFIGURATION	16
3.3	Group SPECIAL UNITS	17
3.3.1	Function group ARBITRARY UNIT	17
3.3.2	Function group DENSITY PARAMETER	18
4	Block QUICK SETUP	19
4.0.1	Setup Commissioning	21
5	Block USER INTERFACE	27
5.1	Group CONTROL	28
5.1.1	Function group BASIC CONFIGURATION	28
5.1.2	Function group UNLOCKING/LOCKING	29
5.1.3	Function group OPERATION	30
5.2	Group MAIN LINE	31
5.2.1	Function group CONFIGURATION	31
5.2.2	Function group MULTIPLEX	33
5.3	Group ADDITIONAL LINE	35
5.3.1	Function group CONFIGURATION	35
5.3.2	Function group MULTIPLEX	37
5.4	Group INFORMATION LINE	39
5.4.1	Function group CONFIGURATION	39
5.4.2	Function group MULTIPLEX	41
6	Block TOTALIZER	43
6.1	Group TOTALIZER (1...3)	44
6.1.1	Function group CONFIGURATION	44
6.1.2	Function group OPERATION	46
6.2	Group HANDLING TOTALIZER	47

7	Block OUTPUTS	48
7.1	Group CURRENT OUTPUT (1...2)	49
7.1.1	Function group CONFIGURATION	49
7.1.2	Function group OPERATION	57
7.1.3	Function group INFORMATION	58
7.2	Group PULSE/FREQUENCY OUTPUT (1...2)	59
7.2.1	Function group CONFIGURATION	59
7.2.2	Function group OPERATION	74
7.2.3	Function group INFORMATION	77
7.3	Group RELAY OUTPUT (1...2)	78
7.3.1	Function group CONFIGURATION	78
7.3.2	Function group OPERATION	82
7.3.3	Function group INFORMATION	84
7.3.4	Information on the response of the relay output	85
7.3.5	Switching response of the relay output	86
8	Block INPUTS	88
8.1	Group STATUS INPUT	89
8.1.1	Function group CONFIGURATION	89
8.1.2	Function group OPERATION	90
8.1.3	Function group INFORMATION	91
9	Block BASIC FUNCTION	92
9.1	Group HART	93
9.1.1	Function group CONFIGURATION	93
9.1.2	Function group INFORMATION	94
9.2	Group PROCESS PARAMETER	95
9.2.1	Function group CONFIGURATION	95
9.2.2	Function group EPD PARAMETER	97
9.2.3	Function group ECC PARAMETER	99
9.2.4	Function group ADJUSTMENT	101
9.3	Group SYSTEM PARAMETER	102
9.3.1	Function group CONFIGURATION	102
9.4	Group SENSOR DATA	104
9.4.1	Function group CONFIGURATION	104
9.4.2	Function group OPERATION	105
10	Block SPECIAL FUNCTION	107
10.1	Group BATCHING FUNCTION	108
10.1.1	Function group CONFIGURATION	108
10.1.2	Function group VALVE PARAMETER	114
10.1.3	Examples of setting parameters for batching processes	116
10.1.4	Function group SUPERVISION	119
10.1.5	Function group OPERATION	122
10.1.6	Function group INFORMATION	124
10.2	Group ADVANCED DIAGNOSTICS	125
10.2.1	Function group ACQUISITION	126
10.2.2	Function group CONFIGURATION COATING	127
10.2.3	Function group OPERATION COATING	128
10.2.4	Function group CONFIGURATION ELECTRODES	129
10.2.5	Function group OPERATION ELECTRODE POTENTIAL 1	130
10.2.6	Function group OPERATION ELECTRODE POTENTIAL 2	131

11	Block SUPERVISION	132
11.1	Group SYSTEM	133
11.1.1	Function group CONFIGURATION	133
11.1.2	Function group OPERATION	135
11.2	Group VERSION INFO	137
11.2.1	Function group SENSOR	137
11.2.2	Function group AMPLIFIER	137
11.2.3	Function group F-CHIP	138
11.2.4	Function group I/O MODULE	138
11.2.5	Function groups INPUT /OUTPUT 1...4	139
12	Factory settings	141
12.1	SI units (not for USA and Canada)	141
12.1.1	Low flow cut off, full scale value, pulse value, totalizer	141
12.1.2	Language	142
12.1.3	Density, length, temperature	142
12.2	US units (only for USA and Canada)	143
12.2.1	Low flow cut off, full scale value, pulse value, totalizer	143
12.2.2	Language, density, length, temperature	143
13	Index function matrix	145
14	Index key words	149

Registered trademarks

HART®

Registered trademark of the HART Communication Foundation, Austin, USA

S-DAT™, T-DAT™, F-CHIP™

Registered trademarks of Endress+Hauser Flowtec AG, Reinach, CH

1 Notes on using this Manual

There are various ways of locating the description of a function of your choice in the manual:

1.1 Using the table of contents to locate a function description

The designations of all the cells in the function matrix are listed in the table of contents. You can use these unambiguous designations (such as USER INTERFACE, INPUTS, OUTPUTS, etc.) to choose whichever functions are applicable to a particular set of conditions. The page references show you exactly where to find the detailed descriptions of the functions in question.

The table of contents is on Page 3.

1.2 Using the graphic of the function matrix to locate a function description


This step-by-step, top-down approach starts with the blocks, the highest level, and works down through the matrix to the description of the function you need:

1. All available blocks and their corresponding groups, are illustrated on Page 10. Select the block (or the group within the block) which you need for your application and use the page reference to locate the information corresponding to the next level.
2. The page in question contains a graphic showing of the block with all its subordinate groups, function groups and functions. Select the function which you need for your application and use the page reference to locate the detailed function description.

1.3 Using the index of the function matrix to locate a function description

Each "cell" in the function matrix (blocks, groups, function groups, functions) has a unique identifier in the form of a code consisting of one or three letters or a three- or four-digit number. The code identifying a selected "cell" appears at the top right on the local display.

Example:

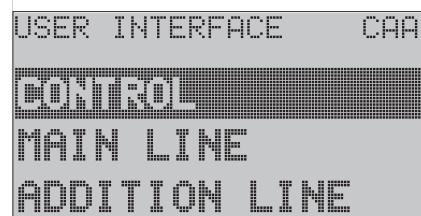

F06-x3xxxx-20-xx-xx-en-000


The function matrix index lists the codes for all the available "cells" in alphabetic and consecutive order, complete with the page references for the corresponding functions. The index to the function matrix is on Page 145.

2 Function Matrix

2.1 General layout of the function matrix

The function matrix consists of four levels:

Blocks -> Groups -> Function groups -> Functions

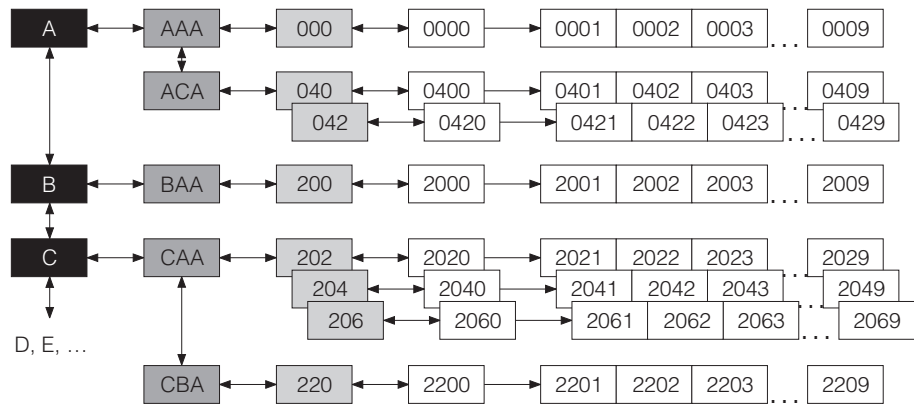

F06-x3xxxx-13-xx-xx-xx-000

2.1.1 Blocks (A, B, C, etc.)

The blocks are the highest-level grouping of the operation options for the device. The blocks include, for example: MEASURED VARIABLES, QUICK SETUP, USER INTERFACE, TOTALIZER, etc.

2.1.2 Groups (AAA, AEA, CAA, etc.)

A block consists of one or more groups. Each group represents a more detailed selection of the operation options in the higher-order block. The groups in the "USER INTERFACE" block, for example, include: CONTROL, MAIN LINE, ADDITIONAL LINE, etc.

2.1.3 Function groups (000, 020, 060, etc.)

A group consists of one or more function groups. Each function group represents a more detailed selection of the operation options in the higher-order group. Function groups available of group "CONTROL" are for example: BASIC CONFIGURATION, UNLOCKING/LOCKING, OPERATION, etc.

2.1.4 Functions (0000, 0001, 0002, etc.)

Each function group consists of one or more functions. The functions are used to operate and parameterize the device. Numerical values can be entered or. parameters selected and saved.

The functions in the "BASIC CONFIGURATION" function group include LANGUAGE, DISPLAY DAMPING, CONTRAST LCD, etc. The procedure for changing the language of the user interface, for example, is as follows:

1. Select the block "USER INTERFACE".
2. Select the group "CONTROL".
3. Select the function group "BASIC CONFIGURATION".
4. Select the function "LANGUAGE" (here you can set the language required).

2.1.5 Codes identifying cells

Each cell (block, group, function group and function) in the function matrix has an individual, unique code.

Blocks:

The code is a letter (A, B, C, etc.)

Groups:

The code consists of three letters (AAA, ABA, BAA, etc.).

The first letter matches the block code (i.e. each group in block A has a code starting with an A _ _; the codes of the groups in block B start with a B _ _, etc.).

The other two letters are for identifying the group within the respective block.

Function groups:


The code consists of three digits (000, 001, 100, etc.).

Functions:

The code consists of four digits (0000, 0001, 0201, etc.).

The first three digits are the same as the code for the function group.


The last digit in the code is a counter for the functions in the function group, incrementing from 0 to 9 (e.g. function 0005 is the sixth function in group 000).

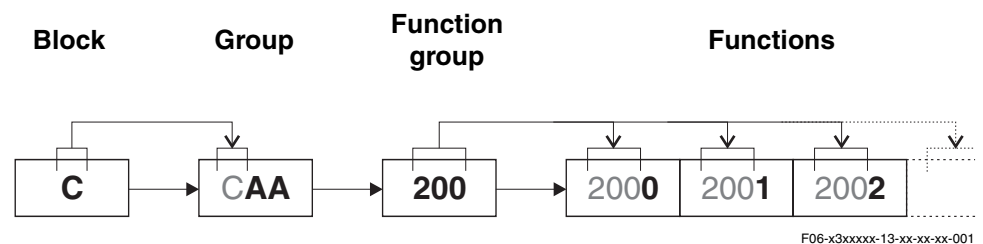

2.2 Function matrix PROline Promag 53

BLOCKS		GROUPS		FUNCTION GROUPS
MEASURED VARIABLES A (see Page 11)	→	MEASURING VALUES	AAA	→ see Page 12
		SYSTEM UNITS	ACA	→ see Page 13
		SPECIAL UNITS	AEA	→ see Page 17
↓				
QUICK SETUP B (see Page 19)	→	Commissioning and application setups		→ see Page 19
↓				
USER INTERFACE C (see Page 27)	→	CONTROL	CAA	→ see Page 28
		MAIN LINE	CCA	→ see Page 31
		ADDITIONAL LINE	CEA	→ see Page 35
		INFORMATION LINE	CGA	→ see Page 39
↓				
TOTALIZER D (see Page 43)	→	TOTALIZER 1	DAA	→ see Page 44
		TOTALIZER 2	DAB	→ see Page 44
		TOTALIZER 3	DAC	→ see Page 44
		HANDLING TOTALIZER	DJA	→ see Page 47
↓				
OUTPUTS E (see Page 48)	→	CURRENT OUTPUT 1	EAA	→ see Page 49
		CURRENT OUTPUT 2	EAB	→ see Page 49
		PULSE/FREQ. OUTPUT 1	ECA	→ see Page 59
		PULSE/FREQ. OUTPUT 2	ECB	→ see Page 59
		RELAY OUTPUT 1	EGA	→ see Page 78
		RELAY OUTPUT 2	EGB	→ see Page 78
↓				
INPUTS F (see Page 88)	→	STATUS INPUT		→ see Page 89
↓				
BASIC FUNCTION G (see Page 92)	→	HART	GAA	→ see Page 93
		PROCESS PARAMETER	GIA	→ see Page 95
		SYSTEM PARAMETER	GLA	→ see Page 102
		SENSOR DATA	GNA	→ see Page 104
↓				
SPECIAL FUNCTION H (see Page 107)	→	BATCHING FUNCTION	HCA	→ see Page 108
		ADVANCED DIAGNOSIS	HEA	→ see Page 125
↓				
SUPERVISION J (see Page 132)	→	SYSTEM	JAA	→ see Page 133
		VERSION INFO	JCA	→ see Page 137

3 Block MEASURED VARIABLES

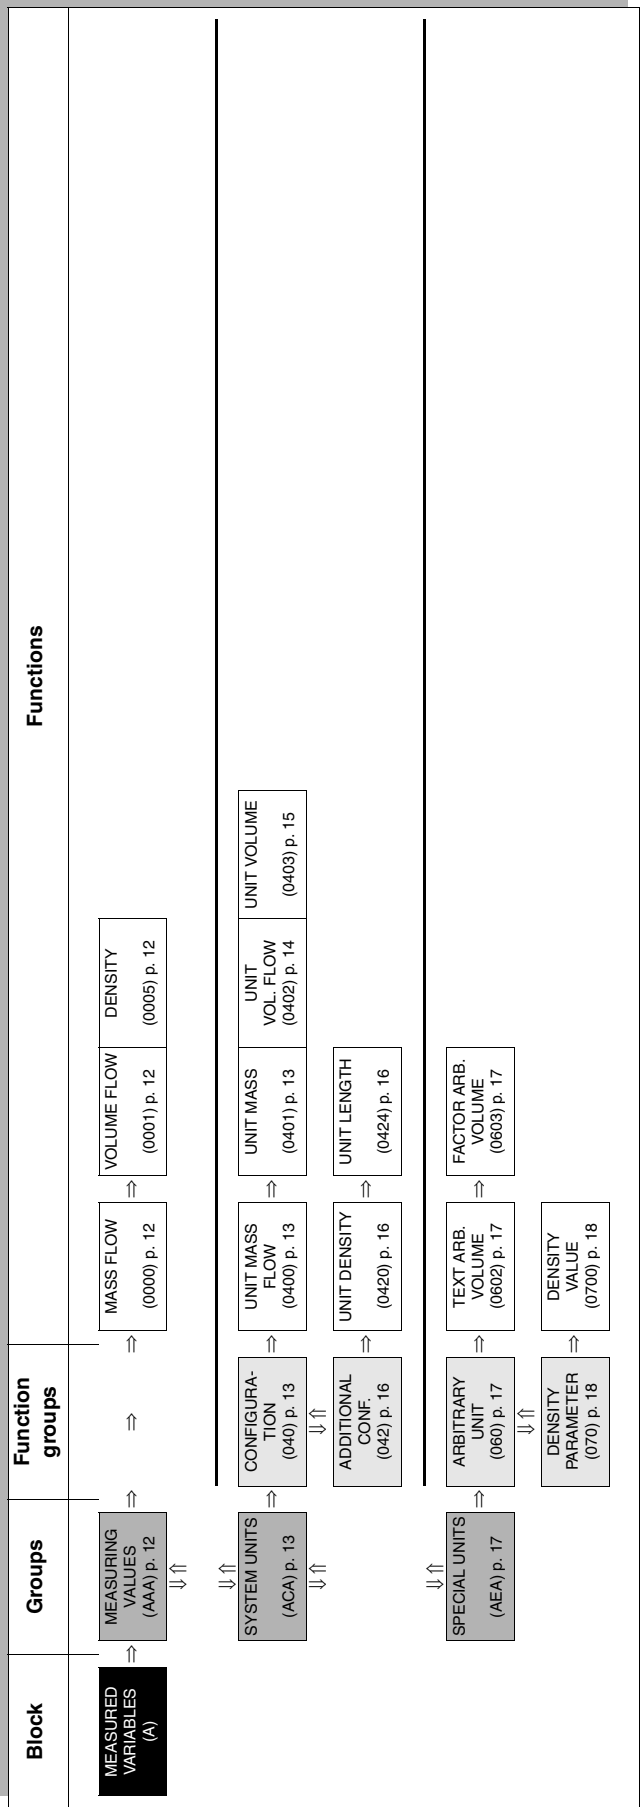


3.1 Group MEASURING VALUES

MEASURED VARIABLES A ⇒ MEASURING VALUES AAA ⇒ Measuring value functions

Function description	
MEASURED VARIABLES → MEASURING VALUES → Measuring value functions	
 Note! • The engineering units of all the measured variables shown here can be set in the “SYSTEM UNITS” group. • If the fluid in the pipe flows backwards, a negative sign prefixes the flow reading on the display.	
CALCULATED MASS FLOW (0000)	The calculated mass flow appears on the display. The mass flow is derived from the measured volume flow and the fixed (or temperature-compensated) density. User interface 5-digit floating-point number, including unit and sign (e.g. 462.87 kg/h; - 731.63 lb/min; etc.)
VOLUME FLOW (0001)	The volume flow currently measured appears on the display. User interface 5-digit floating-point number, including unit and sign (e.g. 5.5445 dm³/min; 1.4359 m³/h; -731.63 gal/d; etc.)
DENSITY (0005)	The fixed density appears on the display. User interface 5-digit floating-point number, including unit (corresponding to 0.100000...6.00000 kg/dm³) e.g. 1.2345 kg/dm³; 993.5 kg/m³; 1.0015 SG_20 °C; etc.

3.2 Group SYSTEM UNITS

 3.2.1 Function group CONFIGURATION




Function description	
MEASURED VARIABLES → SYSTEM UNITS → CONFIGURATION	
You can select the units for measured variables in this function group.	
UNIT MASS FLOW (0400)	Use this function to select the unit for displaying the calculated mass flow (mass/time). The mass flow is derived from the preset (compensated) specific fluid density and the measured volume flow. The unit you select here is also valid for: • Current outputs • Frequency outputs • Relay switch points (limit value for mass flow, flow direction) • Low flow cut off Options: Metric: gram → g/s; g/min; g/h; g/day Kilogram → kg/s; kg/min; kg/h; kg/day Metric ton → t/s; t/min; t/h; t/day US: ounce → oz/s; oz/min; oz/h; oz/day pound → lb/s; lb/min; lb/h; lb/day ton → ton/s; ton/min; ton/h; ton/day Factory setting: Depends on nominal diameter and country (kg/min...t/h or US-lb/min...US-ton/h), corresponding to the full scale value unit (see Page 141 ff.) factory setting.
UNIT MASS (0401)	Use this function to select the unit for displaying the calculated mass. The mass is derived from the preset (compensated) specific fluid density and the measured volume. The unit you select here is also valid for: • Pulse value (e.g. kg/p) Options: Metric → g; kg; t US → oz; lb; ton Factory setting: Depends on nominal diameter or country (kg...t or US-lb...US-ton), corresponding to the totalizer unit (see Page 141 ff.) factory setting.  Note! The unit for the totalizers is independent of your choice here. The unit for each totalizer is selected separately for the totalizer in question.

Function description	
MEASURED VARIABLES → SYSTEM UNITS → CONFIGURATION	
UNIT VOLUME FLOW (0402)	Use this function to select the unit for displaying the volume flow (volume/time). The unit you select here is also valid for: • Current outputs • Frequency outputs • Relay switch points (limit value for volume flow, flow direction) • Low flow cut off Options: Metric: Cubic centimeter → cm³/s; cm³/min; cm³/h; cm³/day Cubic decimeter → dm³/s; dm³/min; dm³/h; dm³/day Cubic meter → m³/s; m³/min; m³/h; m³/day Milliliter → ml/s; ml/min; ml/h; ml/day Liter → l/s; l/min; l/h; l/day Hectoliter → hl/s; hl/min; hl/h; hl/day Megaliter → Ml/s; Ml/min; Ml/h; Ml/day US: Cubic centimeter → cc/s; cc/min; cc/h; cc/day Acre foot → af/s; af/min; af/h; af/day Cubic foot → ft³/s; ft³/min; ft³/h; ft³/day Fluid ounce → oz f/s; oz f/min; oz f/h; oz f/day Gallon → gal/s; gal/min; gal/h; gal/day Million gallon → Mgal/s; Mgal/min; Mgal/h; Mgal/day Barrel (normal fluids: 31.5 gal/bbl) → bbl/s; bbl/min; bbl/h; bbl/day Barrel (beer: 31.0 gal/bbl) → bbl/s; bbl/min; bbl/h; bbl/day Barrel (petrochemicals: 42.0 gal/bbl) → bbl/s; bbl/min; bbl/h; bbl/day Barrel (filling tanks: 55.0 gal/bbl) → bbl/s; bbl/min; bbl/h; bbl/day Imperial Gallon → gal/s; gal/min; gal/h; gal/day Mega gallon → Mgal/s; Mgal/min; Mgal/h; Mgal/day Barrel (beer: 36.0 gal/bbl) → bbl/s; bbl/min; bbl/h; bbl/day Barrel (petrochemicals: 34.97 gal/bbl) → bbl/s; bbl/min; bbl/h; bbl/day Arbitrary unit (see function group ARBITRARY UNIT on Page 17) ____ → ____/s; ____/min; ____/h; ____/day Factory setting: Depends on nominal diameter and country (dm³/min...m³/h or US-gal/min...US-Mgal/day), corresponding to the factory setting of the full scale value unit (see Page 141 ff.).  Note! If you defined a unit of volume in the ARBITRARY UNIT 060 function group (see Page 17) the unit in question is shown here.

Function description	
MEASURED VARIABLES → SYSTEM UNITS → CONFIGURATION	
UNIT VOLUME (0403)	Use this function to select the unit for displaying the volume. The unit you select here is also valid for: • Pulse weighting (e.g. m³/p) Options: Metric → cm³; dm³; m³; ml; l; hl; Ml US → cc; af; ft³; oz f; gal; Mgal; bbl (normal fluids); bbl (beer); bbl (petrochemicals); bbl (filling tanks) Imperial → gal; Mgal; bbl (beer); bbl (petrochemicals) Arbitrary unit → _ _ _ _ (see function group ARBITRARY UNIT on Page 17) Factory setting: Depends on nominal diameter and country (dm³...m³ or US-gal...US-Mgal), corresponding to the totalizer unit (see Page 141 ff.) factory setting.  Note! • If you defined a unit of volume in the ARBITRARY UNIT 060 function group (see Page 17) the unit in question is shown here. • The unit of the totalizers is independent of your choice here. The unit for each totalizer is selected separately for the totalizer in question.


3.2.2 Function group ADDITIONAL CONFIGURATION

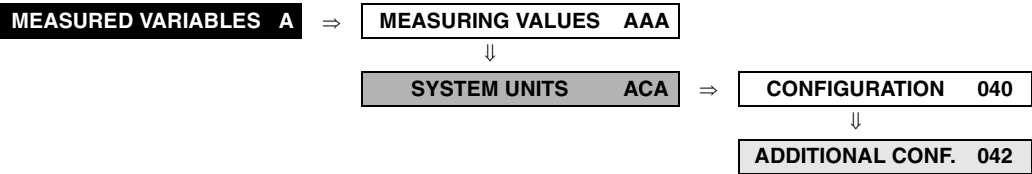

Function description	
MEASURED VARIABLES → SYSTEM UNITS → ADDITIONAL CONFIGURATION	
UNIT DENSITY (0420)	Use this function to select the unit for displaying the fluid density. The unit you select here is also valid for: Fluid density entry Options: Metric → g/cm³; g/cc; kg/dm³; kg/l kg/m³; SD 4 °C, SD 15 °C, SD 20 °C; SG 4 °C, SG 15 °C, SG 20 °C US → lb/ft³; lb/gal; lb/bbl (normal fluids); lb/bbl (beer); lb/bbl (petrochemicals); lb/bbl (filling tanks) Imperial → lb/gal; lb/bbl (beer); lb/bbl (petrochemicals) Factory setting: Country-dependent (kg/l or g/cc), see factory setting Page 141 ff. SD = Specific Density, SG = Specific Gravity The specific density is the ratio of fluid density to water density (at water temperature = 4, 15, 20 °C).
UNIT LENGTH (0424)	Use this function to select the unit for displaying the length of the nominal diameter. The unit you select here is also valid for: Nominal diameter of sensor (function NOMINAL DIAMETER (6804) on Page 104) Options: MILLIMETER INCH Factory setting: Country-dependent (MILLIMETER or INCH), see factory setting Page 141 ff.


3.3 Group SPECIAL UNITS

3.3.1 Function group ARBITRARY UNIT

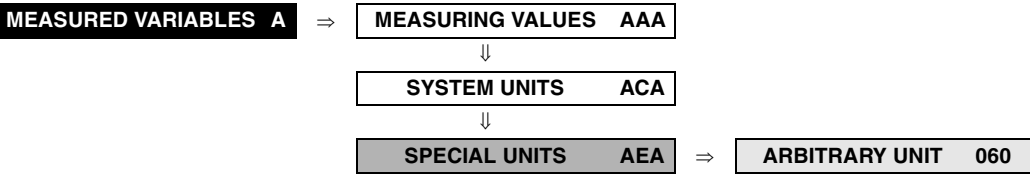

Function description	
MEASURED VARIABLES → SPECIAL UNITS → ARBITRARY UNIT	
Use this function group to define an arbitrary unit for the flow rate variable.	
TEXT ARBITRARY VOLUME (0602)	Use this function to enter a text for the selectable volume unit / volume flow unit. You define only the text, the unit of time is provided from a choice of options (s, min, h, day). User input: xxxxxxx (max. 4 characters) Valid characters are A-Z, 0-9, +, -, decimal point, white space or underscore Factory setting: " _ _ _ _ " (No text) Example: If your text entry is "GLAS", this text string appears on the display complete with the unit of time, e.g. "GLAS/min": GLAS = Volume (text input) GLAS / min = Volume flow as shown (on the display)
FACTOR ARBITRARY VOLUME (0603)	Use this function to define a quantity factor (without time) for the selectable unit. The volume unit on which this factor is based is one liter. User input: 7-digit floating-point number Factory setting: 1 Reference quantity: Liter Example: The volume of a glass is 0.5 l → 2 glasses = 1 liter User input: 2

3.3.2 Function group DENSITY PARAMETER

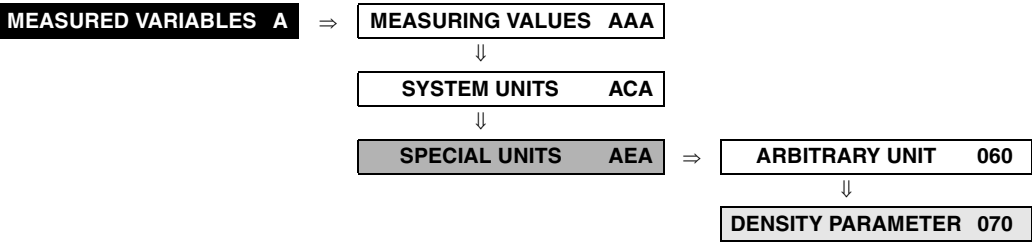

Function description	
MEASURED VARIABLES → SPECIAL UNITS → DENSITY PARAMETER	
 Note! This function group does not appear if the density is imported via the current input and the DENSITY option was selected in the function ASSIGN CURRENT INPUT (5200). Use this function group to calculate a mass flow from a volume flow. The thermal expansion of the fluid can be compensated if the measuring device is provided with the fluid process temperature by means of a current input.  Note! It is advisable to enter the density factor at process temperature for calculating the mass flow without compensating for thermal expansion. Example of calculated mass flow without compensation for thermal expansion of the fluid: $\dot{m} = \dot{V} \cdot \rho = 1 \text{ [dm}^3\text{/h]} \times 0.900 \text{ [kg/l]} = 0.900 \text{ [kg/h]} \text{ (mass flow at 20 °C)}$$\dot{m} = \dot{V} \cdot \rho = 1 \text{ [dm}^3\text{/h]} \times 0.783 \text{ [kg/l]} = 0.783 \text{ [kg/h]} \text{ (mass flow at 150 °C)}$ Example of calculated mass flow with compensation for thermal expansion of the fluid: $\dot{m} = \text{Mass flow [kg/h]}$$\dot{V} = \text{Volume flow} = 1 \text{ [dm}^3\text{/h]}$$\rho = \text{Density factor} = 0.9 \text{ [kg/l]} \text{ see function DENSITY (0700)}$$T_{Ref} = \text{Reference temperature} = 20 \text{ [°C]} \text{ see function REFERENCE TEMPERATURE (0701)}$$T_{Pro} = \text{Process temperature of the fluid} = 150 \text{ [°C]} \text{ via current input}$$\epsilon = \text{Vol. expansion coefficient} = 1 \times 10^{-3} \text{ [1/K]}, \text{ see function EXPANSION COEFFICIENT (0702)}$$\dot{m} = \dot{V} \cdot \rho \cdot \{1 + \epsilon \cdot (T_{Ref} - T_{Pro})\}$$\dot{m} = 1 \text{ [dm}^3\text{/h]} \times 0.9 \text{ [kg/l]} \times \{1 + 1 \times 10^{-3} \text{ [1/K]} \times (20 \text{ [°C]} - 150 \text{ [°C]})\}$$\dot{m} = 0.783 \text{ [kg/h]}$	
DENSITY VALUE (0700)	Use this function to enter a density factor preferably at process temperature (or at reference temperature). This density factor is used to convert the volume flow to a mass flow. User input: 5-digit floating-point number Factory setting: 1 [unit]  Note! The appropriate unit is taken from the function UNIT DENSITY (0420), (see Page 16).


4 Block QUICK SETUP

Block	Group	Function groups	Functions
QUICK SETUP (B)	⇒	⇒	QS COMMISSION (1002) p. 19 ⇒ QS PULSATING FLOW (1003) p. 19 QS BATCHING (1005) p. 19 T-DAT SAVE/LOAD (1009) p. 20

Function description	
QUICK SETUP	
QUICK SETUP COMMISSION (1002)	Use this function to start the Setup menu for commissioning. Options: YES NO Factory setting: NO  Note! You will find a flowchart of the COMMISSIONING Setup menu on Page 21. For more information on Setup menus, please refer to the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en.
QUICK SETUP PULSATING FLOW (1003)	Use this function to start the application-specific Setup menu for pulsating flow. Options: YES NO Factory setting: NO  Note! You will find a flowchart of the PULSATING FLOW Setup menu on Page 23. For more information on Setup menus, please refer to the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en.
QUICK SETUP BATCHING/DOSING (1005)	 Note! This function is not available unless the optional software package BATCHING is installed and at least one relay output is available. Use this function to start the (optional) application-specific Setup menu for batching. Options: YES NO Factory setting: NO  Note! You will find a flowchart of the BATCHING Setup menu on Page 25. For more information on Setup menus, please refer to the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en.

Function description	
QUICK SETUP	
T-DAT SAVE/LOAD (1009)	Use this function to save the parameter settings / configuration of the transmitter in a transmitter DAT (T-DAT), or to load the parameter settings from the T-DAT into the EEPROM (manual security function). Application examples: • After commissioning, the current measuring point parameters can be saved to the T-DAT as a backup. • If the transmitter is replaced for some reason, the data from the T-DAT can be loaded into the new transmitter (EEPROM). Options: CANCEL SAVE (from EEPROM to T-DAT) LOAD (from the T-DAT into EEPROM) Factory setting: CANCEL  Note! If the power supply fails, the totalizer readings are automatically saved to the EEPROM.

4.0.1 Setup Commissioning

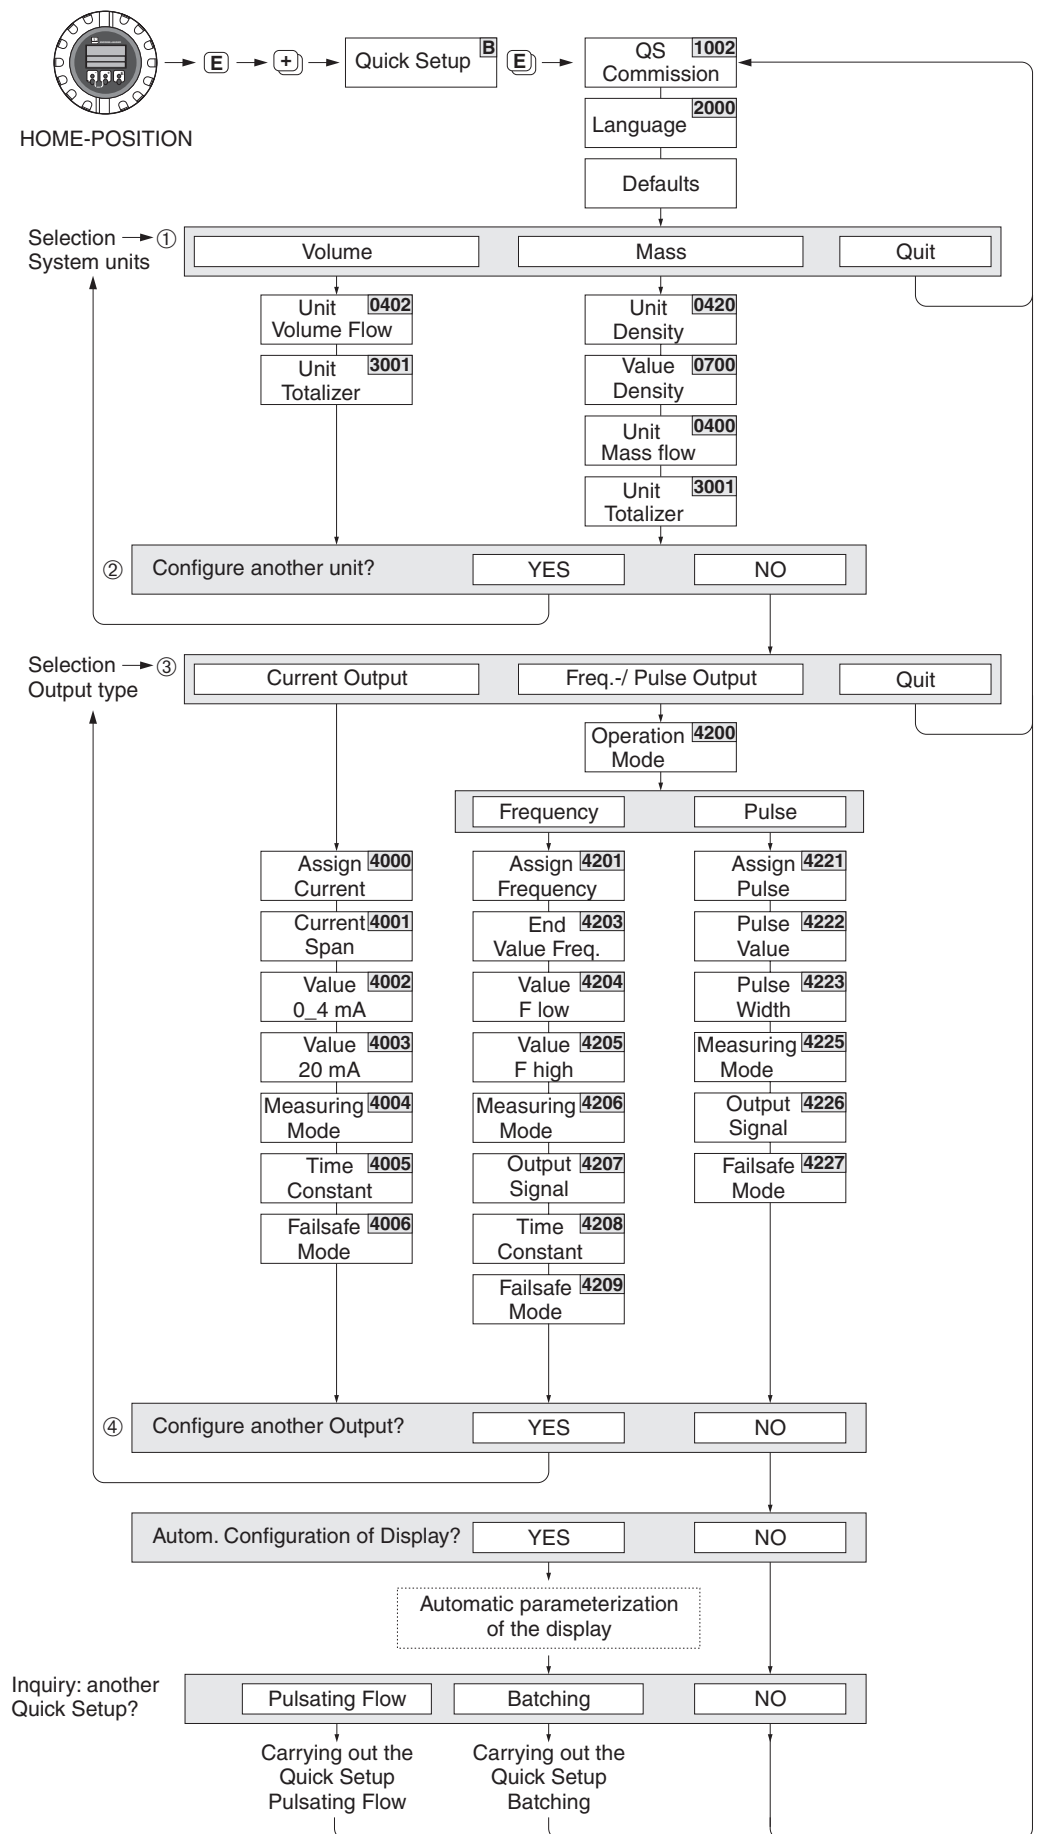


F-53xxxx-19-xx-xx-en-000



Note!

- The display returns to the cell QUICK SETUP COMMISSION (1002) if you press the ESC key combination during parameter interrogation.
- ① Only units not yet configured in the current Setup are offered for selection in each cycle. The unit for volume is derived from the volume flow unit.
- ② The “YES” option remains visible until all the units have been parameterized. “NO” is the only option displayed when no further units are available.
- ③ Only the outputs not yet configured in the current Setup are offered for selection in each cycle.
- ④ The “YES” option remains visible until all the outputs have been parameterized. “NO” is the only option displayed when no further outputs are available.

4.0.2 Pulsating flow Setup menu

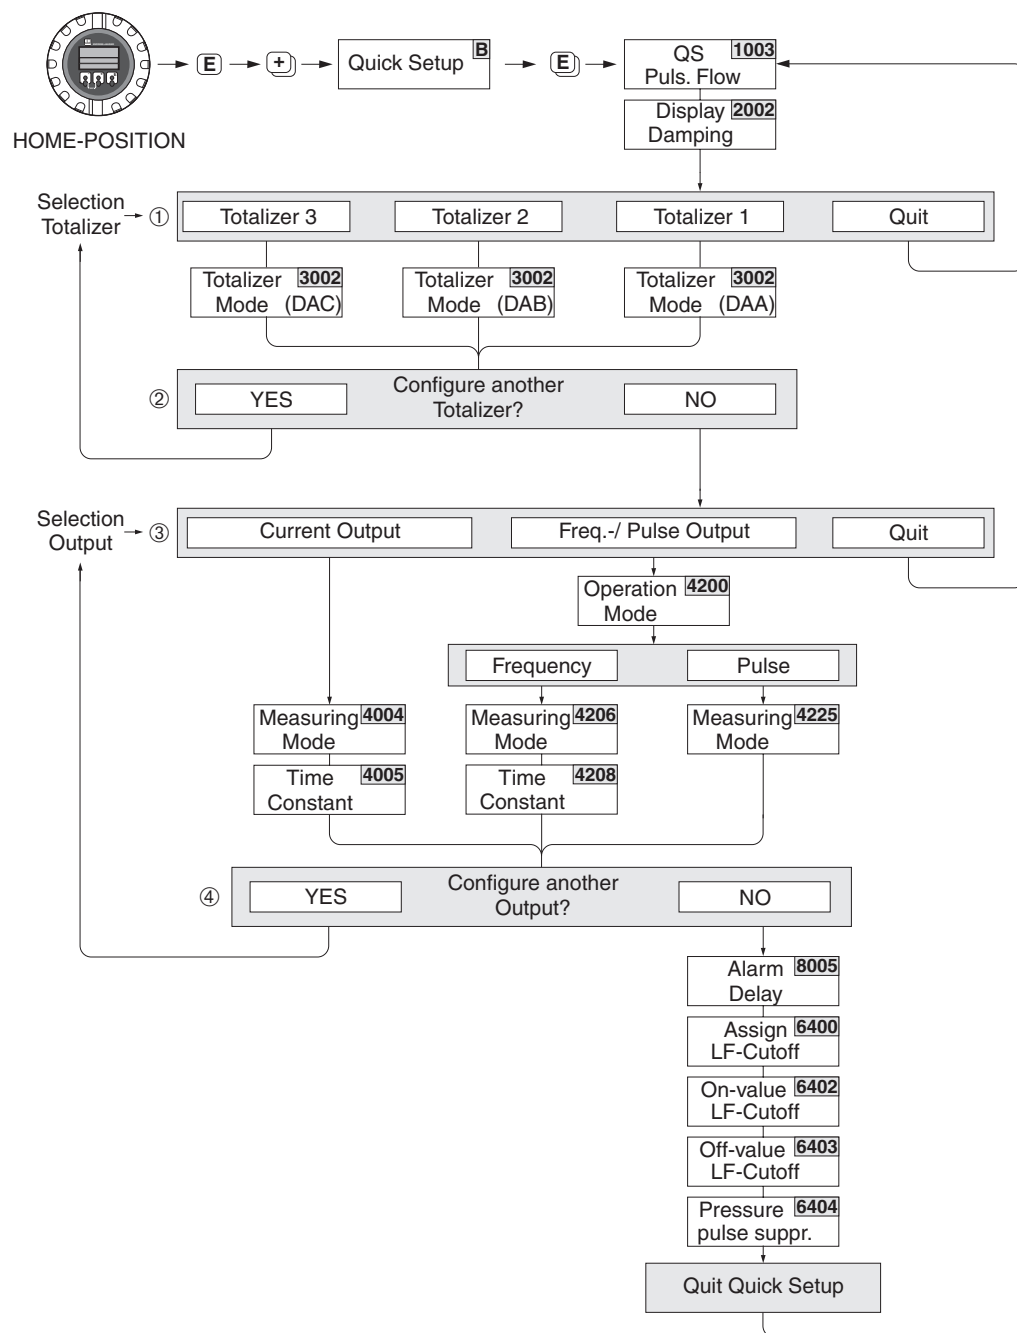

F-53xxxx-19-xx-xx-en-001



Note!

- The display returns to the cell QUICK SETUP PULSATING FLOW (1003) if you press the ESC key combination during parameter interrogation.
- You can call up this Setup menu either directly from the "COMMISSIONING" Setup menu or manually by means of the function QUICK SETUP PULSATING FLOW (1003).
- ① Only totalizers not yet configured in the current Setup are offered for selection in each cycle.
- ② The "YES" option remains visible until all the totalizers have been parameterized. "NO" is the only option displayed when no further totalizers are available.
- ③ Only the outputs not yet configured in the current Setup are offered for selection in each cycle.
- ④ The "YES" option remains visible until all the outputs have been parameterized. "NO" is the only option displayed when no further outputs are available.

Settings for the pulsating flow Setup menu:			
Fct. code	Function name	Suggested settings	Description
Call up through the function matrix:			
B	QUICK SETUP	QUICK SETUP PULSATING FLOW	see P. 19
1003	QUICK SETUP PULSATING FLOW	YES	see P. 19
Basic configuration:			
2002	DISPLAY DAMPING	1 s	see P. 28
3002	TOTALIZER MODE (DAA)	BALANCE	see P. 45
3002	TOTALIZER MODE (DAB)	BALANCE	see P. 45
3002	TOTALIZER MODE (DAC)	BALANCE	see P. 45
Select the signal type: CURRENT OUTPUT (1...2)			
4004	MEASURING MODE	PULSATING FLOW	see P. 53
4005	TIME CONSTANT	1 s	see P. 55
Select the signal type: FREQ./PULSE OUTPUT (1...2) / operating mode: FREQUENCY			
4206	MEASURING MODE	PULSATING FLOW	see P. 63
4208	TIME CONSTANT	0 s	see P. 65
Select the signal type: FREQ./PULSE OUTPUT (1...2) / operating mode: PULSE			
4225	MEASURING MODE	PULSATING FLOW	see P. 68
Other settings:			
8005	ALARM DELAY	0 s	see P. 134
6400	ASSIGN LOW FLOW CUT OFF	VOLUME FLOW	see P. 95
6402	ON-VALUE LOW FLOW CUT OFF	see table below	see P. 95
6403	OFF-VALUE LOW FLOW CUT OFF	50%	see P. 95
6404	PRESSURE SHOCK SUPPRESSION	0 s	see P. 96


Recommended settings for the function ASSIGN LOW FLOW CUT OFF (6400):

DN [mm]	dm ³ /min		US-gal/min
2	0.002	or	0.001
4	0.007	or	0.002
8	0.03	or	0.008
15	0.1	or	0.03
25	0.3	or	0.08
32	0.5	or	0.15
40	0.7	or	0.2
50	1.1	or	0.3
65	2.0	or	0.5
80	3.0	or	0.8
100	4.7	or	1.3

The recommended values correspond to the max. full scale value per DN divided by 1000 (see Operating Instructions *PROline promag 53*, BA 047D/06/en, Chapter "Installation", → nominal diameters and flow rates).

4.0.3 Batching Setup menu

This Setup menu guides the user systematically through all the device functions that have to be adjusted and configured for batching operation. The Setup menu settings result in a (simple) one-stage batching process. The parameters for any additional settings, e.g. for automatic compensation of after-runs or multi-stage batching, must be manually set in the function matrix.

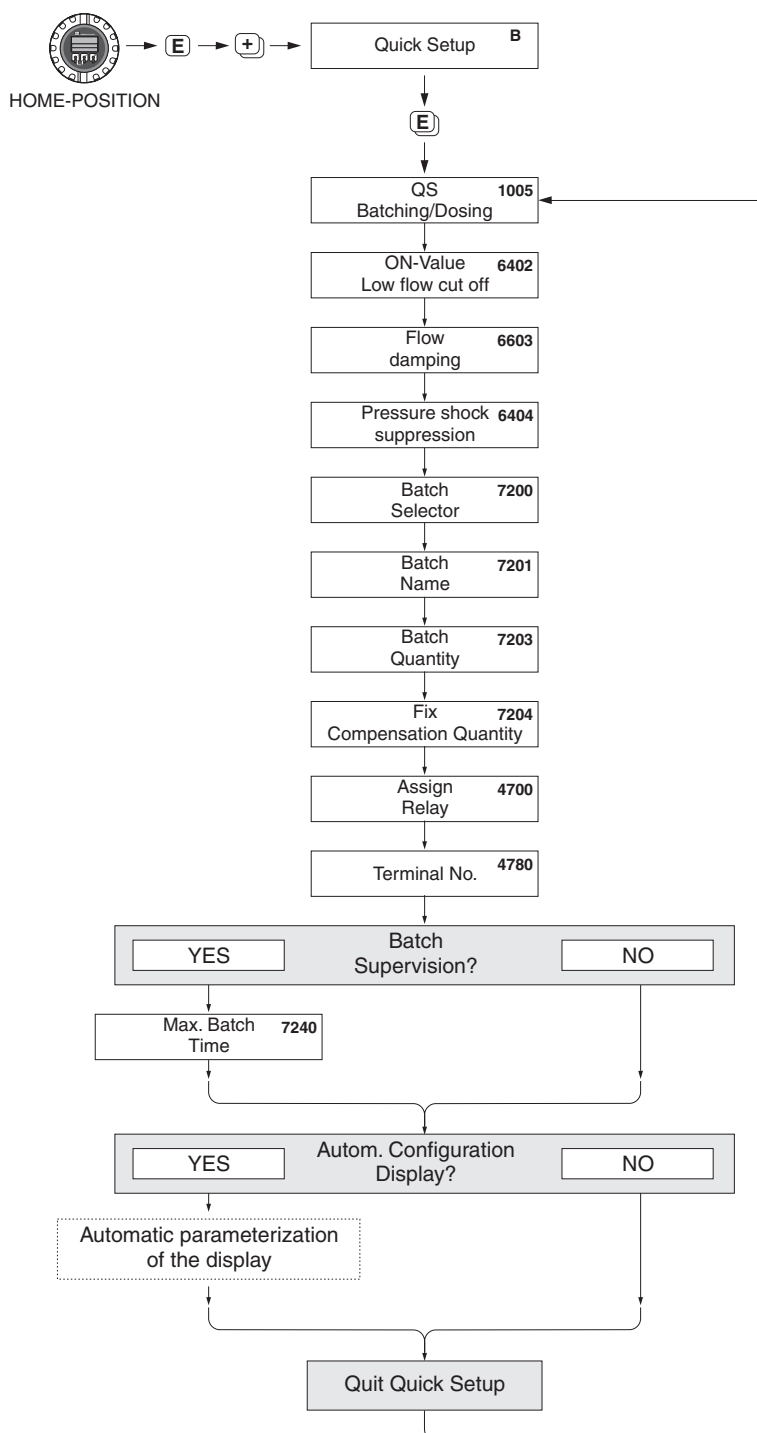

F06-53xxxx-19-xx-xx-en-002



Note!

- This Setup menu is only available if the optional software package BATCHING is installed in the measuring device. By means of the order option, the software package can already be installed in the measuring device when delivered from the factory or it can be ordered at a later date from Endress + Hauser and installed as an optional software package.

- The display returns to the function QUICK SETUP BATCHING/DOSING (1005), if you press the ESC key combination during parameter interrogation.
- At the start of the Setup, general device parameters are optimally configured for measuring signal processing and output response.
- Then you can enter the specific batching parameters, starting with the options list "Batching 1...6". In this way, by running through the Setup menu a number of times, up to six different batching parameter sets (incl. special naming) can be created and called up as necessary.
- In order to enjoy full functionality, it is advisable to let the display parameters be set automatically. This means that the lowest display line is parameterised as the batching menu. Softkeys are displayed which can be used to start or stop the batching process in the HOME position. In this way, the measuring device can be fully deployed as a "batch controller".

**Caution!**

By running the Setup, certain device parameters are optimally set for discontinuous operation. Should the measuring device be used for continuous flow measurement at a later time, we recommend you to rerun the "COMMISSIONING" or the "PULSATING FLOW" Setup.

Settings for the Batching Setup menu:

Fct. code	Function name	Suggested settings	Description
Call up through the function matrix:			
B	QUICK SETUP	QUICK SETUP BATCHING	see P. 19
1005	QUICK SETUP BATCHING	YES	see P. 19
Settings (functions with a grey background are set automatically):			
6400	ASSIGN LOW FLOW CUT OFF	MASS	see P. 95
6402	ON-VALUE LOW FLOW CUT OFF	Table value (see page 141)	see P. 95
6403	OFF-VALUE LOW FLOW CUT OFF	50%	see P. 95
6603	FLOW DAMPING	0 seconds	see P. 102
6404	PRESSURE SHOCK SUPPRESSION	0 seconds	see P. 96
7200	BATCH SELECTOR	BATCH #1	see P. 108
7202	BATCH NAME	BATCH #1	see P. 108
7201	ASSIGN BATCH VARIABLE	MASS	see P. 109
7203	BATCH QUANTITY	0	see P. 109
7204	FIX COMPENSATION QUANTITY	0	see P. 109
7205	COMENSATION MODE	OFF	see P. 110
7208	BATCH STAGES	1	see P. 113
7209	INPUT FORMAT	Value input	see P. 113
4700	ASSIGN RELAY	BATCHING VALVE 1	see P. 78
4780	TERMINAL NUMBER	Output (display only)	see P. 84
7220	OPEN VALVE 1	0% or 0 [unit]	see P. 114
7240	MAXIMUM BATCHING TIME	0 seconds (Off)	see P. 119
7241	MINIMUM BATCHING QUANTITY	0% or 0 [unit]	see P. 120
7242	MAXIMUM BATCHING QUANTITY	0% or 0 [unit]	see P. 121
2200	ASSIGN (Main line)	BATCH NAME	see P. 31
2220	ASSIGN (Multiplex main line)	Off	see P. 33
2400	ASSIGN (Additional line)	BATCH DOWNWARDS	see P. 35
2420	ASSIGN (Multiplex additional line)	Off	see P. 37
2600	ASSIGN (Info line)	BATCHING KEYS	see P. 39
2620	ASSIGN (Multiplex info line)	Off	see P. 41

5 Block USER INTERFACE

 
Block	Groups	Function groups	Functions
USER INTER- FACE (C)	CONTROL (CAA) p. 28	BASIC CONFIG. (200) p. 28	LANGUAGE (2000) p. 28
			CONTRAST LCD (2003) p. 28
		UN-/LOCKING (202) p. 29	DISPLAY DAMPING (2002) p. 28
			DEF. PRIVATE CODE (2021) p. 29
	OPERATION (204) p. 30	ACCESS CODE (2020) p. 29	STATUS ACCESS (2022) p. 29
		TEST DISPLAY (2040) p. 30	
	MAIN LINE (CCA) p. 31	CONFIGURA- TION (220) p. 31	100% VALUE (2201) p. 31
			FORMAT (2202) p. 32
		MULTIPLY (222) p. 33	100% VALUE (2221) p. 33
			FORMAT (2222) p. 34
	ADDITIONAL LINE (CEA) p. 35	CONFIGURA- TION (240) p. 35	100% VALUE (2401) p. 36
			FORMAT (2402) p. 36
		MULTIPLY (242) p. 37	100% VALUE (2421) p. 38
			FORMAT (2422) p. 38
	INFORMATION LINE (CGA) p. 39	CONFIGURA- TION (260) p. 39	100% VALUE (2601) p. 40
			FORMAT (2602) p. 40
		MULTIPLY (262) p. 41	100% VALUE (2621) p. 42
			FORMAT (2622) p. 42

5.1 Group CONTROL

5.1.1 Function group BASIC CONFIGURATION


USER INTERFACE C ⇒ CONTROL CAA ⇒ BASIC CONFIGURATION 200	
Function description	
USER INTERFACE → CONTROL → BASIC CONFIGURATION	
LANGUAGE (2000)	Use this function to select the language for all texts, parameters and messages shown on the local display. Options: ENGLISH DEUTSCH FRANCAIS ESPANOL ITALIANO NEDERLANDS DANSK NORSK SVENSKA SUOMI BAHASA INDONESIA JAPANESE (syllabary) Factory setting: Country-dependent, see factory setting Page 142 ff.  Note! If you press the  keys at startup, the language defaults to “ENGLISH”.
DISPLAY DAMPING (2002)	Use this function to enter a time constant defining how the display reacts to severely fluctuating flow variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). User input: 0...100 seconds Factory setting: 1 s  Note! Setting the time constant to zero seconds switches off damping.
CONTRAST LCD (2003)	Use this function to optimize display contrast to suit local operating conditions. User input: 10...100% Factory setting: 50%

5.1.2 Function group UNLOCKING/LOCKING



Function description	
USER INTERFACE → CONTROL → UNLOCKING/LOCKING	
ACCESS CODE (2020)	All data of the measuring system are protected against inadvertent change. Programming is disabled and the settings cannot be changed until a code is entered in this function. If you press the  keys in any function, the measuring system automatically goes to this function and the prompt to enter the code appears on the display (when programming is disabled). You can enable programming by entering your personal code (factory setting = 53, see function DEFINE PRIVATE CODE(2021)). User input: max. 4-digit number: 0 ...9999  Note! • Programming is disabled if you do not press a key within 60 seconds following automatic return to the HOME position. • You can also disable programming in this function by entering any number (other than the defined private code). • The Endress+Hauser service organization can be of assistance if you mislay your personal code.
DEFINE PRIVATE CODE (2021)	Use this function to specify a personal code for enabling programming in the function ACCESS CODE. User input: 0...9999 (max. 4-digit number) Factory setting: 53  Note! • Programming is always enabled with the code "0". • Programming has to be enabled before this code can be changed. When programming is disabled this function is not available, thus preventing others from accessing your personal code.
STATUS ACCESS (2022)	Use this function to check the access status for the function matrix. User Interface: ACCESS CUSTOMER (parameterization possible) LOCKED (parameterization disabled)


5.1.3 Function group OPERATION

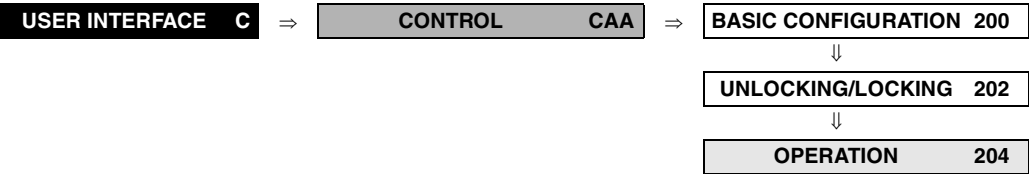


Function description	
USER INTERFACE → CONTROL → OPERATION	
TEST DISPLAY (2040)	Use this function to test the operability of the local display and its pixels. Options: OFF ON Factory setting: OFF Test sequence: 1. Start the test by selecting ON. 2. All pixels of the main line, additional line and information line are darkened for minimum 0.75 seconds. 3. Main line, additional line and information line show an "8" in each field for minimum 0.75 seconds. 4. Main line, additional line and information line show a "0" in each field for minimum 0.75 seconds. 5. Main line, additional line and information line show nothing (blank display) for minimum 0.75 seconds. When the test completes the local display returns to its initial state and the setting changes to OFF.

5.2 Group MAIN LINE

 
5.2.1 Function group CONFIGURATION



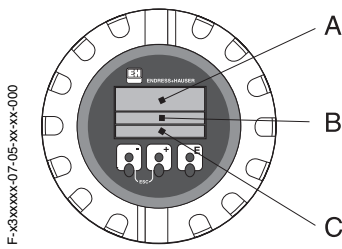Function description	
USER INTERFACE → MAIN LINE → CONFIGURATION	
 A = main line, B = additional line, C = information line	
ASSIGN (2200)	In this function, a value to be displayed is assigned to the main line (top line in the local display). This value is displayed during normal operation. Options: OFF VOLUME FLOW MASS FLOW VOLUME FLOW IN % MASS FLOW IN % ACTUAL CURRENT (1...2) ACTUAL FREQUENCY (1...2) TOTALIZER (1...3) Advanced options with optional software package BATCHING: BATCH NAME (BATCH # 1" or "BEER 330", etc.) BATCH QUANTITY (overall quantity to be batched) BATCH COUNTER (batching processes carried out) BATCH SUM (effective total batching quantity)  Note! The options given in the BATCHING software package always refer to the batching selected ("BATCH # 1", "BATCH # 2", etc.) in the function BATCH SELECTOR (Page 108). Example: If the option BATCH # 1 was selected in function BATCH SELECTOR (7200), then only the values of BATCH # 1 (batch name, batch quantity, etc.) can be displayed. Factory setting: VOLUME FLOW
100% VALUE (2201)	 Note! This function is only available if VOLUME FLOW IN % or MASS FLOW IN % was selected in the function ASSIGN (2200). Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.).

Function description	
USER INTERFACE → MAIN LINE → CONFIGURATION	
FORMAT (2202)	Use this function to define the maximum number of places after the decimal point displayed for the reading in the main line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX -X.XXXX Factory setting: X.XXXX  Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.

5.2.2 Function group MULTIPLEX

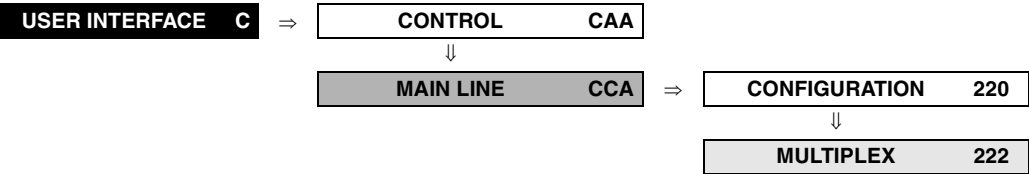


Function description	
USER INTERFACE → MAIN LINE → MULTIPLEX	
ASSIGN (2220)	Use this function to define the second reading to be displayed in the main line alternately (every 10 seconds) with the value defined in the ASSIGN function (2200). Options: OFF VOLUME FLOW MASS FLOW VOLUME FLOW IN % MASS FLOW IN % ACTUAL CURRENT (1...2) ACTUAL FREQUENCY (1...2) TOTALIZER (1...3) Advanced options with optional software package BATCHING: BATCH NAME ("BATCH # 1" or "BEER 330", etc.) BATCH QUANTITY (overall quantity to be batched) BATCH COUNTER (batching processes carried out) BATCH SUM (effective total batching quantity) Note! The options given in the BATCHING software package always refer to the batching selected ("BATCH # 1", "BATCH # 2", etc.) in the function BATCH SELECTOR (Page 108). Example: If the option BATCH # 1 was selected in the function BATCH SELECTOR (7200), then only the values of BATCH # 1 (batch name, batch quantity, etc.) can be displayed. Factory setting: OFF
100% VALUE (2221)	Note! This function is only available if VOLUME FLOW IN % or MASS FLOW IN % was selected in the function ASSIGN (2220). Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.).

Function description	
USER INTERFACE → MAIN LINE → MULTIPLEX	
FORMAT (2222)	Use this function to define the maximum number of places after the decimal point for the second value displayed in the main line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX -X.XXXX Factory setting: X.XXXX  Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.

Function description	
USER INTERFACE → ADDITIONAL LINE → CONFIGURATION	
100% VALUE (2401)	 Note! This function is not available unless one of the following was selected in the function ASSIGN (2400): • VOLUME FLOW IN % • MASS FLOW IN % • VOLUME FLOW BARGRAPH IN % • MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.).
FORMAT (2402)	 Note! This function is not available unless a number was selected in the function ASSIGN (2400). Use this function to define the maximum number of places after the decimal point displayed for the reading in the additional line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX -X.XXXX Factory setting: X.XXXX  Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.
DISPLAY MODE (2403)	 Note! This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2400). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +25 +50 +75 % F-x3xxxx-20-xx-xx-xx-000 SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign). -50 +50 % F-x3xxxx-20-xx-xx-xx-001 Factory setting: STANDARD

5.3.2 Function group MULTIPLEX

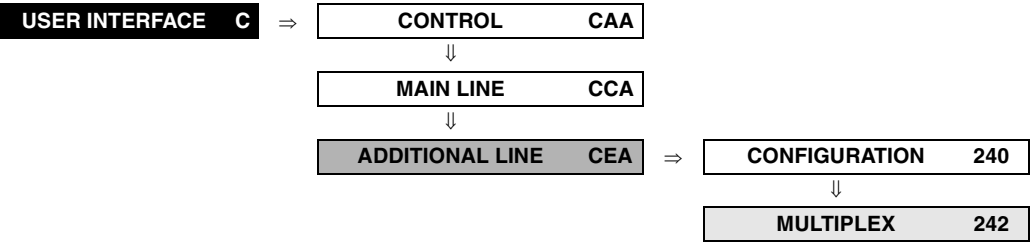



Function description	
USER INTERFACE → ADDITIONAL LINE → MULTIPLEX	
ASSIGN (2420)	Use this function to define the second reading to be displayed in the additional line alternately (every 10 seconds) with the value defined in the function ASSIGN (2400). Options: OFF VOLUME FLOW MASS FLOW VOLUME FLOW IN % MASS FLOW IN % VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % FLOW VELOCITY ACTUAL CURRENT (1...2) ACTUAL FREQUENCY (1...2) TOTALIZER (1...3) TAG NAME BLANK LINE Advanced options with optional software package BATCHING: BATCH NAME ("BATCH # 1" or "BEER 330", etc.) BATCH QUANTITY (overall quantity to be batched) BATCH COUNTER (batching processes carried out) BATCH SUM (effective total batching quantity) BATCH UPWARDS (batching progress upwards) BATCH DOWNWARDS (batching progress downwards)  Note! The options given in the BATCHING software package always refer to the batching selected ("BATCH # 1", "BATCH # 2", etc.) in the function BATCH SELECTOR (Page 108). Example: If option BATCH # 1 was selected in the function BATCH SELECTOR (7200), then only the values of BATCH # 1 (batch name, batch quantity, etc.) can be displayed. Factory setting: OFF  Note! Multiplex mode is suspended as soon as a fault/notice message is generated. The message in question appears on the display. • Fault message (identified by a lightning icon): – If ON was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault has been acknowledged and is no longer active. – If OFF was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault is no longer active. • Notice message (identified by an exclamation mark): – Multiplex mode is continued as soon as the notice message is no longer active.

Function description	
USER INTERFACE → ADDITIONAL LINE → MULTIPLEX	
100% VALUE (2421)	 Note! This function is not available unless one of the following was selected in the function ASSIGN (2420): • VOLUME FLOW IN % • MASS FLOW IN % • VOLUME FLOW BARGRAPH IN % • MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.).
FORMAT (2422)	 Note! This function is not available unless a number was selected in the function ASSIGN (2420). Use this function to define the maximum number of places after the decimal point for the second value displayed in the additional line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX -X.XXXX Factory setting: X.XXXX  Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.
DISPLAY MODE (2423)	 Note! This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2420). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +25+50+75 % F-x3xxxx-20-xx-xx-xx-000 SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign). -50+50 % F-x3xxxx-20-xx-xx-xx-001 Factory setting: STANDARD

5.4 Group INFORMATION LINE


5.4.1 Function group CONFIGURATION

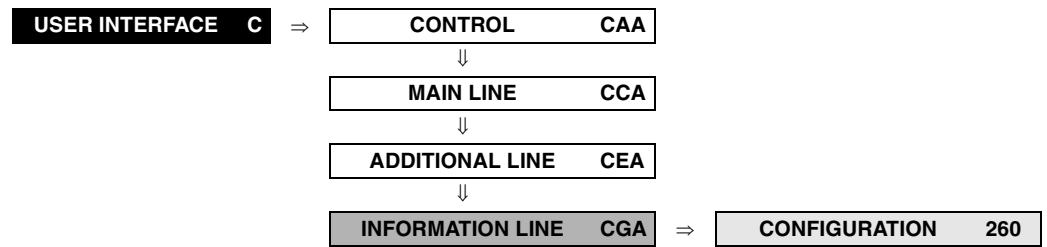

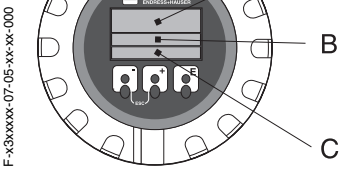Function description USER INTERFACE → INFORMATION LINE → CONFIGURATION	
 F-x3xxxxx-07-05-xx-xx-xx-000 A = main line, B = additional line, C = information line	
ASSIGN (2600)	In this function, a value to be displayed is assigned to the information line (bottom line in the local display). This value is displayed during normal operation. Options: OFF VOLUME FLOW IN % MASS FLOW IN % VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % FLOW VELOCITY ACTUAL CURRENT (1...2) ACTUAL FREQUENCY (1...2) TAG NAME OPERATING/SYSTEM CONDITIONS FLOW DIRECTION BLANK LINE Advanced options with optional software package BATCHING: BATCHING KEYS (softkeys on the local display)  Note! • If you select the BATCHING OPERATING KEYS, the multiplex display functionality (function ASSIGN (2620), etc.) is not available in the information line. • For information on the functional concept of the batching menu, see chapter "Operation" in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en. Factory setting: OPERATING/SYSTEM CONDITIONS

Function description	
USER INTERFACE → INFORMATION LINE → CONFIGURATION	
100% VALUE (2601)	 Note! This function is not available unless one of the following was selected in the function ASSIGN (2600): • VOLUME FLOW IN % • MASS FLOW IN % • VOLUME FLOW BARGRAPH IN % • MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.).
FORMAT (2602)	 Note! This function is not available unless a number was selected in the function ASSIGN (2600). Use this function to define the maximum number of places after the decimal point displayed for the reading in the information line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX -X.XXXX Factory setting: X.XXXX  Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.
DISPLAY MODE (2603)	 Note! This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2600). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +25+50+75 % F-x3xxxxx-20-xx-xx-xx-000 SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign). -50+50 % F-x3xxxxx-20-xx-xx-xx-001 Factory setting: STANDARD


5.4.2 Function group MULTIPLEX

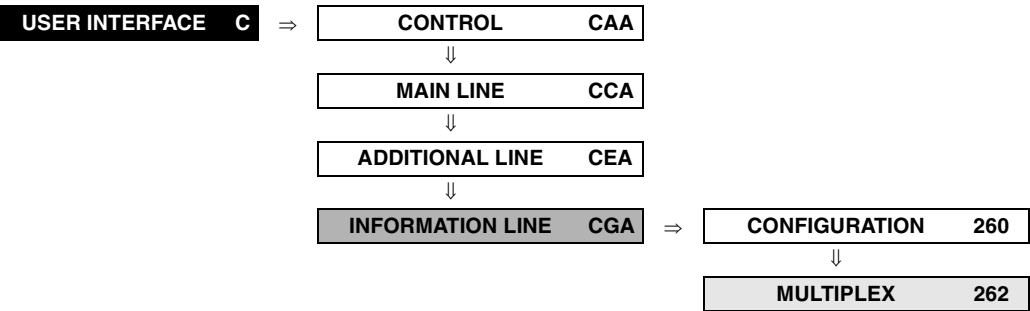

Function description	
USER INTERFACE → INFORMATION LINE → MULTIPLEX	
Note! If you select the BATCHING KEYS in the function ASSIGN (2600), the multiplex display functionality is not available in the information line.	
ASSIGN (2620)	Use this function to define the second reading to be displayed in the information line alternately (every 10 seconds) with the value defined in the function ASSIGN (2600). Options: OFF VOLUME FLOW IN % MASS FLOW IN % VOLUME FLOW BARGRAPH IN % MASS FLOW BARGRAPH IN % FLOW VELOCITY ACTUAL CURRENT (1...2) ACTUAL FREQUENCY (1...2) TAG NAME OPERATING/SYSTEM CONDITIONS DISPLAY FLOW DIRECTION BLANK LINE Factory setting: OFF Note! Multiplex mode is suspended as soon as a fault / notice message is generated. The message in question appears on the display. - Fault message (identified by a lightning icon): - If ON was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault has been acknowledged and is no longer active. - If OFF was selected in the function ACKNOWLEDGE FAULTS (8004), multiplex mode is continued as soon as the fault is no longer active. - Notice message (identified by an exclamation mark): - Multiplex mode is continued as soon as the notice message is no longer active.


Function description	
USER INTERFACE → INFORMATION LINE → MULTIPLEX	
100% VALUE (2621)	 Note! This function is not available unless one of the following was selected in the function ASSIGN (2620): • VOLUME FLOW IN % • MASS FLOW IN % • VOLUME FLOW BARGRAPH IN % • MASS FLOW BARGRAPH IN % Use this function to define the flow value to be shown on the display as the 100% value. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.).
FORMAT (2622)	 Note! This function is not available unless a number was selected in the ASSIGN function (2600). Use this function to define the maximum number of places after the decimal point for the second value displayed in the information line. Options: XXXXX. - XXXX.X - XXX.XX - XX.XXX -X.XXXX Factory setting: X.XXXX  Note! • Note that this setting only affects the reading as it appears on the display, it has no influence on the accuracy of the system's calculations. • The places after the decimal point as computed by the measuring device cannot always be displayed, depending on this setting and the engineering unit. In such instances an arrow appears on the display between the measuring value and the engineering unit (e.g. 1.2 → kg/h), indicating that the measuring system is computing with more decimal places than can be shown on the display.
DISPLAY MODE (2623)	 Note! This function is only available if VOLUME FLOW BARGRAPH IN % or MASS FLOW BARGRAPH IN % was selected in the function ASSIGN (2620). Use this function to define the format of the bar graph. Options: STANDARD (Simple bar graph with 25 / 50 / 75% gradations and integrated sign). +25 +50 +75 % F-x3xxxxx-20-xx-xx-xx-000 SYMMETRY (Symmetrical bar graph for positive and negative directions of flow, with -50 / 0 / +50% gradations and integrated sign). -50 +50 % F-x3xxxxx-20-xx-xx-xx-001 Factory setting: STANDARD

6 Block TOTALIZER

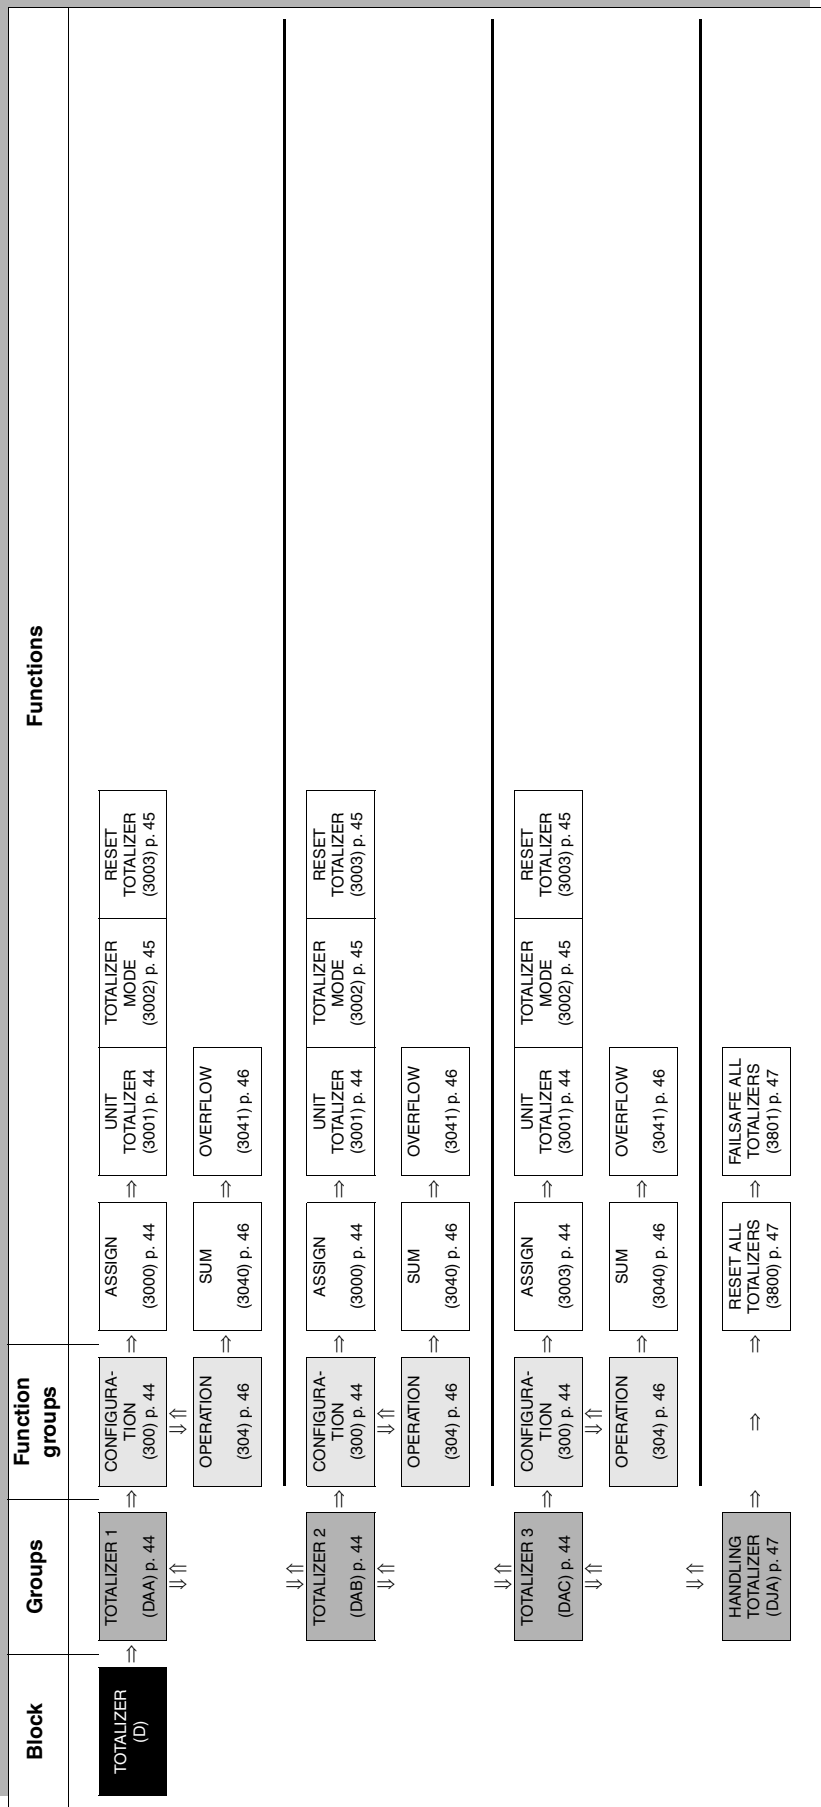

6.1 Group TOTALIZER (1...3)


6.1.1 Function group CONFIGURATION

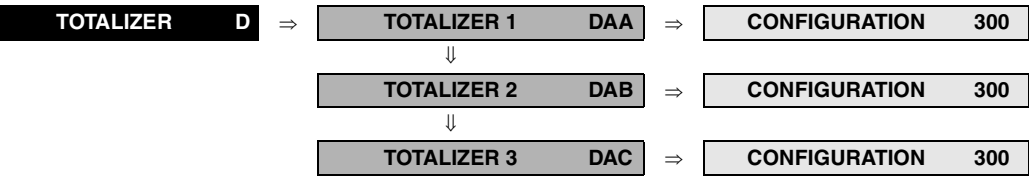

Function description	
TOTALIZER → TOTALIZER (1...3) → CONFIGURATION	
The function descriptions below apply to totalizers 1...3; the totalizers are independently configurable.	
ASSIGN (3000)	Use this function to assign a measured variable to the totalizer in question. Options: OFF MASS FLOW VOLUME FLOW Factory setting: VOLUME FLOW Note! • The totalizer is reset to "0" as soon as the selection is changed. • If you select OFF in the function group CONFIGURATION of the totalizer in question, only the ASSIGN (3000) function remains visible.
UNIT TOTALIZER (3001)	Use this function to define the unit for the totalizer's measured variable, as selected beforehand. Options: (for MASS FLOW assignment): Metric → g; kg; t US → oz; lb; ton Factory setting: Depends on nominal diameter and country (kg...t or US-lb...US-ton), corresponding to the totalizer unit (see Page 141 ff.) factory setting. Options (for VOLUME FLOW assignment): Metric → cm³; dm³; m³; ml; l; hl; Ml US → cc; af; ft³; oz f; gal; Mgal; bbl (normal fluids); bbl (beer); bbl (petrochemicals); bbl (filling tanks) Imperial → gal; Mgal; bbl (beer); bbl (petrochemicals) Arbitrary unit → _ _ _ _ (see function group ARBITRARY UNIT on Page 17) Factory setting: Depends on nominal diameter and country, (dm³...m³ or US-gal...US-Mgal), corresponding to the totalizer unit (see Page 141 ff.) factory setting.


Function description	
TOTALIZER → TOTALIZER (1...3) → CONFIGURATION	
TOTALIZER MODE (3002)	Use this function to define how the flow components are to be totalised. Options: BALANCE Positive and negative flow components. The positive and negative flow components are balanced. In other words, net flow in the flow direction is registered. FORWARD Positive flow components only REVERSE Negative flow components only Factory setting: Totalizer 1 = BALANCE Totalizer 2 = FORWARDS Totalizer 3 = REVERSE
RESET TOTALIZER (3003)	Use this function to reset the sum and the overflow of the totalizer to zero. Options: NO YES Factory setting: NO  Note! If the device is equipped with a status input, with the appropriate configuration a reset for each individual totalizer can also be triggered by a pulse (see function ASSIGN STATUS INPUT (5000) on page 89).

6.1.2 Function group OPERATION

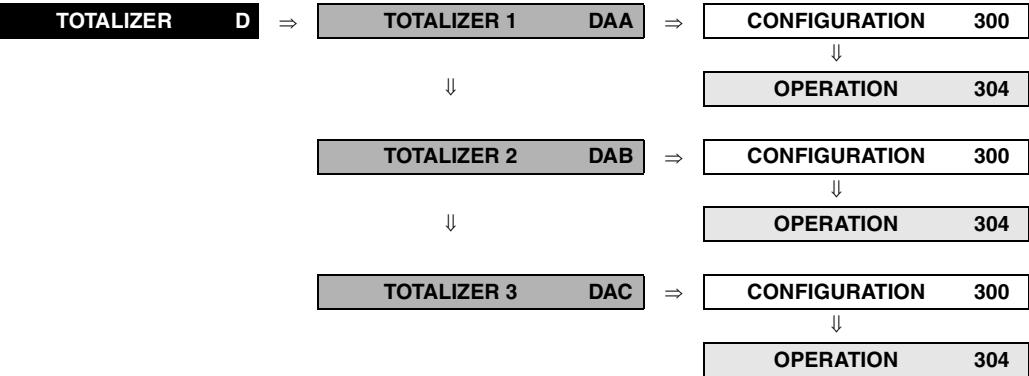

Function description	
TOTALIZER → TOTALIZER (1...3) → OPERATION	
The function descriptions below apply to totalizers 1...3; the totalizers are independently configurable.	
SUM (3040)	Use this function to view the total for the totalizer's measured variable aggregated since measuring commenced. The value can be positive or negative, depending on the setting selected in the "TOTALIZER MODE" function (3002), and the direction of flow. User interface: max. 7-digit floating-point number, including sign and unit (e.g. 15467.04 m³; -4925.631 kg) Note! • The effect of the setting in the "TOTALIZER MODE" function (see Page 45) is as follows: – If the setting is "BALANCE", the totalizer balances flow in the positive and negative directions. – If the setting is "POSITIVE", the totalizer registers only flow in the positive direction. – If the setting is "NEGATIVE", the totalizer registers only flow in the negative direction. • The totalizer's response to faults is defined in the "FAILSAFE ALL TOTALIZERS" function (3801), (see Page 47).
OVERFLOW (3041)	Use this function to view the overflow for the totalizer aggregated since measuring commenced. Total flow quantity is represented by a floating-point number consisting of max. 7 digits. You can use this function to view higher numerical values (> 9,999,999) as overflows. The effective quantity is thus the total of OVERFLOW plus the value returned by the SUM function. Example: Reading for 2 overflows: 2 · 10⁷ dm³ (= 20,000.000 dm³) The value displayed in the function SUM = 196,845.7 dm³ Effective total quantity = 20,196,845.7 dm³ User interface: integer with exponent, including sign and unit, e.g. 2 · 10⁷ dm³

6.2 Group HANDLING TOTALIZER

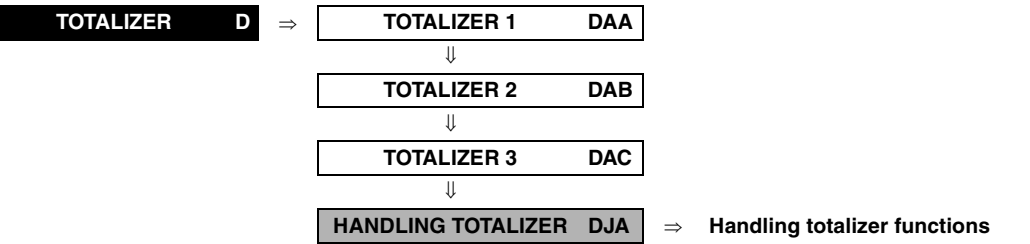


Function description	
TOTALIZER → HANDLING TOTALIZER → Handling totalizer functions	
RESET ALL TOTALIZERS (3800)	Use this function to reset the totals (including all overflows) of the totalizers (1...3) to zero (= RESET). Options: NO YES Factory setting: NO  Note! If the device is equipped with a status input and if it is appropriately configured, a reset for the totalizer (1...3) can also be triggered by a pulse (see function ASSIGN STATUS INPUT (5000) on page 89).
FAILSAFE ALL TOTALIZERS (3801)	Use this function to define the common response of all totalizers (1...3) to error. Options: STOP The totalizer is paused until the fault is rectified. ACTUAL VALUE The totalizer continues to count is based on the current flow measuring value. The fault is ignored. HOLD VALUE The totalizer continues to count the flow that is based on the last valid flow measuring value (before the fault occurred). Factory setting: STOP

7 Block OUTPUTS

Block	Groups	Function groups	Functions												
OUTPUTS (E)	CURRENT (EAA, EAB) p. 49	⇒	CONFIGURA- TION (400) p. 49	⇒	ASSIGN CURRENT (4000) p. 49	⇒	CURRENT SPAN (4001) p. 49	VALUE 0.4 mA (4002) p. 50	VALUE 20 mA (4003) p. 52	MEASURING MODE (4004) p. 53	TIME CONSTANT (4005) p. 55	FAILSAFE MODE (4006) p. 56			
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	SIMULATION CURRENT (4041) p. 57	VALUE SIM. CURRENT (4042) p. 57								
		⇕⇕	OPERATION (404) p. 57	⇕⇕	ACTUAL CURRENT (4040) p. 57	⇕⇕									
		⇕⇕	INFORMATION (408) p. 58	⇕⇕	TERMINAL NUMBER (4080) p. 58										
	PULSE/FREQ. (ECA, ECB) p. 59	⇕⇕	CONFIGURA- TION (420) p. 59	⇕⇕	OPERATION MODE (4200) p. 59	⇒	ASSIGN FREQUENCY (4201) p. 59	START VALUE FREQ. (4202) p. 60	END VALUE FREQ. (4203) p. 60	VALUE F LOW (4204) p. 61	VALUE F HIGH (4205) p. 61	MEASURING MODE (4206) p. 63	OUTPUT SIGNAL (4207) p. 64	TIME CONSTANT (4208) p. 65	FAILSAFE MODE (4209) p. 65
		⇕⇕	⇕⇕	⇕⇕	⇕⇕										
		⇕⇕													
		⇕⇕													
	RELAY (EGA, EGB) p. 78	⇕⇕	CONFIGURA- TION (470) p. 78	⇕⇕	ASSIGN RELAY (4700) p. 78	⇒	ON-VALUE (4701) p. 79	SWITCH-ON DELAY (4702) p. 79	OFF-VALUE (4703) p. 79	SWITCH-OFF DELAY (4704) p. 80	MEASURING MODE (4705) p. 80	TIME CONSTANT (4706) p. 81			
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	SIM. SWITCH POINT (4741) p. 82	VAL. SIM. SWITCH PNT. (4742) p. 83							
		⇕⇕	OPERATION (474) p. 82	⇕⇕	ACTUAL STATUS RELAY (4740) p. 82	⇕⇕									
		⇕⇕	INFORMATION (478) p. 84	⇕⇕	TERMINAL NUMBER (4780) p. 84										
	OPERATION (430) p. 74	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
	INFORMATION (438) p. 77	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
	ASSIGN PULSE (4221) p. 66	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
		⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕
ASSIGN STATUS (4241) p. 71	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	
	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	
	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	
	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	⇕⇕	


7.1 Group CURRENT OUTPUT (1...2)

 
7.1.1 Function group CONFIGURATION









Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
ASSIGN CURRENT OUTPUT (4000)	Use this function to assign a measured variable to the current output. Options: OFF MASS FLOW VOLUME FLOW Advanced options with optional software package BATCHING: BATCH UPWARDS (batching progress upwards) BATCH DOWNWARDS (batching progress downwards)  Note! - The current range selected (function CURRENT SPAN (4001)) corresponds to a batching rate of 0 – 100%, based on the batching quantity. - The batching software automatically sets the values for 0/4 mA and 20 mA (function VALUE 0_4 mA (4002) and VALUE 20 mA (4003)). Example with upward batching: Value 0/4 mA = 0 [unit]; Value 20 mA = batch quantity [unit]. Factory setting: VOLUME FLOW  Note! If you select OFF, the only function shown in the function group CONFIGURATION (400) is this function, in other words, ASSIGN CURRENT OUTPUT (4000).
CURRENT SPAN (4001)	Use this function to define the current range. You can configure the current output either in accordance with the NAMUR recommendation (max. 20.5 mA) or for a maximum drive of 25 mA. Options: NAMUR-compliant: 0-20 mA 4-20 mA 4-20 mA HART (for current output 1) not NAMUR-compliant: 0-20 mA (25 mA) 4-20 mA (25 mA) 4-20 mA (25 mA) HART (for current output 1) Factory setting: 4-20 mA HART (for current output 1) 4-20 mA (for current output 2)  Note! - Option 4-20 mA HART or 4-20 mA (25 mA) HART is only supported by the current output marked as current input 1 in the device software (terminals 26 and 27, see function TERMINAL NUMBER (4080) on Page 58). - When switching the hardware from an active (factory setting) to a passive output signal, select a current range of 4-20 mA (see Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en).

Function description OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
VALUE 0_4 mA (4002)	Use this function to assign the 0/4 mA current a value. The value can be higher or lower than the value assigned to 20 mA (function VALUE 20 mA (4003)). Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow). Example: 4 mA assigned value = - 250 l/h 20 mA assigned value = +750 l/h Calculated current value = 8 mA (at zero flow) Note that values with different signs cannot be entered for 0/4 mA and 20 mA (function 4003) if SYMMETRY is the setting selected for the MEASURING MODE function (4004). In this case, the message "INPUT RANGE EXCEEDED" appears on the display. Example for STANDARD measuring mode: ① = initial value 0...20 mA ② = initial value 4...20 mA ③ = full scale value 0/4...20 mA * = max. current value Minimum range: Q = 0.3 m/s User input: 5-digit floating-point number, with sign Factory setting: 0 [unit] Note! - The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400), (see Page 14 or Page 13). - If the option BATCH UPWARDS or BATCH DOWNWARDS (only possible with the optional software package BATCHING) is selected in the function ASSIGN CURRENT OUTPUT (4000), the value 0/4 mA is automatically specified in this function and cannot be edited. Caution! The current output responds differently, depending on the parameters set in the various functions. Some examples of parameter settings and their effect on the current output are given in the following section. Parameter setting, example 1: VALUE 0_4 mA (4002) = not equal to zero flow (e.g. -5 m³/h, 10m³/h) VALUE 20 mA (4003) = not equal to zero flow (e.g. 100 m³/h, -40 m³/h) MEASURING MODE (4004) = STANDARD When you enter the values for 0/4 mA and 20 mA, the working range of the measuring device is defined. If the effective flow drops below or exceeds this working range, (see ①), a fault/notice message is generated (#351-354, current range) and the current output responds in accordance with the parameter settings in the function FAILSAFE MODE (4002).

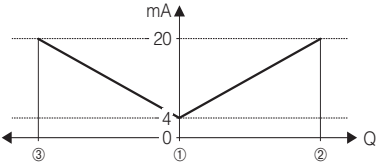Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
VALUE 0_4 mA (continued)	Parameter setting, example 2: VALUE 0_4 mA (4002) = equal to zero flow (e.g. 0 m³/h) VALUE 20 mA (4003) = not equal to zero flow (e.g. 10 m³/h) or VALUE 0_4 mA (4002) = not equal to zero flow (e.g. 100 m³/h) VALUE 20 mA (4003) = equal to zero flow (e.g. 0 m³/h) and MEASURING MODE (4004) = STANDARD When you enter the values for 0/4 mA and 20 mA, the working range of the measuring device is defined. In doing so, one of the two values is parameterised as zero flow (e.g. 0 m³/h). If the effective flow drops below or exceeds the value parameterised as the zero flow, no fault/notice message is generated and the current output retains its value. If the effective flow drops below or exceeds the other value, a fault/notice message is generated (#351-354, current range) and the current output responds in accordance with the parameter settings in the function FAILSAFE MODE (4002).  Deliberately only one flow direction is output with this setting and flow values in the other flow direction are suppressed. Parameter setting, example 3: MEASURING MODE (4004) = SYMMETRY The current output signal is independent of the direction of flow (absolute amount of the measured variable). The 0_4 mA value ① and the 20 mA value ② must have the same sign (+ or -). The "20 mA VALUE" ③ (e.g. backflow) corresponds to the mirrored 20 mA value ② (e.g. flow).  ASSIGN RELAY (4700) = FLOW DIRECTION Flow direction output via a switching contact. Parameter setting example 4: MEASURING MODE (4004) = PULSATING FLOW If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, flow components outside the measuring range are buffered, balanced and output after a delay. If the effective flow drops below or exceeds the defined working range, normally no fault/notice message is generated.

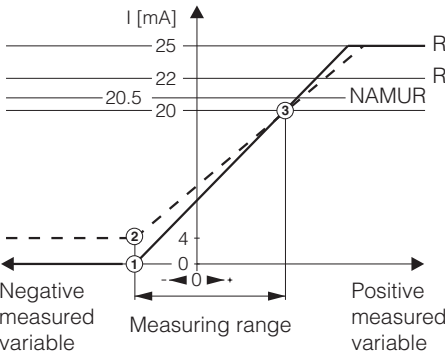
Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
VALUE 20 mA (4003)	Use this function to assign the 20 mA current a value. The value can be higher or lower than the value assigned to 0/4 mA (function VALUE 0_4 mA (4002), see Page 50). Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow). Example: 4 mA assigned value = - 250 l/h 20 mA assigned value = +750 l/h Calculated current value = 8 mA (at zero flow) Note that values with different signs cannot be entered for 0/4 mA (function 4002) and 20 mA, if SYMMETRY is the setting selected in the function MEASURING MODE (4004). In this case, the message "INPUT RANGE EXCEEDED" appears. Example for STANDARD measuring mode:  Minimum range: Q = 0.3 m/s User input: 5-digit floating-point number, with sign Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.)  Note! • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • If the option BATCH UPWARDS or BATCH DOWNWARDS, (only possible with the optional software package BATCHING), is selected in the function ASSIGN CURRENT OUTPUT (4000), the value 20 mA is automatically specified in this function and cannot be edited.  Caution! It is very important to read and comply with the information in the function VALUE 0_4 mA (under "⚠ Caution"; Examples of parameter settings) on Page 50.

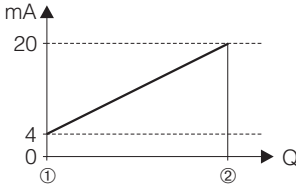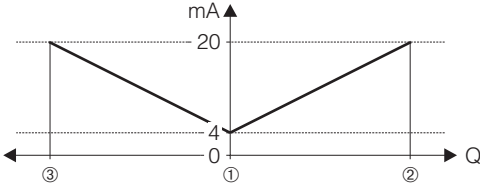Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
MEASURING MODE (4004)	Use this function to define the measuring mode for the current output. Options: STANDARD SYMMETRY PULSATING FLOW Factory setting: STANDARD Description of the individual options: - STANDARD The current output signal is proportional to the measured variable. The flow components outside the scaled measuring range (defined by the 0_4 mA VALUE ① and the 20 mA VALUE ②) are taken into account as follows for signal output. - If one of the values is defined as equal to the zero flow (e.g. VALUE 0_4 mA = 0 m³/h), no message is given if this value is exceeded or not achieved and the current output retains its value (4 mA in the example). If the other value is exceeded or not achieved, the message "CURRENT OUTPUT AT FULL SCALE VALUE" appears and the current output responds in accordance with the parameter setting in the function FAIL-SAFE MODE (4006). - If both values defined are not equal to the zero flow (for example VALUE 0_4 mA = -5 m³/h; VALUE 20 mA = 10m³/h), the message "CURRENT OUTPUT AT FULL SCALE VALUE" appears if the measuring range is exceeded or not achieved and the current output responds in accordance with the parameter setting in the function FAILSAFE MODE (4006).  - SYMMETRY The current output signal is independent of the direction of flow (absolute amount of the measured variable). The 0_4 mA value ① and the 20 mA value ② must have the same sign (+ or -). The "20 mA value" ③ (e.g. backflow) corresponds to the mirrored 20 mA value ② (e.g. flow).   Note! - The direction of flow can be output via the configurable relay or status outputs. - SYMMETRY cannot be selected unless the values in the VALUE 0_4 mA (4002) and VALUE 20 mA (4003) functions have the same sign or one of the values is zero. If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed. (continued on next page)

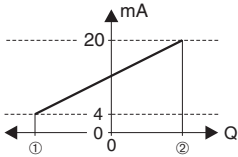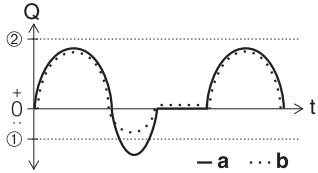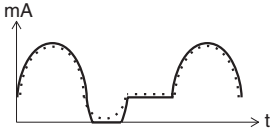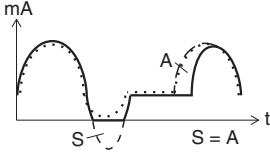Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
Detailed explanations and information (continued)	2. Defined measuring range (①-②): ① and ② do not have the same sign.  F-x3xxxxx-05-xx-xx-xx-002 Flow a (—) outside, b (---) within the measuring range.  F-x3xxxxx-05-xx-xx-xx-012 • STANDARD a (—): The flow components outside the scaled measuring range cannot be taken into account at signal output. A fault message is generated (# 351...354, current range) and the current output responds in accordance with the parameter settings in the function FAILSAFE MODE (4006). b (---): The current output signal is proportional to the measured variable assigned.  F-x3xxxxx-05-xx-xx-xx-013 • SYMMETRY This option is not available under these circumstances, because the 0_4 mA value and the 20 mA value have different signs. • PULSATING FLOW Flow components outside the measuring range are buffered, balanced and output after a maximum delay of 60 seconds.  F-x3xxxxx-05-xx-xx-xx-014
TIME CONSTANT (4005)	Use this function to enter a time constant defining how the current output signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). User input: fixed-point number 0.01...100.00 s Factory setting: 1.00 s


Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → CONFIGURATION	
FAILSAFE MODE (4006)	For safety reasons it is advisable to ensure that the current output assumes a predefined state in the event of a fault. The setting you select here affects only the current output. It has no effect on other outputs and the display (e.g. totalizers). Options: MIN. CURRENT Depends on the setting selected in the CURRENT SPAN function (4001). If the current range is: 0-20 mA (25 mA) → Output current = 0 mA 4-20 mA (25 mA) → Output current = 2 mA 4-20 mA (25 mA) HART → Output current = 2 mA 0-20 mA (NAMUR) → Output current = 0 mA 4-20 mA (NAMUR) → Output current = 2 mA 4-20 mA HART (NAMUR) → Output current = 2 mA MAX. CURRENT Depends on the setting selected in the CURRENT SPAN function (4001). If the current range is: 0-20 mA (25 mA) → Output current = 25 mA 4-20 mA (25 mA) → Output current = 25 mA 4-20 mA (25 mA) HART → Output current = 25 mA 0-20 mA (NAMUR) → Output current = 22 mA 4-20 mA (NAMUR) → Output current = 22 mA 4-20 mA HART (NAMUR) → Output current = 22 mA HOLD VALUE Measuring value output is based on the last measuring value saved before the error occurred. ACTUAL VALUE Measuring value output is based on the current flow measurement. The fault is ignored. Factory setting: MIN. CURRENT

7.1.2 Function group OPERATION

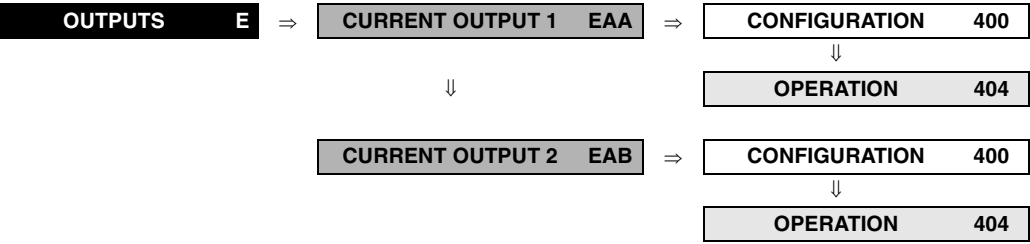

Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → OPERATION	
ACTUAL CURRENT (4040)	Use this function to view the computed actual value of the output current. User interface: 0.00...25.00 mA
SIMULATION CURRENT (4041)	Use this function to activate simulation of the current output. Options: OFF ON Factory setting: OFF  Note! • The “SIMULATION CURRENT OUTPUT” message indicates that simulation is active. • The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs.  Caution! The setting is not saved if the power supply fails.
VALUE SIMULATION CURRENT (4042)	 Note! The function is not visible unless the SIMULATION CURRENT function (4041) is active (= ON). Use this function to define a freely selectable value (e.g. 12 mA) to be output at the current output. This value is used to test downstream devices and the measuring device itself. User input: 0.00...25.00 mA Factory setting: 0.00 mA  Caution! The setting is not saved if the power supply fails.


7.1.3 Function group INFORMATION

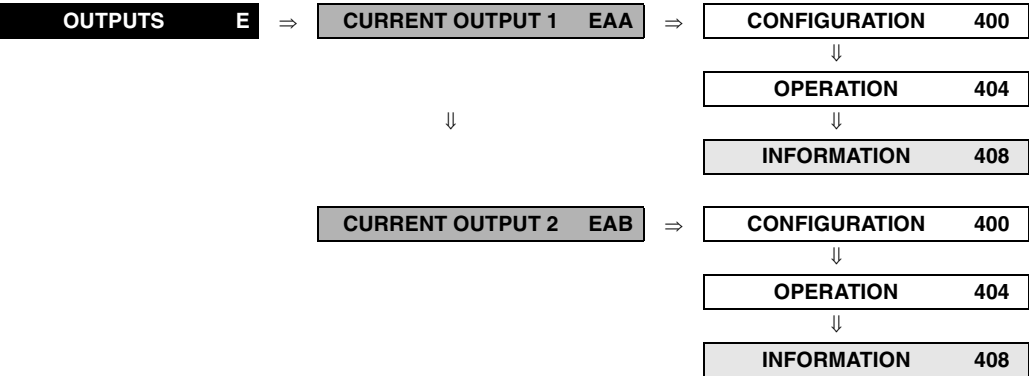

Function description	
OUTPUTS → CURRENT OUTPUT (1...2) → INFORMATION	
TERMINAL NUMBER (4080)	Use this function to display the numbers of the terminals (in the connection compartment) which are used by the current output.

7.2 Group PULSE/FREQUENCY OUTPUT (1...2)




7.2.1 Function group CONFIGURATION

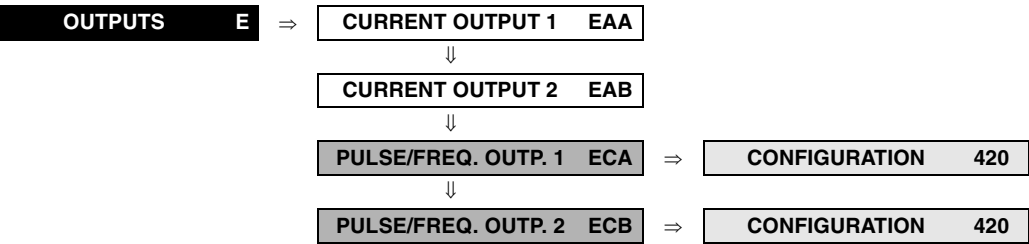






Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (GENERAL / FREQUENCY)	
OPERATION MODE (4200)	Use this function to configure the output as a pulse output, frequency output or status output. The functions available in this function group vary, depending on which option you select here. Options: PULSE FREQUENCY STATUS Factory setting: PULSE
ASSIGN FREQUENCY (4201)	 Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to assign a measured variable to the frequency output. Options: OFF MASS FLOW VOLUME FLOW Factory setting: VOLUME FLOW  Note! If you select OFF, the only function shown in the CONFIGURATION function group is this function, in other words ASSIGN FREQUENCY (4201).

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (FREQUENCY)	
START VALUE FREQUENCY (4202)	 Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to define an initial frequency for the frequency output. You define the associated measuring value of the measuring range in the VALUE F LOW function (4204) described on Page 61. User input: 5-digit fixed-point number: 0...10000 Hz Factory setting: 0 Hz Example: • VALUE F LOW. = 0 l/h, initial frequency = 0 Hz: i.e. a frequency of 0 Hz is output at a flow of 0 l/h. • VALUE F LOW. = 1 l/h, initial frequency = 10 Hz: i.e. a frequency of 10 Hz is output at a flow of 1 l/h.
END VALUE FREQUENCY (4203)	 Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to define a full scale frequency for the frequency output. You define the associated measuring value of the measuring range in the VALUE F HIGH function (4205) described on Page 61. User input: 5-digit fixed-point number 2...10000 Hz Factory setting: 10000 Hz Example: • VALUE F HIGH = 1000 l/h, full scale value frequency = 1000 Hz: i.e. a frequency of 1000 Hz is output at a flow of 1000 l/h. • VALUE F HIGH = 3600 l/h, full scale value frequency = 1000 Hz: i.e. a frequency of 1000 Hz is output at a flow of 3600 l/h.  Note! In the FREQUENCY operating mode the output signal is symmetrical (on/off ratio = 1:1). At low frequencies the pulse duration is limited to a maximum of 2 seconds, i.e. the on/off ratio is no longer symmetrical.

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (FREQUENCY)	
VALUE F LOW (4204)	Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to assign a variable to the start value frequency (4202). The value can be higher or lower than the value assigned to the VALUE F HIGH. Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow). You define a measuring range by defining the VALUE F LOW and VALUE F HIGH values. User input: 5-digit floating-point number Factory setting: 0 [unit] Note! - For graphic illustration of VALUE F LOW see function 4204. - The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400), (see Page 14 or Page 13).
VALUE F HIGH (4205)	Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to assign a variable to the end value frequency (4203). The value can be higher or lower than the value assigned to the VALUE F LOW. Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow). You define a measuring range by defining the VALUE F LOW and VALUE F HIGH values. User input: 5-digit floating-point number Factory setting: Depends on nominal diameter and country, [value / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for the full scale value (see Page 141 ff.). Frequency [%] 125 100 0 ① ② Measuring range Measured variable (amount) ① Value f min ② Value f max
Caution! The frequency output responds differently, depending on the parameters set in the various functions. Some examples of parameter settings and their effect on the frequency output are given in the following section. (continued on next page)	

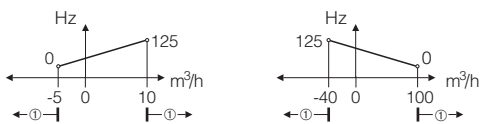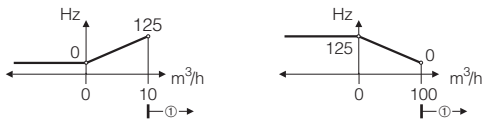 
Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (FREQUENCY)	
VALUE F HIGH (continued)	Parameter setting, example 1: VALUE F LOW (4204) = not equal to zero flow (e.g. -5 m³/h, 10m³/h) VALUE F HIGH (4205) = not equal to zero flow (e.g. 100 m³/h, -40 m³/h) MEASURING MODE (4206) = STANDARD When you enter the values for VALUE F LOW and VALUE F HIGH, the working range of the measuring device is defined. If the effective flow drops below or exceeds this working range (see ①), a fault or notice message is generated (#351-354, frequency area) and the frequency output responds in accordance with the parameter settings in the function FAILSAFE MODE (4209).  F06-xxxxxxx-05-xx-xx-xx-009 Parameter setting, example 2: VALUE F LOW (4204) = equal to zero flow (e.g. 0 m³/h) VALUE F HIGH (4205) = not equal to zero flow (e.g. 10 m³/h) or VALUE F LOW (4204) = not equal to zero flow (e.g. 100 m³/h) VALUE F HIGH (4205) = equal to zero flow (e.g. 0 m³/h) and MEASURING MODE (4206) = STANDARD When you enter the values for VALUE F LOW and VALUE F HIGH, the working range of the measuring device is defined. In doing so, one of the two values is parameterised as zero flow (e.g. 0 m³/h). If the effective flow drops below or exceeds the value parameterised as the zero flow, no fault/notice message is generated and the frequency output retains its value. If the effective flow drops below or exceeds the other value, a fault/notice message is generated (#351-354, frequency area) and the frequency output responds in accordance with the parameters set in the function FAILSAFE MODE (4209).  F06-xxxxxxx-05-xx-xx-xx-0010 Deliberately only one flow direction is output with this setting and flow values in the other flow direction are suppressed. Parameter setting, example 3: MEASURING MODE (4206) = SYMMETRY The current output signal is independent of the direction of flow (absolute amount of the measured variable). The VALUE F LOW ① and VALUE F HIGH ② must have the same sign (+ or -). The "VALUE F HIGH" ③ (e.g. backflow) corresponds to the mirrored VALUE F HIGH ② (e.g. flow).  F06-xxxxxxx-05-xx-xx-xx-011 ASSIGN RELAY (4700) = FLOW DIRECTION Flow direction output via a switching contact. Parameter setting, example 4: MEASURING MODE (4206) = PULSATING FLOW If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, flow components outside the measuring range are buffered, balanced and output after a delay. If the effective flow drops below or exceeds the defined working range, normally no fault/notice message is generated.

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (FREQUENCY)	
MEASURING MODE (4206)	Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to define the measuring mode for the frequency output. Options: STANDARD SYMMETRY PULSATING FLOW Factory setting: STANDARD Description of the individual options: • STANDARD The frequency output signal is proportional to the measured variable. The flow components outside the scaled measuring range (defined by the VALUE F LOW. ① and VALUE F HIGH. ②) are not taken into account for signal output. – If one of the values is defined as equal to the zero flow (e.g.VALUE F LOW = 0 m³/h), no message is given if this value is exceeded or not achieved and the frequency output retains its value (0 Hz in the example). If the other value is exceeded or not achieved, the message “FREQUENCY OUTPUT AT FULL SCALE VALUE” appears and the frequency output responds in accordance with the parameter setting in the function FAILSAFE MODE (4209). – If both values defined are not equal to the zero flow (for example VALUE F LOW= −5 m³/h; VALUE F HIGH = 10m³/h) the message “FREQUENCY OUTPUT AT FULL SCALE VALUE” appears if the measuring range is exceeded or not achieved and the frequency output responds in accordance with the parameter settings in the function FAILSAFE MODE (4209). Freq. 125 100 0 0 ① ② Q Freq. 125 100 0 ③ ① ② Q Note! • The direction of flow can be output via the configurable relay or status outputs. • SYMMETRY cannot be selected unless the values in the VALUE F LOW (4204) and VALUE F HIGH (4205) functions have the same sign or one of the values is zero. If the values have different signs, SYMMETRY cannot be selected and an “ASSIGNMENT NOT POSSIBLE” message is displayed. (continued on next page)


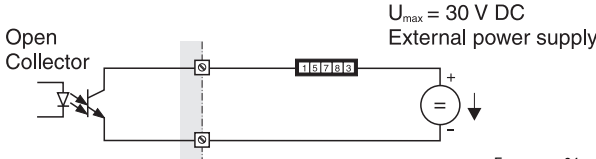
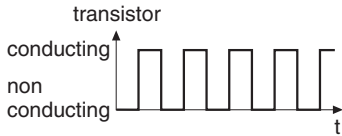
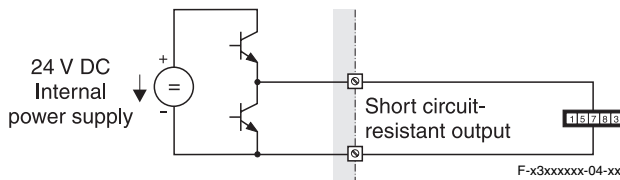
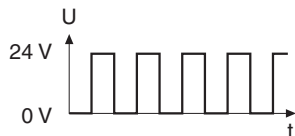
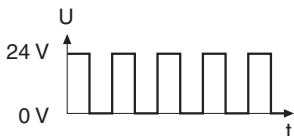
Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (FREQUENCY)	
MEASURING MODE (continued)	PULSATING FLOW If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, flow components outside the measuring range are buffered, balanced and output after a maximum delay of 60 seconds. If the buffered data cannot be processed within approx. 60 seconds, a fault/notice message appears. Under certain plant conditions, flow values can aggregate in the buffer, for example in the case of prolonged and unwanted fluid backflow. However, this buffer is reset in all relevant programming adjustments which affect the frequency output.
OUTPUT SIGNAL (4207)	Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to select whether to use the device's internal power supply (ACTIVE) or an external power supply (PASSIVE), along with the polarity of the frequency. Options: PASSIVE - POSITIVE PASSIVE - NEGATIVE ACTIVE-POSITIVE ACTIVE-NEGATIVE Factory setting: PASSIVE - POSITIVE PASSIVE: Open Collector  F-xxxxxxx-04-xx-xx-en-000 Note! For continuous currents up to 25 mA ($I_{max} = 250 \text{ mA} / 20 \text{ ms}$) PASSIVE-POSITIVE transistor  F-xxxxxxx-05-xx-xx-de-002 PASSIVE-NEGATIVE transistor  F-xxxxxxx-05-xx-xx-de-002 ACTIVE: 24 V DC Internal power supply  F-x3xxxxxx-04-xx-xx-en-000 ACTIVE-POSITIVE  F06-xxxxxxx-05-xx-xx-en-003 ACTIVE-NEGATIVE  F06-xxxxxxx-05-xx-xx-en-003

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (FREQUENCY)	
TIME CONSTANT (4208)	 Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to enter a time constant defining how the frequency output signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). User input: fixed-point number 0.00...100.00 s Factory setting: 1.00 s
FAILSAFE MODE (4209)	 Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). For safety reasons it is advisable to ensure that the frequency output assumes a predefined state in the event of a fault. The setting you select here affects only the frequency output. It has no effect on other outputs and the display (e.g. totalizers). Options: FALLBACK VALUE Output is 0 Hz. FAILSAFE VALUE Output is the frequency specified in the FAILSAFE VALUE function (4211). HOLD VALUE Measuring value output is based on the last measuring value saved before the error occurred. ACTUAL VALUE Measuring value output is based on the current flow measurement. The fault is ignored. Factory setting: FALLBACK VALUE
FAILSAFE VALUE (4211)	 Note! This function is not available unless FREQUENCY was selected in the OPERATION MODE function (4200) and FAILSAFE VALUE was selected in the FAILSAFE MODE function (4209). Use this function to define the frequency that the measuring device outputs in the event of an error. User input: max. 5-digit number: 0...12500 Hz Factory setting: 12500 Hz

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (PULSE)	
ASSIGN PULSE (4221)	 Note! This function is not available unless the PULSE setting was selected in the OPERATION MODE function (4200). Use this function to assign a measured variable to the pulse output. Options: OFF MASS FLOW VOLUME FLOW Factory setting: VOLUME FLOW  Note! If you select OFF, the only function shown in the CONFIGURATION function group is this function, in other words ASSIGN PULSE (4221).
PULSE VALUE (4222)	 Note! This function is not available unless the PULSE setting was selected in the OPERATION MODE function (4200). Use this function to define the flow at which a pulse is triggered. These pulses can be totaled by an external totalizer, and the total flow quantity since measuring started can be registered in this way. User input: 5-digit floating-point number [unit] Factory setting: Depends on nominal diameter and country, [value] [dm³...m³ or US-gal...US-Mgal] / pulse, corresponding to the factory setting for the pulse value (see Page 141 ff.).  Note! The appropriate unit is taken from the function UNIT VOLUME (0403) or UNIT MASS (0401), (see Page 15 or Page 13).

 Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (PULSE)	
PULSE WIDTH (4223)	 Note! This function is not available unless the PULSE setting was selected in the OPERATION MODE function (4200). Use this function to enter the pulse width of the output pulse. User input: 0.05...2000 ms Factory setting: 100 ms Pulse output is always with the pulse width (B) entered in this function. The pauses (P) between the individual pulses are automatically configured. However, they must at least correspond to the pulse width (B = P).  B = Pulse width entered (the illustration applies to positive pulses) P = Intervals between the individual pulses  Note! When entering the pulse width, select a value that can still be processed by an external totalizer (e.g. mechanical totalizer, PLC, etc.) .  Caution! If the pulse number or frequency resulting from the pulse value entered, (see function PULSE VALUE (4222) onPage 66) and from the current flow is too large to maintain the pulse width selected (the interval P is smaller than the pulse width B entered), a system error message (# 359...362, pulse memory) is generated after buffering/balancing has occurred.


Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (PULSE)	
MEASURING MODE (4225)	 Note! This function is not available unless the PULSE setting was selected in the OPERATION MODE function (4200). Use this function to define the measuring mode for the pulse output. Options: STANDARD Only positive flow components are totalled. Negative components are not taken into account. SYMMETRY Positive and negative flow components are taken into account.  Note! The direction of flow can be output via the relay output. PULSATING FLOW If flow is characterized by severe fluctuations as is the case, for example, with reciprocating pumps, the positive and negative flow components are totalled, with the signs taken into account (e.g. -10 l and +25 l = 15 l). Flow components outside the maximum pulse number per second (value/width) are buffered, balanced and output after a maximum delay of 60 seconds. If the buffered data cannot be processed within approx. 60 seconds, a fault/notice message appears. Under certain plant conditions, flow values can aggregate in the buffer, for example in the case of prolonged and unwanted fluid backflow. However, this buffer is reset in all relevant programming adjustments which affect the pulse output. Factory setting: STANDARD

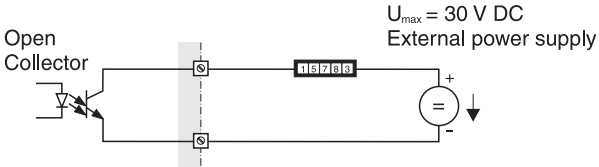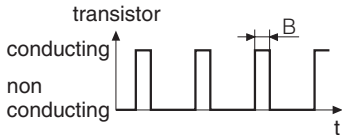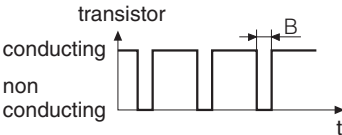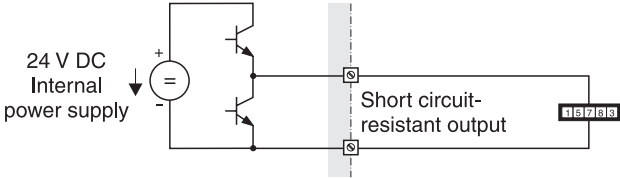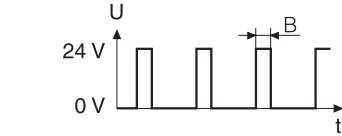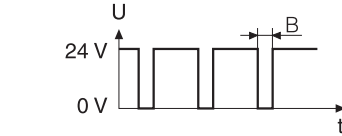Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (PULSE)	
OUTPUT SIGNAL (4226)	Note! This function is not available unless the PULSE setting was selected in the OPERATION MODE function (4200). Use this function to configure the output in such a way that it matches an external counter, for example. Depending on the application you can select whether to use the device's internal power supply (ACTIVE) or an external power supply (PASSIVE), along with the direction of the polarity of the pulses. Options: PASSIVE - POSITIVE PASSIVE - NEGATIVE ACTIVE-POSITIVE ACTIVE-NEGATIVE Factory setting: PASSIVE - POSITIVE PASSIVE: Open Collector  Note! For continuous currents up to 25 mA ($I_{max} = 250 \text{ mA} / 20 \text{ ms}$) PASSIVE-POSITIVE pulses  B = Pulse width PASSIVE-NEGATIVE pulses  ACTIVE: 24 V DC Internal power supply  ACTIVE-POSITIVE pulses  B = Pulse width ACTIVE-NEGATIVE pulses 


Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (PULSE)	
FAILSAFE MODE (4227)	 Note! This function is not available unless the PULSE setting was selected in the OPERATION MODE function (4200). For safety reasons it is advisable to ensure that the pulse output assumes a predefined state in the event of a fault. The setting you select here affects only the pulse output. It has no effect on other outputs and the display (e.g. totalizers). Options: FALLBACK VALUE Output is 0 pulse. HOLD VALUE Measuring value output is based on the last measuring value saved before the error occurred. ACTUAL VALUE Measuring value output is based on the current flow measurement. The fault is ignored. Factory setting: FALL BACK VALUE

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (STATUS)	
ASSIGN STATUS (4241)	 Note! This function is not available unless the STATUS setting was selected in the OPERATION MODE function (4200). Use this function to assign a switching function to the status output. Options: OFF ON (operation) FAULT MESSAGE NOTICE MESSAGE FAULT MESSAGE or NOTICE MESSAGE EPD/OED (Empty Pipe Detection/ Open Electrode Detection, only if active) FLOW DIRECTION MASS FLOW LIMIT VALUE VOLUME FLOW LIMIT VALUE TOTALIZER (1...3) LIMIT VALUE Advanced options with optional software package BATCHING: BATCH RUNNING > BATCH TIME >< BATCH QUANTITIES (< min. / > max. batching quantity) PROGRESS NOTE (batching end approaching)  Note! The only options available are the monitoring functions (7240...7243) which have a value not equal to zero (max. 3). Factory setting: FAULT MESSAGE  Note! - The behaviour of the status output is a normally closed behaviour, in other words the output is closed (transistor conductive) when normal, error-free measuring is in progress. - If you select OFF, the only function shown in the CONFIGURATION function group is this function, in other words ASSIGN STATUS (4241).
ON-VALUE (4242)	 Note! This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and LIMIT VALUE or FLOW DIRECTION was selected in the ASSIGN STATUS function (4241). Use this function to assign a value to the switch-on point (activation of the status output). The value can be equal to, higher than or lower than the switch-off point. Positive or negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit]  Note! - The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). - Only the switch-on point is available for flow direction output (no switch-off point). If you enter a value not equal to the zero flow (e.g. 5), the difference between the zero flow and the value entered corresponds to half the switch-over hysteresis.

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (STATUS)	
SWITCH-ON DELAY (4243)	 Note! This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and LIMIT VALUE or FLOW DIRECTION was selected in the ASSIGN STATUS function (4241). Use this function to specify a delay (0...100 seconds) for switching on the status output (i.e. signal changes from 0 to 1). The delay starts when the limit value is reached. The status output does switch when the delay has timed out and the switch-on condition has been valid over the delay time. User input: fixed-point number: 0.0...100.0 s Factory setting: 0.0 s
OFF-VALUE (4244)	 Note! This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and LIMIT VALUE was selected in the ASSIGN STATUS function (4241). Use this function to assign a value to the switch-off point (deactivation of the status output). The value can be equal to, higher than or lower than the switch-on point. Positive and negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit]  Note! • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • If SYMMETRY is selected in the function MEASURING MODE (4246) and values with different signs are entered for the switch-on and switch-off points, the notice message "INPUT RANGE EXCEEDED" appears.
SWITCH-OFF DELAY (4245)	 Note! This function is not available unless the STATUS setting was selected in the OPERATION MODE function (4200). Use this function to define a delay (0...100 seconds) for switching off the status output (i.e. signal changes from 1 to 0). The delay starts when the limit value is reached. The status output does switch when the delay has timed out and the switch condition has been valid over the delay time. User input: fixed-point number 0.0...100.0 s Factory setting: 0.0 s

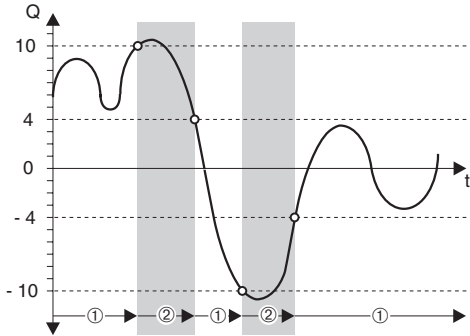Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → CONFIGURATION (STATUS)	
MEASURING MODE (4246)	Note! This function is not available unless STATUS was selected in the function OPERATION MODE (4200) and the status output was assigned a limit value. Use this function to define the measuring mode for the status output. Options: STANDARD The status output signal switches at the defined switch points. SYMMETRY The status output signal switches at the defined switch points, irrespective of the sign. If you define a switch point with a positive sign, the status output signal switches as soon as the value is reached in the negative direction (negative sign), see illustration. Factory setting: STANDARD Example for the SYMMETRY measuring mode: Switch-on point Q = 4, switch-off point: Q = 10 ① = Status output switched on (conductive) ② = Status output switched off (non-conductive)  Note! - SYMMETRY cannot be selected unless the values in the ON-VALUE (4242) and OFF-VALUE (4244) functions have the same sign or one of the values is zero. - If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed.
TIME CONSTANT (4247)	Note! This function is not available unless the STATUS setting was selected in the OPERATION MODE function (4200). Use this function to enter a time constant defining how the measuring signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). Damping acts on the measuring signal before the switch status changes, and consequently before switch-on or switch-off delay is activated. The purpose of damping, therefore, is to prevent the status output changing state continuously in response to fluctuations in flow. User input: fixed-point number 0.00...100.00 s Factory setting: 0.00 s

7.2.2 Function group OPERATION

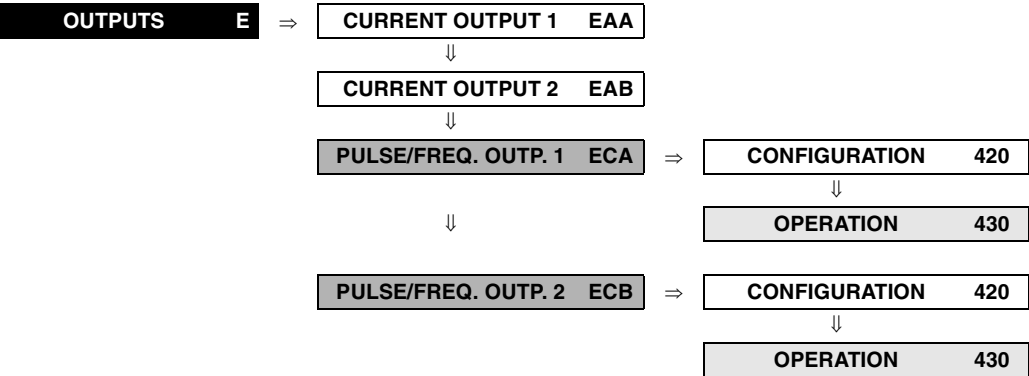


Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → OPERATION (FREQUENCY)	
ACTUAL FREQUENCY (4301)	Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to view the computed value of the output frequency. User Interface: 0...12500 Hz
SIMULATION FREQUENCY (4302)	Note! This function is not available unless the FREQUENCY setting was selected in the OPERATION MODE function (4200). Use this function to activate simulation of the frequency output. Options: OFF ON Factory setting: OFF Note! - The “SIMULATION FREQUENCY OUTPUT” message indicates that simulation is active. - The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs. Caution! The setting is not saved if the power supply fails.

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → OPERATION (FREQUENCY)	
VALUE SIMULATION FREQUENCY (4303)	 Note! This function is not available unless FREQUENCY was selected in the OPERATION MODE function (4200) and the SIMULATION FREQUENCY function (4302) is active (= ON). Use this function to define a selectable frequency value (e.g. 500 Hz) to be output at the frequency output. This value is used to test downstream devices and the flowmeter itself. User input: 0...12500 Hz Factory setting: 0 Hz  Caution! The setting is not saved if the power supply fails.

Function description OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → OPERATION (STATUS)	
ACTUAL STATUS (4341)	 Note! This function is not available unless the STATUS setting was selected in the OPERATION MODE function (4200). Use this function to check the current status of the status output. User Interface: NOT CONDUCTIVE CONDUCTIVE
SIMULATION SWITCH POINT (4342)	 Note! This function is not available unless the STATUS setting was selected in the OPERATION MODE function (4200). Use this function to activate simulation of the status output. Options: OFF ON Factory setting: OFF  Note! • The "SIMULATION STATUS OUTPUT" message indicates that simulation is active . • The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs.  Caution! The setting is not saved if the power supply fails.
VALUE SIMULATION SWITCH POINT (4343)	 Note! This function is not available unless STATUS was selected in the OPERATION MODE function (4200) and the SIMULATION SWITCH POINT function (4342) is active (= ON). Use this function to define the switching response of the status output during the simulation. This value is used to test downstream devices and the flowmeter itself. Options: NOT CONDUCTIVE CONDUCTIVE Factory setting: NOT CONDUCTIVE  Caution! The setting is not saved if the power supply fails.


7.2.3 Function group INFORMATION

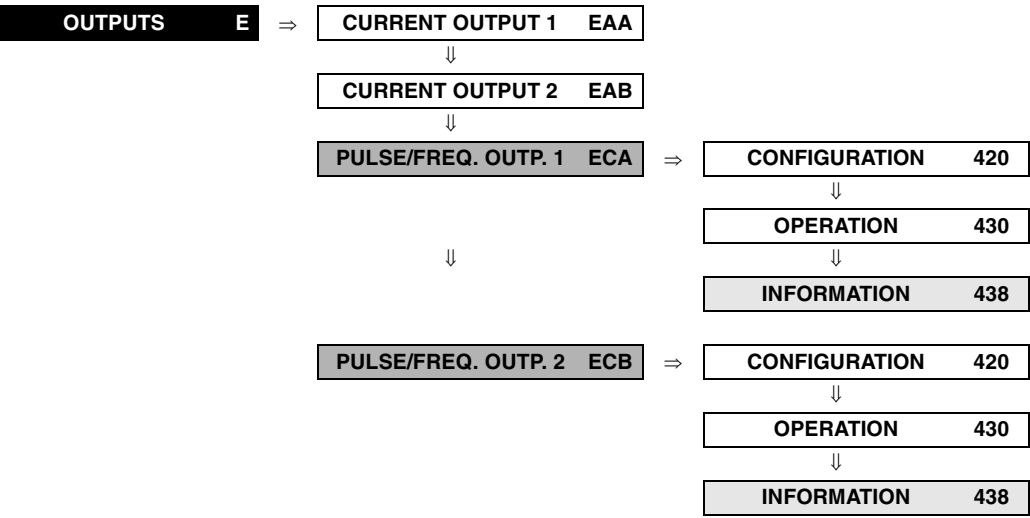

Function description	
OUTPUTS → PULSE/FREQUENCY OUTPUT (1...2) → INFORMATION	
TERMINAL NUMBER (4380)	Use this function to display the numbers of the terminals (in the connection compartment) which are used by the pulse/frequency output.


7.3 Group RELAY OUTPUT (1...2)

7.3.1 Function group CONFIGURATION

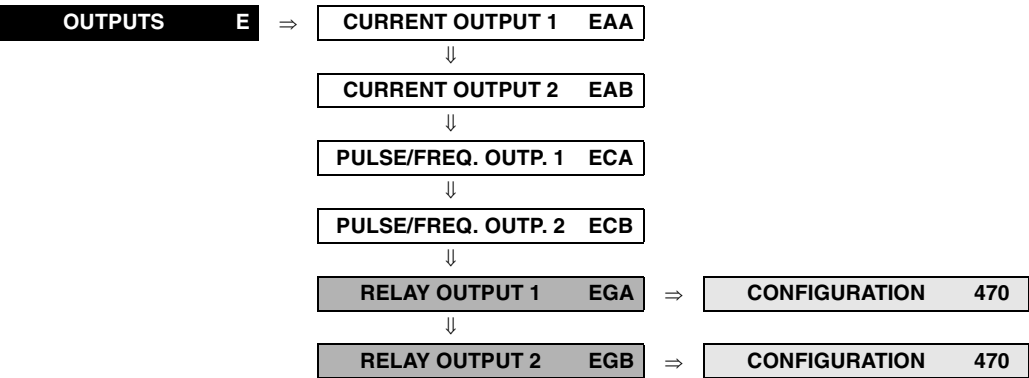


Function description	
OUTPUTS → RELAY OUTPUT (1...2) → CONFIGURATION	
ASSIGN RELAY (4700)	Use this function to assign a switching function to the relay output. Options: OFF ON (operation) FAULT MESSAGE NOTICE MESSAGE FAULT MESSAGE or NOTICE MESSAGE EPD/OED (Empty pipe detection / Open electrode detection, only if active) FLOW DIRECTION MASS FLOW LIMIT VALUE VOLUME FLOW LIMIT VALUE TOTALIZER (1...3) LIMIT VALUE Advanced options with optional software package BATCHING: BATCH VALVE 1 (e.g. to control valve 1) BATCH VALVE 2 (e.g. to control valve 2) BATCH RUNNING > BATCH TIME >< BATCH QUANTITIES (< min. / > max. batching quantity) PROGRESS NOTE (batching end approaching)  Note! • The batching valves defined in the function BATCH STAGES (7208) are the only available selection (max. 3). • Only the monitoring functions (7240...7243) which have a value not equal to zero (max. 3) are available as selection. Factory setting: FAULT MESSAGE  Note! • It is very important to read and comply with the information on the switching characteristics of the relay output (see Page 85). • It is advisable to configure at least one relay output as a fault output and define the outputs' response to error. • The relay output is configured as a normally open (NO or make) contact by default. It can be reconfigured as a normally closed (NC or break) contact by means of a jumper on the relay module (see Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en). • If you select OFF, the only function shown in the CONFIGURATION function group is the function ASSIGN RELAY (4700).

Function description	
OUTPUTS → RELAY OUTPUT (1...2) → CONFIGURATION	
ON-VALUE (4701)	 Note! This function is not available unless LIMIT VALUE or FLOW DIRECTION was selected in the function ASSIGN RELAY (4700). Use this function to assign a value to the switch-on point (relay output pulls up). The value can be equal to, higher than or lower than the switch-off point. Positive or negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit]  Note! • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • Only the switch-on point is available for flow direction output (no switch-off point). If you enter a value not equal to the zero flow (e.g. 5), the difference between the zero flow and the value entered corresponds to half the switching hysteresis.
SWITCH-ON DELAY (4702)	 Note! This function is not available unless LIMIT VALUE or FLOW DIRECTION was selected in the function ASSIGN RELAY (4700). Use this function to define a delay (0 ... 100 seconds) for pull-up (i.e. signal changes from 0 to 1) of the relay output. The delay starts when the limit value is reached. The relay output does switch when the delay has timed out and the switch condition has been valid throughout the delay time. User input: fixed-point number 0.0...100.0 s Factory setting: 0.0 s
OFF-VALUE (4703)	 Note! This function is not available unless LIMIT VALUE was selected in the ASSIGN RELAY function (4700). Use this function to assign a value to the switch-off point (relay drops out). The value can be equal to, higher than or lower than the switch-on point. Positive or negative values are permissible, depending on the measured variable in question (e.g. volume flow, totalizer reading). User input: 5-digit floating-point number [unit] Factory setting: 0 [unit]  Note! • The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400). • If SYMMETRY is selected in the function MEASURING MODE (4705) and values with different signs are entered for the switch-on and switch-off points, the notice message "INPUT RANGE EXCEEDED" appears.

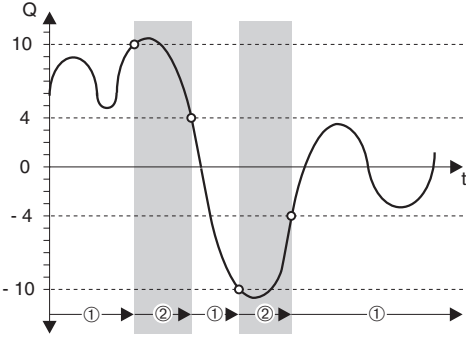Function description	
OUTPUTS → RELAY OUTPUT (1...2) → CONFIGURATION	
SWITCH-OFF DELAY (4704)	 Note! This function is not available unless LIMIT was selected in the ASSIGN RELAY function (4700). Use this function to define a delay (0 ... 100 seconds) for drop-out (i.e. signal changes from 1 to 0) of the relay output. The delay starts when the limit value is reached. The relay output does switch when the delay has timed out and the switch condition has been valid throughout the delay time. User input: fixed-point number 0.0...100.0 s Factory setting: 0.0 s
MEASURING MODE (4705)	 Note! This function is not visible unless a limit value was assigned to the relay output. Use this function to define the measuring mode for the relay output. Options: STANDARD The relay output signal switches at the defined switch points. SYMMETRY The relay output signal switches at the defined switching points, irrespective of the sign. If you define a switch point with a positive sign, the relay output switches as soon as the value is reached in the negative direction (negative sign), (see illustration). Factory setting: STANDARD Example for the SYMMETRY measuring mode: Switch-on point Q = 4 Switch-off point Q = 10 ① = Relay energized ② = Relay de-energized   Note! • SYMMETRY cannot be selected unless the values in the ON-VALUE (4701) and OFF-VALUE (4703) functions have the same sign or one of the values is zero. • If the values have different signs, SYMMETRY cannot be selected and an "ASSIGNMENT NOT POSSIBLE" message is displayed.

Function description	
OUTPUTS → RELAY OUTPUT (1...2) → CONFIGURATION	
TIME CONSTANT (4706)	Use this function to enter a time constant defining how the measuring signal reacts to severely fluctuating measured variables, either very quickly (enter a low time constant) or with damping (enter a high time constant). Damping acts on the measuring signal before the switch status changes, and consequently before switch-on or switch-off delay is activated. The purpose of damping, therefore, is to prevent the relay output changing state continuously in response to fluctuations in flow. User input: fixed-point number 0.00...100.00 s Factory setting: 0.00 s


7.3.2 Function group OPERATION

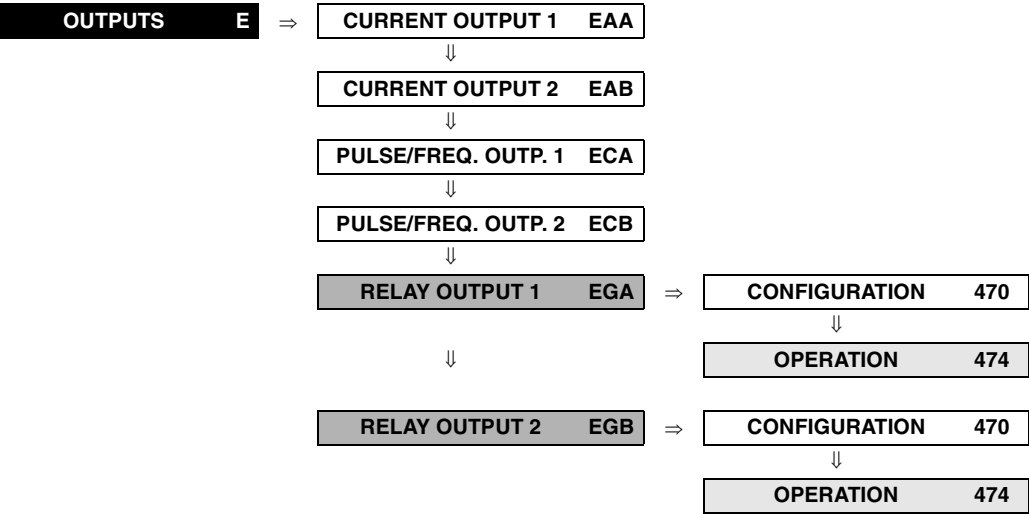

Function description	
OUTPUTS → RELAY OUTPUT (1...2) → OPERATION	
ACTUAL STATUS RELAY (4740)	Use this function to check the current status of the relay output. A jumper on the contact side defines the relay output as a normally open (NO or make) or normally closed (NC or break) contact (see Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en). User interface: NC OPEN NC CLOSED NO OPEN NO CLOSED
SIMULATION SWITCH POINT (4741)	Use this function to activate simulation of the relay output. Options: OFF ON Factory setting: OFF Note! • The “SIMULATION RELAY” message indicates that simulation is active. • The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs. Caution! The setting is not saved if the power supply fails.

Function description	
OUTPUTS → RELAY OUTPUT (1...2) → OPERATION	
VALUE SIMULATION SWITCH POINT (4742)	 Note! The function is not visible unless the SIMULATION SWITCH POINT function (4741) is active (= ON). Use this function to define the status of the relay output during the simulation. This value is used to test downstream devices and the flowmeter itself. Depending on the relay configuration (as make or break contact) the following selections are available. Options: Relay output configured as normally open (make) contact: NO OPEN NO CLOSED Relay output configured as normally closed (break) contact: NC OPEN NC CLOSED  Caution! The setting is not saved if the power supply fails.

7.3.3 Function group INFORMATION

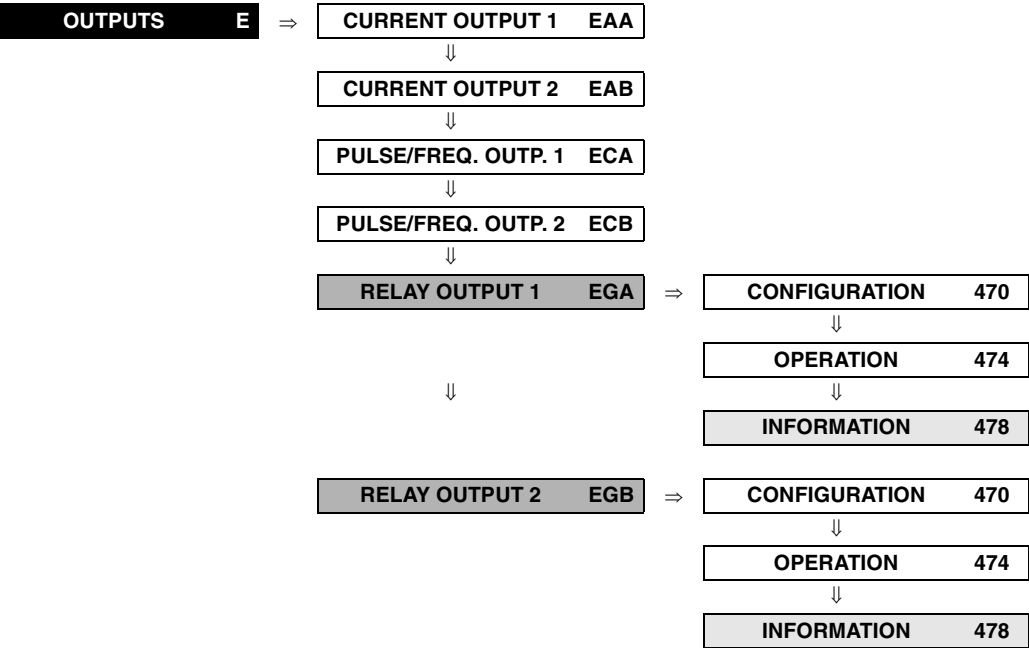

Function description	
OUTPUTS → RELAY OUTPUT (1...2) → INFORMATION	
TERMINAL NUMBER (4780)	Use this function to display the numbers of the terminals (in the connection compartment) which are used by the relay output.

7.3.4 Information on the response of the relay output


General

If you have configured the relay output signal for "LIMIT VALUE" or "FLOW DIRECTION", you can define the requisite switch points in the ON-VALUE and OFF-VALUE functions. When the measured variable in question reaches one of these predefined values, the relay output switches as shown in the illustrations below.

Relay output configured for "flow direction"

The value you entered in the function ON-VALUE defines the switch point for the positive and negative directions of flow.

If, for example, the switch point you define is $1 \text{ m}^3/\text{h}$, the relay drops out at $-1 \text{ m}^3/\text{h}$ and pulls up at $+1 \text{ m}^3/\text{h}$. Set the switch point to 0 if your process calls for direct switchover (no switching hysteresis). If low flow cut off is used, it is advisable to set hysteresis to a value higher than or equal to the low flow cut off rate.

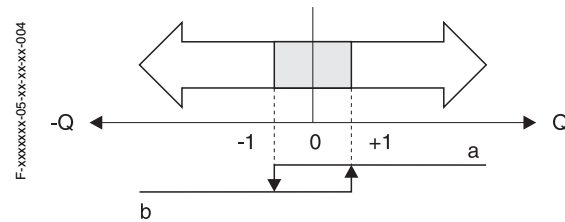

a = Relay energized


b = Relay de-energized

Relay output configured for "limit value"

The relay output signal switches as soon as the measured variable undershoots or overshoots a defined switch point.

Application: Monitoring flow or process-related boundary conditions.

Measured variable




















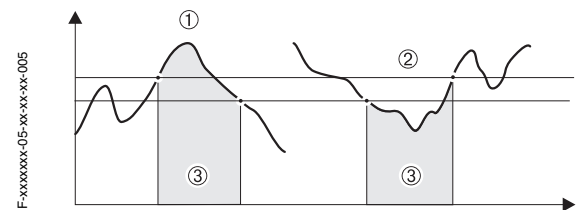








① = $\text{ON} \leq \text{SWITCH-OFF POINT}$ (maximum safety)

② = $\text{ON} > \text{SWITCH-OFF POINT}$ (minimum safety)


③ = Relay de-energized

                    7.3.5 Switching response of the relay output

Function	State		Relay coil	Contact*	
				NC	NO
ON (operation)	System in measuring mode		energized		
	System not in measuring mode (power supply failed)		de-energized		
Fault message	System OK		energized		
	(System or process error) Fault → Response to error, outputs /inputs and totalizers		de-energized		
Notice message	System OK		energized		
	(System or process error) Fault → Continuation of measuring		de-energized		
Fault message or Notice message	System OK		energized		
	(System or process error) Fault → Response to error or Note → Continuation of measuring		de-energized		
Empty pipe detection (EPD) / Open electrode detection (OED)	Measuring tube full		energized		
	Measuring tube partially filled /empty measuring tube		de-energized		
Flow direction	forward		energized		
	reverse		de-energized		

      Function	State	Relay coil	Contact*	
			NC	NO
Limit value – Volume flow – Totalizer	Limit value not overshoot or undershot	 energized		
	Limit value overshoot or undershot	 de-energized		
* Terminal numbers in accordance with the TERMINAL NUMBER function (4780) on Page 84.  Note! If the measuring device has two relays, the factory setting is: • Relay 1 → normally open contact (NO) • Relay 2 → normally closed contact (NC)  Caution! When using the optional software package BATCHING, it is advisable for the contacts (either normally open or normally closed contacts) to have the same switching response for all relay outputs used.				

8 Block INPUTS

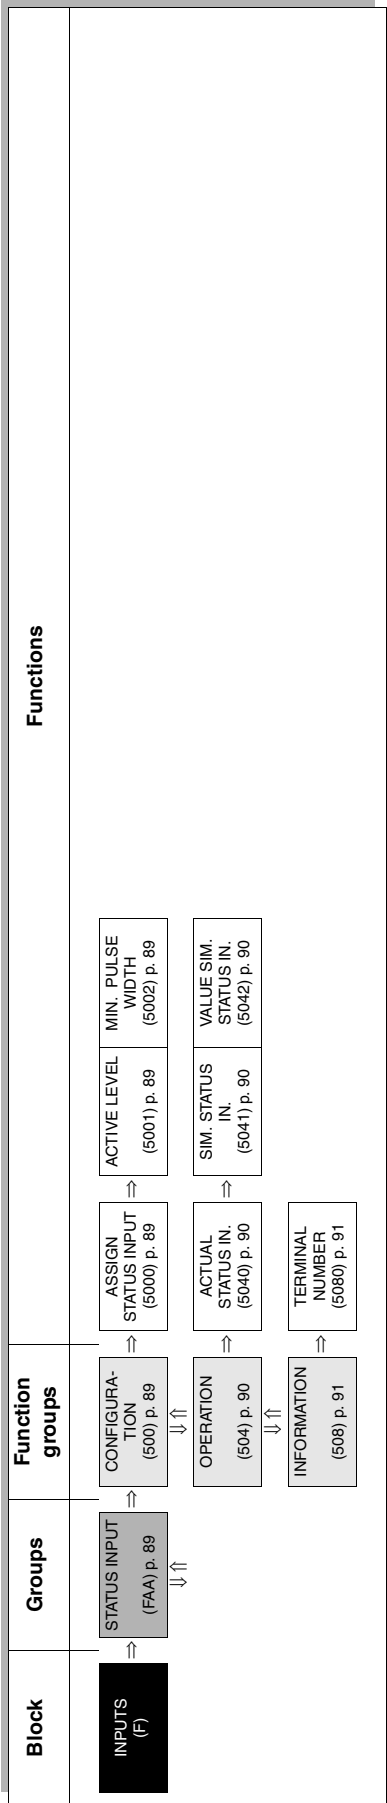


8.1 Group STATUS INPUT

8.1.1 Function group CONFIGURATION

INPUTS	F	⇒	STATUS INPUT	FAA	⇒	CONFIGURATION	500
--------	---	---	--------------	-----	---	---------------	-----


Function description	
INPUTS → STATUS INPUT → CONFIGURATION	
ASSIGN STATUS INPUT (5000)	Use this function to assign a switching function to the status input. Options: OFF RESET TOTALIZER (1...3) RESET ALL TOTALIZERS POSITIVE ZERO RETURN RESET FAULT MESSAGE Advanced options with optional software package BATCHING: RUN BATCHING (start/stop) HOLD BATCHING (stop/continue) RESET BATCH SUM (resetting total quantity / total quantity totalizers) Factory setting: OFF  Caution! Positive zero return is active as long as the level is available at the status input (continuous signal). All other assignments react to a change in level (pulse) at the status input.
ACTIVE LEVEL (5001)	Use this function to define whether the assigned switch function is released or sustained when the signal level is present (HIGH) or not present (LOW). Options: HIGH LOW Factory setting: HIGH
MINIMUM PULSE WIDTH (5002)	Use this function to define a minimum pulse width which the input pulse must achieve in order to trigger the selected switching function (see function ASSIGN STATUS INPUT (5000)). User input: 20...100 ms Factory setting: 50 ms

 8.1.2 Function group OPERATION



Function description	
INPUTS → STATUS INPUT → OPERATION	
ACTUAL STATUS INPUT (5040)	Use this function to view the current level of the status input. User Interface: HIGH LOW
SIMULATION STATUS INPUT (5041)	Use this function to simulate the status input, i.e. to trigger the function (see function ASSIGN STATUS INPUT (5000) on page 89) assigned to the status input. Options: OFF ON Factory setting: OFF  Note! • The "SIMULATION STATUS INPUT" message indicates that simulation is active. • The measuring device continues to measure while simulation is in progress, i.e. the current measuring values are output correctly via the other outputs.  Caution! The setting is not saved if the power supply fails.
VALUE SIMULATION STATUS INPUT (5042)	 Note! The function is not visible unless the SIMULATION STATUS INPUT function (5041) is active (= ON). Use this function to define the level to be assumed at the status output during the simulation. This value is used to test downstream devices and the measuring device itself. Options: HIGH LOW Factory setting: LOW  Caution! The setting is not saved if the power supply fails.

8.1.3 Function group INFORMATION

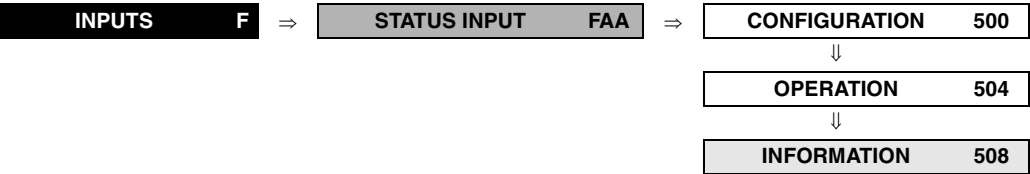

Function description	
INPUTS → STATUS INPUT → INFORMATION	
TERMINAL NUMBER (5080)	Use this function to display the numbers of the terminals (in the connection compartment) which are used by the status input.

9 Block BASIC FUNCTION


Block	Groups	Function groups	Functions				
BASIC FUNCTION (G)	HART (GAA) p. 93	CONFIGURATION (600) p. 93	TAG NAME (6000) p. 93	TAG DESC. (6001) p. 93	BUS ADDRESS (6002) p. 93	HART PROTOCOL (6003) p. 93	WRITE PROTECTION (6004) p. 93
		INFORMATION (604) p. 94	MANUFACTURER ID (6040) p. 94	DEVICE ID (6041) p. 94			
	PROCESS PARAMETER (GIA) p. 95	CONFIGURATION (640) p. 95	ASSIGN LF CUT OFF (6400) p. 95	ON-VALUE LF CUT OFF (6402) p. 95	OFF-VALUE LF CUT OFF (6403) p. 95	PRESSURE SHOCK SUPPR. (6404) p. 96	
		EPD PARAMETER (642) p. 97	EPD/OED MODE (6420) p. 97	EPD/OED RESPON. TIME (6425) p. 98			
	ECC PARAMETER (644) p. 99	ECC PARAMETER (644) p. 99	ECC (6440) p. 99	ECC DURATION (6441) p. 99	ECC RECOV. TIME (6442) p. 100	ECC CLEAN. CYCLE (6443) p. 100	
		ADJUSTMENT (648) p. 101	ADJUSTMENT (6481) p. 101				
	SYSTEM PARAMETER (GLA) p. 102	CONFIGURATION (660) p. 102	INST. DIR. SENSOR (6600) p. 102	FLOW DAMPING (6603) p. 102	INTEGRATION TIME (6604) p. 102	POS. ZERO RETURN (6605) p. 103	
		SENSOR DATA (GNA) p. 104	K-FACTOR POSITIVE (6801) p. 104	K-FACTOR NEGATIVE (6802) p. 104	ZERO POINT (6803) p. 104	NOMINAL DIAMETER (6804) p. 104	
		OPERATION (682) p. 105	MEASURING PERIOD (6820) p. 105	OVERVOLT. TIME (6821) p. 105	EPD ELECTRODE (6822) p. 105	POLARITY ECC (6823) p. 106	

9.1 Group HART

9.1.1 Function group CONFIGURATION

BASIC FUNCTION	G	⇒	HART	GAA	⇒	CONFIGURATION	600
Function description BASIC FUNCTION → HART → CONFIGURATION							
TAG NAME (6000)	Use this function to enter a tag name for the measuring device. You can edit and read this tag name at the local display or via the HART protocol. User input: max. 8-character text, permissible: A-Z, 0-9, +, -, punctuation marks Factory setting: " _ _ _ _ _ _ _ " (no text)						
TAG DESCRIPTION (6001)	Use this function to enter a tag description for the measuring device. You can edit and read this tag description at the local display or via the HART protocol. User input: max. 16-character text, permissible: A-Z, 0-9, +, -, punctuation marks Factory setting: " _ _ _ _ _ _ _ _ _ _ _ _ _ _ _ " (No text)						
BUS ADDRESS (6002)	Use this function to define the address for the exchange of data with the HART protocol. User input: 0...15 Factory setting: 0  Note! Addresses 1...15: a constant 4 mA current is applied.						
HART PROTOCOL (6003)	Use this function to display if the HART protocol is active. User Interface: OFF = HART protocol not active ON = HART protocol active  Note! The HART protocol can be activated with the selection 4-20 mA HART or 4-20 mA (25 mA) HART in the CURRENT SPAN function (see Page 49).						
WRITE PROTECTION (6004)	Use this function to check whether the measuring device can be write-accessed. User interface OFF (Data exchange is possible) ON (Data exchange is disabled) Factory setting: OFF  Note! Write protection is activated and deactivated by means of a jumper on the I/O module (see Operating Instructions <i>PROline promag 53</i> , BA 047D/06/en).						


9.1.2 Function group INFORMATION

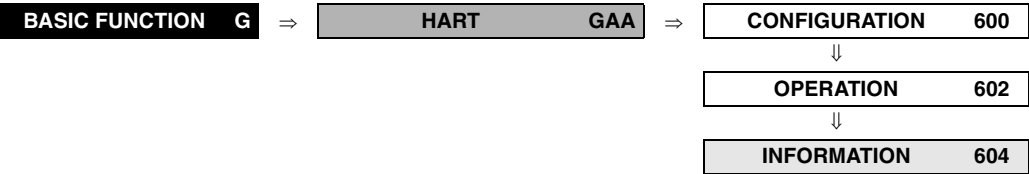



Function description	
BASIC FUNCTION → HART → OPERATION	
MANUFACTURER ID (6040)	Use this function to view the manufacturer ID in decimal numerical format. User Interface: 17 (≅ 11 hex) for Endress+Hauser
DEVICE ID (6041)	Use this function to view the device ID in hexadecimal numerical format. User Interface: 42 (≅ 66 dez) for Promag 53

9.2 Group PROCESS PARAMETER

 
9.2.1 Function group CONFIGURATION



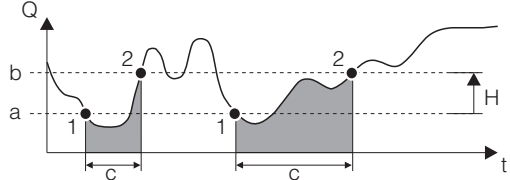Function description	
BASIC FUNCTION → PROCESS PARAMETER → CONFIGURATION	
ASSIGN LOW FLOW CUT OFF (6400)	Use this function to assign the switch point for the low flow cut off. Options: OFF MASS FLOW VOLUME FLOW Factory setting: VOLUME FLOW
ON-VALUE LOW FLOW CUT OFF (6402)	Use this function to enter the switch-on point for low flow cut off. Low flow cut off is active if the value entered is not equal to 0. The sign of the flow value is highlighted on the display to indicate that low flow cut off is active. User input: 5-digit floating-point number [unit] Factory setting: Depends on nominal diameter and country, [value] / [dm³...m³ or US-gal...US-Mgal], corresponding to the factory setting for low flow cut off (see Page 141 ff.).  Note! The appropriate unit is taken from the function UNIT VOLUME FLOW (0402) or UNIT MASS FLOW (0400) (see Page 14 or Page 13).
OFF-VALUE LOW FLOW CUT OFF (6403)	Use this function to enter the switch-off (b) point for low flow cut off. Enter the switch-off point as a positive hysteresis (H) from the switch-on point (a). User input: Integer 0...100% Factory setting: 50% Example:  Q = Flow [volume/time] t = Time H = Hysteresis a = ON-VALUE LOW FLOW CUT OFF (6402) = 200 dm³/h b = OFF-VALUE LOW FLOW CUT OFF (6403) = 10% c = Low flow cut off active 1 = Low flow cut off is switched on at 200 dm³/h 2 = Low flow cut off is switched off at 220 dm³/h

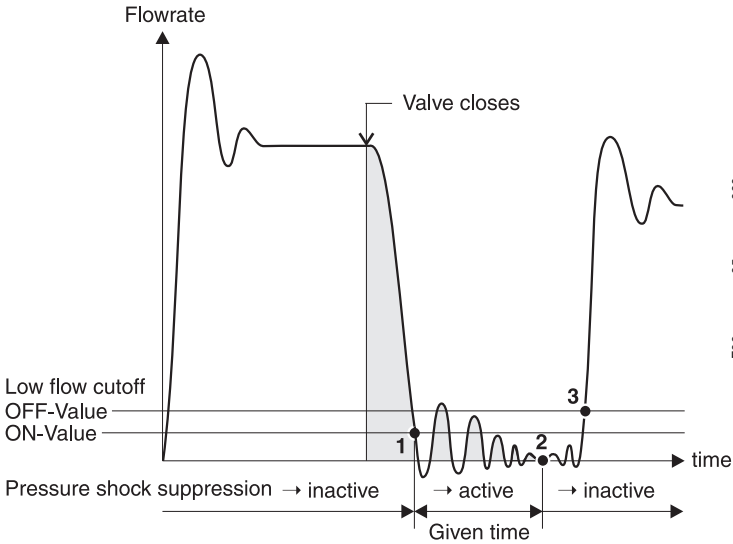Function description	
BASIC FUNCTION → PROCESS PARAMETER → CONFIGURATION	
PRESSURE SHOCK SUPPRESSION (6404)	The closure of a valve can cause brief but severe movements of the fluid in the piping system, movements which the measuring system registers. The pulses totalled in this way result in a totalizer reading error, particularly in the case of batching processes. For this reason, the measuring device is equipped with pressure shock suppression (= short-term signal suppression) which can eliminate system-related "disruptions".  Note! Note that pressure shock suppression cannot be used unless the low flow cut off is active (see ON-VALUE LOW FLOW CUT OFF function on Page 95). Use this function to define the time span for active pressure shock suppression. Activation of the pressure shock suppression Pressure shock suppression is activated one the flow falls below the switch-on point of the low flow cut off (see point 1 in graphic). While pressure shock suppression is active, the following conditions apply: • Current output → outputs the current corresponding to zero flow. • Pulse/frequency output → outputs the frequency corresponding to zero flow. • Flow reading on display → 0 • Totalizer reading → the totalizers are pegged at the last correct value. Deactivation of the pressure shock suppression The pressure shock suppression is deactivated after the time interval, set in this function, has passed (see point 2 in graphic).  Note! The current flow value is displayed and output, when the time interval for the pressure shock suppression has passed and the flow exceeds the switch-off point of the low flow cut off (see point 3 in graphic).  User input: max. 4-digit number, incl. unit: 0.00...100.0 s Factory setting: 0.00 s


9.2.2 Function group EPD PARAMETER

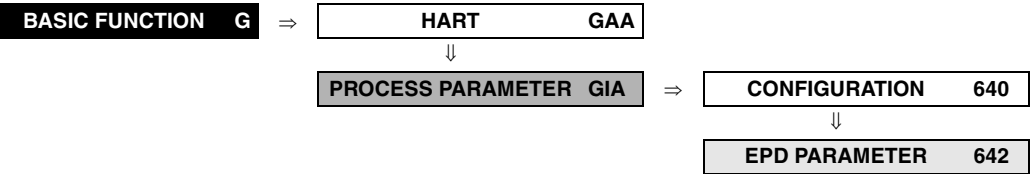

Function description	
BASIC FUNCTION → PROCESS PARAMETER → EPD PARAMETER	
EPD/OED MODE (6420)	Use this function to activate empty pipe detection (EPD) or open electrode detection (OED). Options: OFF EPD (empty pipe detection) OED (open electrode detection) Factory setting: OFF  Note! • The EPD option is not available unless the sensor is equipped with an EPD electrode. • The default setting for the EPD/OED functions when the device is delivered is OFF. The functions must be activated as required. • The EPD/OED function is calibrated at the factory with water (500 µS/cm). If the conductivity of certain fluids deviates from this reference, empty pipe/full pipe adjustment, (see function EPD/OED ADJUSTMENT (6481) on page 101), must be performed on site. • The adjustment coefficients must be valid before switching on the EPD or OED. If these coefficients are not available, the function EPD/OED ADJUSTMENT (6481), see Page 101, is displayed. • The following messages may appear on the display in the event of incorrect adjustment: – ADJUSTMENT FULL = EMPTY: The adjustment values for empty pipe and full pipe are identical. – ADJUSTMENT NOT OK: Adjustment is not possible as the fluid conductivity values are outside the permitted range. In such instances, empty pipe adjustment/full pipe adjustment must be carried out again. Notes on empty pipe detection (EPD) • Flow cannot be measured correctly unless the measuring pipe is completely full. This status can be monitored at all times by means of the EPD. • An empty or partially filled pipe is a process error. A default factory setting defines that a notice message is issued and that this process error has no effect on the outputs. • The EPD process error can be output via the configurable relay or status outputs. • Use the function ASSIGN PROCESS ERROR (8002), see Page 133, to define whether a notice or warning message should be triggered. Response to partially filled pipe If the EPD is switched on and responds to a partially filled or empty pipe, the notice message "EMPTY PIPE" appears on the display. If the pipe is partially empty and the EPD is not switched on, the response can vary in identically configured systems: • Flow reading fluctuates • Zero flow • Excessively high flow values (continued on next page)

Function description	
BASIC FUNCTION → PROCESS PARAMETER → EPD PARAMETER	
EPD/OED MODE (continued)	Notes on open electrode detection (OED) Open electrode detection (OED) functions like the optional empty pipe detection (EPD). In contrast to the EPD where the measuring device must be equipped with a separate (optional) electrode, the OED detects partial filling (fluid no longer covers the measuring electrodes) by means of the two measuring electrodes which are present as standard. Open electrode detection can also be used if: - the sensor is not installed in the optimal position for using EPD (optimal = installed horizontally). - the sensor is not equipped with an additional (optional) EPD electrode.
EPD/OED RESPONSE TIME (6425)	 Note! This function is not available unless EPD or OED was selected in the function EPD/OED MODE (6420). Use this function to enter the time span for which the criteria for an “empty” pipe have to be satisfied without interruption before a notice message or fault message is generated. The setting defined here is used by the active empty pipe detection (EPD) or open electrode detection (OED). User input: fixed-point number: 1.0...100 s Factory setting: 1.0 s  Note! The setting in this function relates to the activated EPD or OED function.


9.2.3 Function group ECC PARAMETER

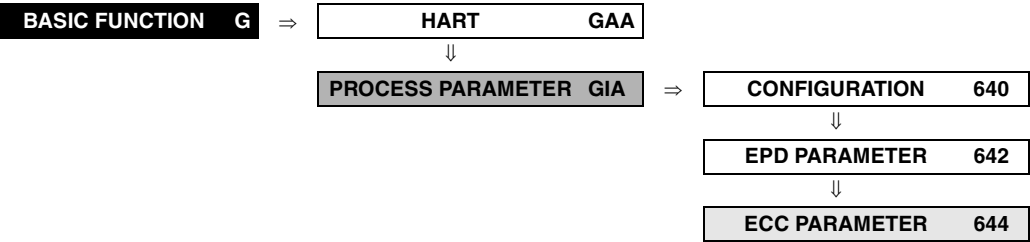

Function description	
BASIC FUNCTION → PROCESS PARAMETER → ECC PARAMETER	
ECC (6440)	 Note! This function is not available unless the measuring device is equipped with an (optional) electrode cleaning function or with the (optional) “Advanced Diagnosis” software package. Use this function to activate cyclical electrode cleaning (ECC) or layer build-up detection. Options: ON (only with the optional electrode cleaning function ECC) OFF COATING (only with the optional software package “Advanced Diagnosis”) Factory setting: ON (only if the optional electrode cleaning function ECC is available) Notes on electrode cleaning (ECC) Conductive deposits on the electrodes and on the walls of the measuring tube (e.g. magnetite) can falsify measurement values. The Electrode Cleaning Circuitry (ECC) was developed to prevent such conductive deposits accreting in the vicinity of the electrodes. ECC functions as described above for all available electrode materials except tantalum. If tantalum is used as the electrode material, the ECC protects the electrode surface only against oxidation.  Caution! If the ECC is switched off for a prolonged period in applications with conductive deposits, a layer forms inside the measuring tube and this can falsify measurement values. If the layer is allowed to accrete beyond a certain level, it might no longer be possible to remove it by switching on the ECC. If this happens the measuring tube must be cleaned and the layer removed. Notes on the software package “Advanced Diagnosis” Layer build-up detection can be activated by means of the optional software package “Advanced Diagnosis”. Its functionality is described on Page 125.
ECC DURATION (6441)	 Note! This function is not available unless the measuring device is equipped with the optional electrode cleaning function (ECC). Use this function to specify the electrode cleaning duration. User input: fixed-point number: 0.01...30.0 s Factory setting: 2.0 s

Function description	
BASIC FUNCTION → PROCESS PARAMETER → ECC PARAMETER	
ECC RECOVERY TIME (6442)	 Note! This function is not available unless the measuring device is equipped with the optional electrode cleaning function (ECC). Use this function to specify the recovery time for which the last flow value measured prior to cleaning is retained. A recovery time is necessary as the signal outputs can fluctuate after electrode cleaning on account of electro-chemical interference voltages. User input: max. 3-digit number: 1...600 s Factory setting: 5 s  Caution! The last value measured prior to cleaning is output for the duration of the recovery time (max. 600 s). This in turn means that the measuring system does not register changes in flow, e.g. stoppage, during this time span.
ECC CLEANING CYCLE (6443)	 Note! This function is not available unless the measuring device is equipped with the optional electrode cleaning function (ECC). Use this function to specify the cleaning cycle for electrode cleaning. User input: Integer: 30...10080 min Factory setting: 30 min


9.2.4 Function group ADJUSTMENT

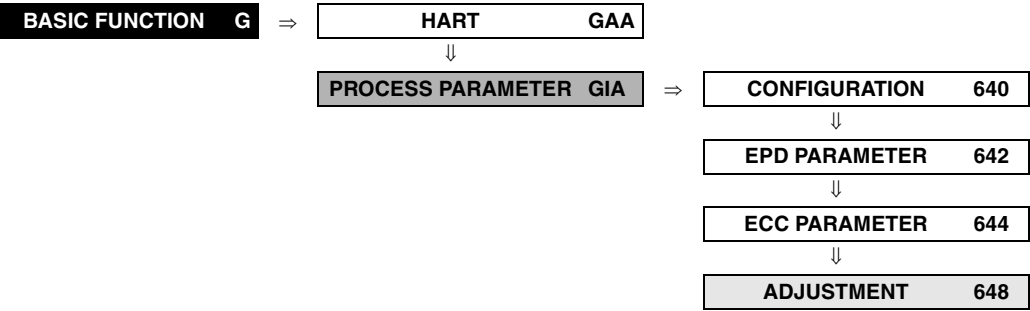

Function description	
BASIC FUNCTION → PROCESS PARAMETER → ADJUSTMENT	
EPD/OED ADJUSTMENT (6481)	Use this function to activate adjustment for an empty or full measuring tube. Options: OFF EPD FULL PIPE ADJUST EPD EMPTY PIPE ADJUST OED FULL PIPE ADJUST OED EMPTY PIPE ADJUST Factory setting: OFF Procedure for EPD or OED empty-pipe / full-pipe adjustment - Empty the piping. For empty pipe adjustment, the walls of the measuring tube should still be coated with fluid. - Start empty pipe adjustment: - Select "EMPTY PIPE ADJUST" and press [E] to confirm. - Fill piping with fluid. - Start full-pipe adjustment with fluid at a standstill: - Select "FULL PIPE ADJUST" and press [E] to confirm. - Terminate the adjustment procedure by selecting "OFF" and pressing [E] to confirm. - When the adjustment procedure is complete, switch on the detection system: Select "EPD" or "OED" (flashing) and press [E] to confirm.

9.3 Group SYSTEM PARAMETER

9.3.1 Function group CONFIGURATION

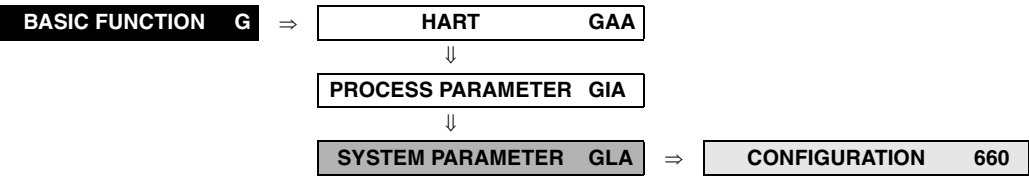


Function description	
BASIC FUNCTION → SYSTEM PARAMETER → CONFIGURATION	
INSTALLATION DIRECTION SENSOR (6600)	Use this function to reverse the sign of the flow quantity, if necessary. Options: NORMAL (flow as indicated by the arrow) INVERSE (flow opposite to direction indicated by the arrow) Factory setting: NORMAL  Note! Ascertain the actual direction of fluid flow with reference to the direction indicated by the arrow on the sensor (nameplate).
FLOW DAMPING (6603)	Use this function to set the filter depth of the digital filter. This reduces the sensitivity of the measuring signal to interference peaks (e.g. high solids content, gas bubbles in the fluid, etc.). The system reaction time increases with the filter setting. User input: 0 ...15 Factory setting: 7  Note! The system damping acts on all functions and outputs of the measuring device.
INTEGRATION TIME (6604)	Use this function to set the integration time. Under normal circumstances it is not necessary to change the factory settings. User input: 3.3...65 ms Factory setting: 20 ms at 50 Hz → mains frequency (e.g. Europe) 16.7 ms at 60 Hz → mains frequency (e.g. USA)  Note! The integration time defines the duration of internal totalling of the induced voltage in the fluid (measured by the measuring electrode), i.e. the time in which the measuring device records the true flow (afterwards the magnetic field for the next integration is created from the opposite pole).

Function description	
BASIC FUNCTION → SYSTEM PARAMETER → CONFIGURATION	
POSITIVE ZERO RETURN (6605)	Use this function to interrupt evaluation of measured variables. This is necessary when a piping system is being cleaned, for example. This setting acts on all function and outputs of the measuring device. Options: OFF ON → Signal output is set to the "ZERO FLOW" value. Factory setting: OFF  Note! Positive zero return may not be activated for batching processes with the optional software package BATCHING.


9.4 Group SENSOR DATA

9.4.1 Function group CONFIGURATION

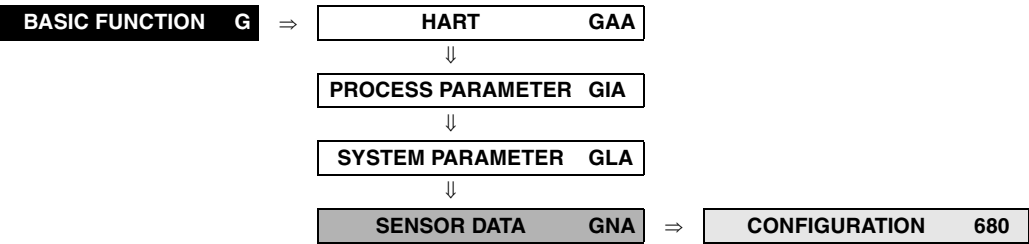

Function description	
BASIC FUNCTION → SENSOR DATA → CONFIGURATION	
All sensor data (calibration factors, zero (point) and nominal diameter) are set at the factory and saved on the S-DAT sensor memory chip. Caution! Under normal circumstances you should not change the following parameter settings, because changes affect numerous functions of the entire measuring facility in general and the accuracy of the measuring system in particular. For this reason, the functions described below cannot be changed even when you enter your personal code. Contact the E+H service organization if you have any questions about these functions. Note! The individual values of the functions are also provided on the sensor nameplate.	
K-FACTOR POSITIVE (6801)	Use this function to display the current calibration factor (positive flow direction) for the sensor. The calibration factor is determined and set at the factory. User interface 5-digit fixed-point number: 0.5000 ...2.0000 Factory setting: Depends on nominal diameter and calibration
K-FACTOR NEGATIVE (6802)	Use this function to display the current calibration factor (negative flow direction) for the sensor. The calibration factor is determined and set at the factory. User interface 5-digit fixed-point number: 0.5000 ...2.0000 Factory setting: Depends on nominal diameter and calibration
ZERO POINT (6803)	This function shows the current zero-point correction value for the sensor. Zero-point correction is determined and set at the factory. User interface max. 4-digit number: -1000 ...+1000 Factory setting: Depends on nominal diameter and calibration
NOMINAL DIAMETER (6804)	This function shows the nominal diameter for the sensor. The nominal diameter depends on the size of the sensor and is set at the factory. User interface 2...2000 mm or 1/12...78" Factory setting: Depends on the size of the sensor

9.4.2 Function group OPERATION

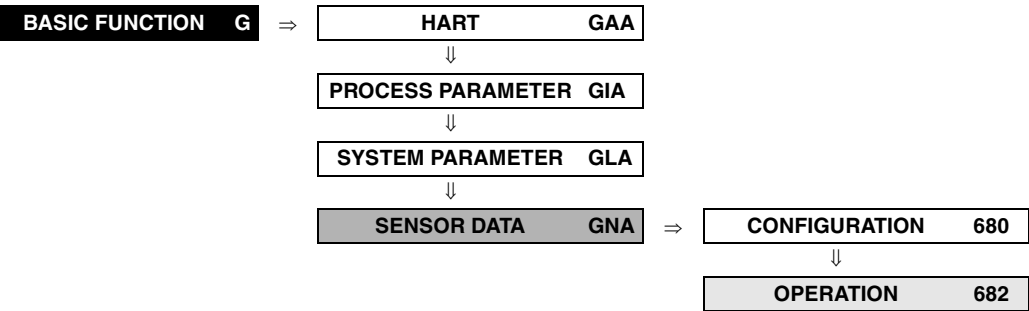

Function description	
BASIC FUNCTION → SENSOR DATA → OPERATION	
All sensor data (measuring period, overvoltage time etc.) are set at the factory and saved on the S-DAT™ sensor memory chip.	
MEASURING PERIOD (6820)	Use this function to set the time for a full measuring period. The duration of the measuring period is calculated from the rise time of the magnetic field, the brief recovery time, the integration time (which can be set) and the empty pipe detection time. User input: 0.0...1000 ms Factory setting: Depends on nominal diameter  Note! The system checks the time entered and sets the measuring period which is actually used internally to a plausible value. If you enter 0 ms, the system automatically computes the shortest time.
 Caution! Under normal circumstances you should not change the following parameter settings, because changes affect numerous functions of the entire measuring facility in general and the accuracy of the measuring system in particular. For this reason, the functions described below cannot be changed even when you enter your personal code. Contact the E+H service organization if you have any questions about these functions.	
OVERVOLTAGE TIME (6821)	Use this function to specify the time in which overvoltage is applied to the coil circuit in order to build up the magnetic field as fast as possible. The overvoltage time is adjusted automatically while measuring is in progress. The overvoltage time depends on the sensor type and the nominal diameter and is set at the factory. User interface 4-digit floating-point number 0.0...100.0 ms Factory setting: Depends on nominal diameter
EPD ELECTRODE (6822)	Use this function to check whether the sensor is equipped with an EPD electrode. User interface YES NO Factory setting: YES → Electrode fitted as standard

Function description	
BASIC FUNCTION → SENSOR DATA → OPERATION	
POLARITY ECC (6823)	Use this function to display the actual current polarity for optional electrode cleaning (ECC). Electrode cleaning uses either a positive or negative current, depending on the electrode material. The measuring device automatically selects the correct polarity on the basis of the electrode-material data stored in the S-DAT. User interface POSITIVE → for electrodes made of: 1.4435, Hastelloy C, platinum NEGATIVE → for electrodes made of: tantalum  Caution! If the incorrect current is applied to the electrodes, the electrode material is destroyed.

10 Block SPECIAL FUNCTION

Block	Groups	Function groups	Functions											
SPECIAL FUNCTION (H)	BATCHING FUNCTION (HCA) p. 108 ⇕⇕	⇒ CONFIGURA- TION (720) p. 108 ⇕⇕	⇒ BATCH SELECTOR (7200) p. 108 ⇒	⇒ BATCH NAME (7201) p. 108 ⇒	⇒ ASSIGN BATCH VAR. (7202) p. 109 ⇒	⇒ BATCH QUANTITY (7203) p. 109 ⇒	⇒ FIX COMP. QUANTITY (7204) p. 109 ⇒	⇒ COMENSAT. MODE (7205) p. 110 ⇒	⇒ CALCULATION MODE (7206) p. 112 ⇒	⇒ AVERAGING DRIP (7207) p. 112 ⇒	⇒ BATCH STAGES (7208) p. 113 ⇒	⇒ INPUT FORMAT (7209) p. 113 ⇒		
		⇕⇕ VALVE PARAMETER (722) p. 114 ⇕⇕	⇕⇕ OPEN VALVE 1 (7220) p. 114 ⇒ (7221) p. 114 ⇒	⇕⇕ CLOSE VALVE 1 (7221) p. 114 ⇒ (7222) p. 115 ⇒	⇕⇕ CLOSE VALVE 2 (7222) p. 115 ⇒ (7223) p. 115 ⇒									
		⇕⇕ SUPERVISION (724) p. 119 ⇕⇕	⇕⇕ MAX. BATCH TIME (7240) p. 119 ⇒	⇕⇕ MIN. BATCHING QUANTITY (7241) p. 120 ⇒	⇕⇕ MAX. BATCH- ING QUANTITY (7242) p. 121 ⇒	⇕⇕ PROGRESS NOTE (7243) p. 121 ⇒								
		⇕⇕ OPERATION (726) p. 122 ⇕⇕	⇕⇕ BATCH PROCEDURE (7260) p. 122 ⇒	⇕⇕ BATCH UPWARDS (7261) p. 122 ⇒	⇕⇕ BATCH DOWNWARDS (7262) p. 123 ⇒	⇕⇕ BATCH COUNTER (7263) p. 123 ⇒	⇕⇕ BATCH SUM (7264) p. 123 ⇒	⇕⇕ RESET SUM/ COUNTER (7265) p. 123 ⇒						
		⇕⇕ INFORMATION (728) p. 124 ⇕⇕	⇕⇕ VALVE 1 INT. SETPOINT (7280) p. 124 ⇒	⇕⇕ DRIP QUANTITY (7281) p. 124 ⇒	⇕⇕ VALVE 1 CLOSING TIME (7282) p. 124 ⇒									
		⇕⇕ ACQUISITION (750) p. 126 ⇕⇕	⇕⇕ RESET HISTORY (7504) p. 126 ⇒											
		⇕⇕ CONFIG. COATING (751) p. 127 ⇕⇕	⇕⇕ PULSE DURATION (7510) p. 127 ⇒	⇕⇕ PULSE INTERVAL (7511) p. 127 ⇒	⇕⇕ DETECTION LEVEL (7512) p. 127 ⇒	⇕⇕ MAX. RELAX. TIME (7513) p. 127 ⇒								
		⇕⇕ OPERATION COATING (752) p. 127 ⇕⇕	⇕⇕ REFERENCE VALUE (7520) p. 128 ⇒	⇕⇕ ACTUAL VALUE (7521) p. 128 ⇒	⇕⇕ MINIMAL VALUE (7522) p. 128 ⇒	⇕⇕ MAXIMUM VALUE (7523) p. 128 ⇒	⇕⇕ HISTORY (7524) p. 128 ⇒	⇕⇕ ACTUAL DEVIATION (7525) p. 128 ⇒						
		⇕⇕ CONFIG. ELECTRODES (754) p. 129 ⇕⇕	⇕⇕ INTERV. POT. HISTORY (7540) p. 129 ⇒											
		⇕⇕ OPER. ELECTR. POT. 1 (755) p. 129 ⇕⇕	⇕⇕ REFERENCE VALUE (7550) p. 130 ⇒	⇕⇕ ACTUAL VALUE (7551) p. 130 ⇒	⇕⇕ MINIMAL VALUE (7552) p. 130 ⇒	⇕⇕ MAXIMUM VALUE (7553) p. 130 ⇒	⇕⇕ HISTORY (7554) p. 130 ⇒	⇕⇕ ACTUAL DEVIATION (7555) p. 130 ⇒						
		⇕⇕ OPER. ELECTR. POT. 2 (754) p. 129 ⇕⇕	⇕⇕ REFERENCE VALUE (7560) p. 131 ⇒	⇕⇕ ACTUAL VALUE (7561) p. 131 ⇒	⇕⇕ MINIMAL VALUE (7562) p. 131 ⇒	⇕⇕ MAXIMUM VALUE (7563) p. 131 ⇒	⇕⇕ HISTORY (7564) p. 131 ⇒	⇕⇕ ACTUAL DEVIATION (7565) p. 131 ⇒						

10.1 Group BATCHING FUNCTION

10.1.1 Function group CONFIGURATION

SPECIAL FUNCTION H

⇒

BATCHING FUNCTION HCA


⇒

CONFIGURATION 720

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION	
BATCH SELECTOR (7200)	Use this function to select a batching specification. There are six different batching specifications available by means of which different batchings can be defined. Options: BATCH # 1 (or the name which was defined for batching specification 1 in the function BATCH NAME (7201). BATCH # 2 (or the name which was defined for batching specification 2 in the function BATCH NAME (7201). BATCH # 3 (or the name which was defined for batching specification 3 in the function BATCH NAME (7201). BATCH # 4 (or the name which was defined for batching specification 4 in the function BATCH NAME (7201). BATCH # 5 (or the name which was defined for batching specification 5 in the function BATCH NAME (7201). BATCH # 6 (or the name which was defined for batching specification 6 in the function BATCH NAME (7201). Factory setting: BATCH #1  Note! • By selecting a batching specification and its related settings (explained below), up to 6 different batchings can be preconfigured and selected as necessary. • All the following functions in this function group, as well as the functions in the function groups VALVE PARAMETER (722) and SUPERVISION (724) are assigned to the batching specification selected here. • All the settings in the following functions of this function group are valid only for the batching specification selected in the function BATCH SELECTOR (7200). In other words, the entry or option is assigned to the batching specification currently selected (e.g. in the factory setting BATCH # 1).
BATCH NAME (7201)	Use this function to assign a specific name to the batching specification . User input: max. 8-character text, permissible: A-Z, 0-9 Factory setting: Name of batching specification (depends on selection in the function BATCH SELECTOR (7200), e.g. "BATCH # 1").  Note! Once an entry has been made (e.g. "BEER 33"), the batch name (BEER 33) appears in the home position when selecting the quantity and the name of the batching specification ("e.g. BATCH # 1") no longer appears.

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION	
ASSIGN BATCH VARIABLE (7202)	Use this function to assign a batching variable to the batching specification. Options: OFF VOLUME FLOW MASS FLOW Factory setting: OFF  Note! - The possible assignments of the display functions are automatically extended. Once a batching variable has been selected (MASS or VOLUME), you can locally define the application-specific function of the minus key (start-stop-continue) and the plus key (stop-batching name/quantity) in the information line by means of the "batching menu" assignment. In this way, a direct batching control station is made available locally at the measuring device by means of the user interface and the controls. - Select OFF if the BATCHING functionality is no longer to be used. All settings related to the function (e.g. switching contact assigned to the relay output) must be assigned to another functionality.
BATCH QUANTITY (7203)	Use this function to define the quantity to be batched. User input: 5-digit floating-point number: 0...max. value (depends on nominal diameter) [unit] Factory setting: 0 [unit]  Note! - The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see Page 13). - When the batching quantity entered here is achieved, valve 1 closes (see function CLOSE VALVE 1 (7221) on Page 114).
FIX COMPENSATION QUANTITY (7204)	Use this function to specify a positive or negative compensation quantity. The compensation quantity balances out a constant, system-related incorrect quantity. This can be caused, for example, by a pump over-running or by the closing time of a valve. The compensation quantity is determined by the system operator. A negative compensation quantity must be specified for over-batching and a positive compensation quantity for underbatching.  Note! The compensation quantity affects batching quantity only and does not affect the after run compensation. User input: Floating-point number with sign (depends on nominal diameter) Factory setting: 0 [unit]  Note! - If the entry range is not sufficient for the compensation quantity, the batching quantity may have to be adjusted. - The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see Page 13).


Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION	
COMENSATION MODE (7205)	Use this function to determine whether the after run quantity or a fixed compensation quantity should be taken into account at the next batching . Options: OFF MODE 1 MODE 2 Factory setting: OFF  Note! The pressure shock suppression must be switched off if MODE 1 or MODE 2 is selected in this function (see function PRESSURE SHOCK SUPPRESSION (6404) on page 96). Detailed explanations and information When batching using the optional software package BATCHING, process-related variable after run quantities or incorrect quantities can be determined and balanced out (by computer) by means of various functions. This ensures a high level of accuracy throughout the entire batching range. • Response when OFF is selected: The batching ends as soon as the quantity specified in the function BATCH QUANTITY (7203) has been achieved. If after running occurs, this is not recorded and is not taken into consideration during the next batching. In this way, in the event of process-related after running, the effective batched quantity is generally larger than the batching quantity specified. • Response when MODE 1 is selected: For short batchings and for batching cycles that follow on quickly from one other. Batching ends before the quantity specified in the function BATCH QUANTITY (7203) is achieved and the after run quantity is recorded. The exact batching switch-off time is calculated based on the previous after run quantities. The number of after run quantities which are to influence the calculation can be specified in the functions AVERAGING DRIP (7207) and CALCULATION MODE (7206). The after run quantity in MODE 1 is determined between the switch-off point and the first undershooting of the low flow cut off. Any subsequent fluid movements are not taken into account. • Response when MODE 2 is selected: For batchings where batching accuracy is vital and where process-related fluctuations in flow occur during after running. Batching ends before the quantity specified in the function BATCH QUANTITY (7203) is achieved and the after run quantity is recorded. The exact batching switch-off time is calculated based on the previous after run quantities. The number of after run quantities which are to influence the calculation can be specified in the functions AVERAGING DRIP (7207) and CALCULATION MODE (7206). The after run quantity in MODE 2 is determined between the switch-off point and the constant undershooting of the low-flow cut off. This means that the lower the setting is for the low-flow cut off, the longer the after run quantity is recorded. The batching is very accurate. (continued on next page)

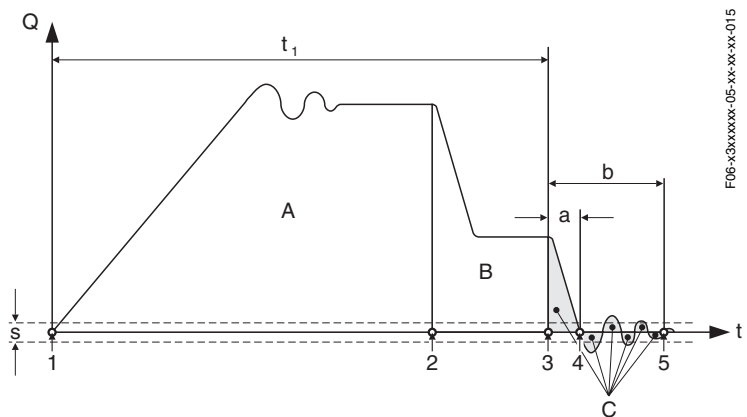Function description SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION	
COMENSATION MODE (continued)	Example diagram of a batching sequence and the respective response in MODE 1 and MODE 2:  Q = Flow t = Time t_1 = time period shorter than or equal to the maximum batching time A = Coarse batching quantity B = Fine batching quantity C = After run quantity (Effective batching quantity = A + B + C) 1 = Coarse batching starts and valve 2 opens (two-stage batching) 2 = Coarse batching ends / fine batching starts, valve 2 closes, valve 1 opens 3 = Fine batching ends, valve 1 closes (automatically when the specified batching quantity is achieved) 4 = After run quantity recording in MODE 1 ends 5 = After run quantity recording in MODE 2 ends a = After run quantity recorded in MODE 1 b = After run quantity recorded in MODE 2 s = Low flow cut off F05-x3xxxxx-05-xx-xx-xx-015

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION	
CALCULATION MODE (7206)	 Note! This function is only available if MODE 1 or MODE 2 is selected in the function COMENSATION MODE (7205). Use this function to select the method for calculating the recorded after run quantities. Options: ALL All after run quantities are used in the calculation. SELECTION The after run quantities recorded are filtered. The smallest and largest after run quantity are not taken into account in the calculation (extreme value filter). Factory setting: ALL  Note! Machine-related (larger) “<i>extreme values</i>”, occurring especially at start-up, delay correction and distort real reproducibility. By selecting “SELECTION”, these <i>extreme values</i> are not taken into account. Example: Function CALCULATION MODE (7206) = SELECTION Function AVERAGING DRIP (7207) = 5 From five after run quantities recorded, the largest and smallest are not used. From the remaining three after run quantities, an average after run quantity is calculated which is taken into account at the next batching.
AVERAGING DRIP (7207)	 Note! This function is only available if MODE 1 or MODE 2 is selected in the function COMENSATION MODE (7205). Use this function to specify the number of after run quantities (cycles) which are included in calculating the batching compensation mode, MODE 1 or MODE 2.  Note! The value entered in this function influences the measuring system reaction time. If you specify: • a small calculation depth (low value entered) = measuring system reacts quickly to differing amount of after run quantities. • a large calculation depth (high value entered) = measuring system reacts slowly to changing after run quantities. User input: 0...100 Factory setting: 0 [cycles]

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → CONFIGURATION	
BATCH STAGES (7208)	Use this function to define the number of batching stages. Batching can be carried out in several stages, e.g. 2-stage batching with fast and precise batching. Options: 1-stage (1 valve or 1-stage batching) 2-stage (2 valves or 2-stage batching) Factory setting: 1-stage (1 valve or 1-stage batching)  Note! • The batching stage selection (number of valves) is directly dependent on the configuration of the outputs. For 2-stage batching two relay outputs must be available in the measuring device. • The functions available in the function group VALVE PARAMETER (Page 114) are dependent on the number of batching stages (number of valves) selected in this function.
INPUT FORMAT (7209)	Use this function to define the entry format of the quantities for the switch points of the valves. Options: VALUE-INPUT (e.g. 10 [unit]) %-INPUT (e.g. 80 [%]) Factory setting: VALUE-INPUT  Note! The entry format selected in this function is also used in the function groups VALVE PARAMETER (Page 114) and SUPERVISION (Page 119).

 10.1.2 Function group VALVE PARAMETER



Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → VALVE PARAMETER	
The parameters for the switching contacts of up to 2 valves can be set in the following functions. The number of switching contacts (valves) available, and thus their settings in this group, is defined in the function BATCH STAGES (7208).	
OPEN VALVE 1 (7220)	Use this function to specify the quantity value at which contact 1 opens. This is used as a switch point for valve 1 to output via an assigned output . The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209). User input: 0...max. value or 0...100% (related to the batching quantity) Factory setting: 0 [unit] or 0 [%]  Note! • Dynamic tracking for %-data: If the value is entered as a %, this %-value always refers to the batching quantity (e.g. 70% of a batching quantity of 10 liters = 7 liters). If the BATCH QUANTITY (7203) is adjusted (reduced/increased), the effective quantity switch point is automatically and dynamically adjusted (e.g. taking 70% and changing the batching quantity from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). • Dynamic tracking for value-data: If you enter value-input, this value is “absolute” for batching quantities that do not change (e.g. always 7 liters for a batching quantity of 10 liters). If the batching quantity (7203) is adjusted (reduced/increased), the quantity switch point is automatically and dynamically adjusted/tracked (e.g. with a new batching quantity changing from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). In other words, the existing value data is tracked as a percentage of the altered batching quantity.
CLOSE VALVE 1 (7221)	Use this function to display the quantity value at which contact 1 (valve 1) closes. The quantity value is displayed either as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209). User Interface: Value or 100% (corresponds to the batching quantity)  Note! The switching contact for valve 1 is the “main contact”, i.e. the closing function of valve 1 is firmly assigned to the batching quantity entered (see function BATCH QUANTITY (7203) on Page 109). In this way, function CLOSE VALVE 1 is also the basis for calculating the after run quantity.

Function description SPECIAL FUNCTION → BATCHING FUNCTION → VALVE PARAMETER	
OPEN VALVE 2 (7222)	Use this function to specify the quantity value at which contact 2 opens. This is used as a switch point for valve 2 to output via an assigned output . The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209). User input: 0...max. value or 0...100% (related to the batching quantity) Factory setting: 0 [unit] or 0 [%]  Note! - Dynamic tracking for %-data: If the value is entered as a %, this %-value always refers to the batching quantity (e.g. 70% of a batching quantity of 10 liters = 7 liters). If the BATCH QUANTITY (7203) is adjusted (reduced/increased), the effective quantity switch point is automatically and dynamically adjusted (e.g. taking 70% and changing the batching quantity from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). - Dynamic tracking for value-data: If you enter value-input, this value is "absolute" for batching quantities that do not change (e.g. always 7 liters for a batching quantity of 10 liters). If the batching quantity (7203) is adjusted (reduced/increased), the quantity switch point is automatically and dynamically adjusted/tracked (e.g. with a new batching quantity changing from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). In other words, the existing value data is tracked as a percentage of the altered batching quantity.
CLOSE VALVE 2 (7223)	Use this function to specify the quantity value at which contact 2 closes. This is used as a switch point for valve 2 to output via an assigned output . The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209). User input: 0...max. value or 0...100% (related to the batching quantity) Factory setting: 0 [unit] or 0 [%]  Note! - Dynamic tracking for %-data: If the value is entered as a %, this %-value always refers to the batching quantity (e.g. 70% of a batching quantity of 10 liters = 7 liters). If the BATCH QUANTITY (7203) is adjusted (reduced/increased), the effective quantity switch point is automatically and dynamically adjusted (e.g. taking 70% and changing the batching quantity from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). - Dynamic tracking for value-data: If you enter value-input, this value is "absolute" for batching quantities that do not change (e.g. always 7 liters for a batching quantity of 10 liters). If the batching quantity (7203) is adjusted (reduced/increased), the quantity switch point is automatically and dynamically adjusted/tracked (e.g. with a new batching quantity changing from 10 to 20 liters, the quantity switch point is adjusted from 7 liters to 14 liters). In other words, the existing value data is tracked as a percentage of the altered batching quantity.

10.1.3 Examples of setting parameters for batching processes


The two examples in the next section clearly show the effect of different entries and options in the function group BATCHING FUNCTION.

Example 1

The first example explains the parameter setting of various functions for carrying out batching and illustrates how functions are affected when the batching quantity is changed.

The following batching is to take place:

- 2-stage batching with a batching quantity of 10 liters in total.
- Coarse batching quantity of 8 liters. Valve 2 opens at the start of the batching and closes when 8 liters is achieved.
- Fine batching of 2 liters. Valve 1 opens at the start of the batching and closes (automatically) when the batching quantity (10 liters) is achieved.
- Once 9 liters have been batched a batching progress message should be generated.
- Value-input should be entered.

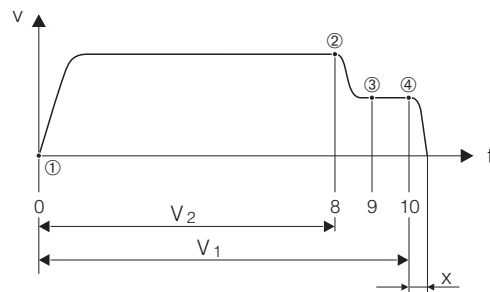

v = Flow velocity [m/s]

t = Time

V_1 = Valve 1 open

V_2 = Valve 2 open

① = Start batching/coarse batching, valves 1 (7220) and 2 (7222) open

② = Valve 2 (7223) closes, coarse batching quantity achieved

③ = Batching progress message (7243)

④ = Valve 1 closes (7221), batching ends

x = After run quantity

The following parameter settings must be made:

- Select the unit for batching:
Function UNIT VOLUME (0403) Page 15 = l (liter)
- Select the measured variable for batching:
Function ASSIGN BATCH VARIABLE (7202) Page 109 = VOLUME FLOW
- Enter the batching quantity:
Function BATCH QUANTITY (7203) Page 109 = 10 [liters]
- Select the entry format:
Function BATCH STAGES (7208) Page 113 = 2-stage
- Select the entry format:
Function INPUT FORMAT (7209) Page 113 = VALUE-INPUT
- Quantity data for when the first valve should open:
Function OPEN VALVE 1 (7220) Page 114 = 0 [liters]
(valve 1 closes automatically when the batching quantity is achieved = 10 [liters], display in function CLOSE VALVE 1 (7221) Page 114)
- Quantity data for when the second valve should open:
Function OPEN VALVE 2 (7224) Page 115 = 0 [liters]

- Quantity data for when the second valve should close:
Function CLOSE VALVE 2 (7223) Page 115 = 8 [liters]
- Quantity data for when the message should be generated:
Function PROGRESS NOTE (7243) Page 121 = 9 [liters]

Example 1 a

Batching specifications identical to those in example 1, however the new batching quantity is 20 liters and the message should be generated once 18 liters are batched.

The following parameters must be set **manually** :

- Enter the new batching quantity:
Function BATCH QUANTITY (7203) Page 109 = 20 [liters]
- New quantity data for when the message should be generated:
Function PROGRESS NOTE (7243) Page 121 = 18 [liters]

The following functions are **automatically** adjusted to suit the new batching quantity:


- Function OPEN VALVE 1 = 0 [liters]
- Function OPEN VALVE 2 = 0 [liters]
- Function CLOSE VALVE 2 = 16 [liters]

Example 2

The second example explains the parameter settings of the various functions for batching with the entry format in % for the switch points of the valves.

The following batching is to take place:

- 2-stage batching with a batching quantity of 15 liters in total.
- Coarse batching quantity from 3 to 12 liters. Valve 2 opens when 20% (3 liters) of the batching quantity is achieved and closes once 80% (12 liters) is achieved.
- Valve 1 opens at the start of the batching and closes (automatically) when the batching quantity (15 liters) is achieved.
- %-data should be entered.

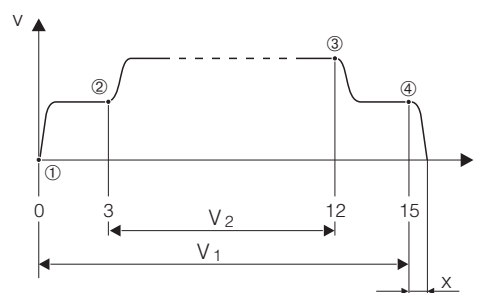

v = Flow velocity [m/s]

t = Time

V_1 = Valve 1 open

V_2 = Valve 2 open

① = Start batching, valve 1 (7220) opens

② = Valve 2 (7222) opens, coarse batching quantity starts

③ = Valve 2 (7223) closes, coarse batching quantity achieved

④ = Valve 1 (7221) closes, end of batching

x = After run quantity

The following parameter settings must be made:

- Select the unit for batching:
Function UNIT VOLUME (0403) Page 15 = l (liter)
- Select the measured variable for batching:
Function ASSIGN BATCH VARIABLE (7202) Page 109 = VOLUME FLOW
- Enter the batching quantity:
Function BATCH QUANTITY (7203) Page 109 = 15 [liters]
- Select the entry format:
Function BATCH STAGES (7208) Page 113 = 2-stage
- Select the entry format:
Function INPUT FORMAT (7209) Page 113 = %-DATA
- Percentage data for when the first valve should open:
Function OPEN VALVE 1 (7220) Page 114 = 0 [%]
(valve 1 closes automatically when the batching quantity is achieved = 15 [liters],
display in function CLOSE VALVE 1 (7221) Page 114)
- Percentage data for when the second valve should open:
Function OPEN VALVE 2 (7224) Page 115 = 20 [%], corresponds to 3 liters
- Percentage data for when the second valve should close:
Function CLOSE VALVE 2 (7223) Page 115 = 80 [%], corresponds to 12 liters

Example 2 a

Batching specifications identical to those in example 1, however the new batching quantity is 45 liters.


The following parameters must be set **manually**:

- Enter the new batching quantity:
Function BATCH QUANTITY (7203) Page 109 = 45 [liters]

The following functions are **automatically** adjusted to suit the new batching quantity:

- Function OPEN VALVE 1 = 0 [%]
- Function OPEN VALVE 2 = 20 [%], corresponds to 9 liters
- Function CLOSE VALVE 2 = 80 [%] corresponds to 36 liters

10.1.4 Function group SUPERVISION

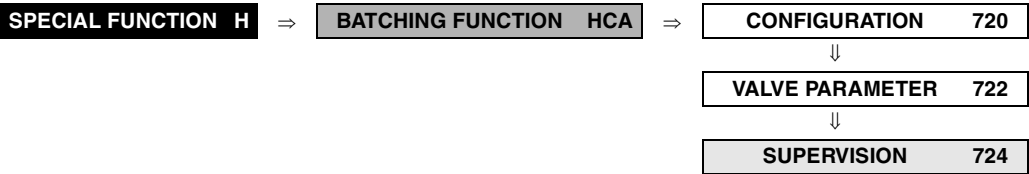


Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION	
MAXIMUM BATCHING TIME (7240)	Use this function to specify a maximum batching time. All valves close once the specified batching time elapses (see functions CLOSE VALVE 1...2, see Page 114 ff.). This function can be used for safety reasons, for example, to ensure all batching valves close in the event of a system fault. User input: 0...30000 s Factory setting: 0 s (= deactivated)  Caution! - When the batching quantity is adjusted (reduced/increased), (see function BATCH QUANTITY (7203) on Page 109), automatic adjustment does not take place i.e. this value must be determined again and re-entered (see also fault message # 471 in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en, Trouble-shooting Chapter). - Batching (START) is not possible when the fault message is active!  Note! - The function is not active if you enter 0 s (factory setting). - This means that the batching valves are not closed by means of this function. - As a factory setting, this function is assigned to a fault message. This appears for 60 seconds. The fault message can be acknowledged earlier by changing a batching function. - If this function is intended more for general monitoring purposes or if there is a short time lapse between two batching processes, it is advisable to assign this function to a notice message (see function ERROR CATEGORY on Page 133). However, while the notice message is active (60 seconds) the next batching can be started and the notice message is thereby acknowledged. - This function can be output via the switch output.

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION	
MINIMUM BATCHING QUANTITY (7241)	Use this function to specify a minimum batching quantity. A message is generated if the minimum batching quantity was not achieved by the time batching ends (e.g. if after run mode is active). The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209). Application: Message stating that underbatching is present (e.g. the contents of the containers does not correspond to the quantity declared). User input: 0...max. value or 0...100% (related to the batching quantity) Factory setting: 0 [unit] (= deactivated)  Caution! • When the batching quantity is adjusted (reduced/increased), (see function BATCH QUANTITY (7203) on Page 109) automatic adjustment does not take place, i.e. this value must be determined again and re-entered (see also fault message # 472 in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en, Trouble-shooting Chapter). • Batching (START) is not possible when the fault message is active!  Note! • The function is not active if you enter 0 (factory setting). • As a factory setting, this function is assigned to a fault message. This appears for 60 seconds. The fault message can be acknowledged earlier by changing a batching function. • If this function is intended more for general monitoring purposes or if there is a short time lapse between two batching processes, it is advisable to assign this function to a notice message (see function ERROR CATEGORY on Page 133). However, while the notice message is active (60 seconds) the next batching can be started and the notice message is acknowledged. • This function can be output via the switch output.

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → SUPERVISION	
MAXIMUM BATCHING QUANTITY (7242)	Use this function to specify a maximum batching quantity. If the maximum batching quantity is exceeded during batching, all valves are closed, batching is stopped and a message is generated. The quantity value is entered as a % or as an absolute value, depending on the option selected in the function INPUT FORMAT (7209). Application: To avoid overbatching and thus prevent critical situations caused by fluid overflow arising in the plant (e.g. plant standstill caused by safety level switches being triggered, contamination, product loss, etc.). User input: 0...2 x max. value or 0...200% (related to the batching quantity) Factory setting: 0 [unit] (= deactivated)  Caution! - When the batching quantity is adjusted (reduced/increased), (see function BATCH QUANTITY (7203) on Page 109) automatic adjustment does not take place, i.e. this value must be determined again and re-entered (see also fault message # 472 in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en, Trouble-shooting Chapter). - Batching (START) is not possible when the fault message is active!  Note! - The function is not active if you enter 0 (factory setting). - As a factory setting, this function is assigned to a fault message. This appears for 60 seconds. The fault message can be acknowledged earlier by changing a batching function. - If this function is intended more for general monitoring purposes or if there is a short time lapse between two batching processes, it is advisable to assign this function to a notice message (see function ERROR CATEGORY on Page 133). However, while the notice message is active (60 seconds) the next batching can be started and the notice message is acknowledged. - This function can be output via the switch output.
PROGRESS NOTE (7243)	Use this function to define a batching quantity at which a message should be generated. When the specified batching quantity is achieved, the message is generated and signaled via an output. The quantity value is entered as a % or as an absolute value, depending on the selection in function INPUT FORMAT (7209). Application: For longer batching processes when preparing or taking measures related to production (e.g. preparing to replace container, etc.). User input: 0...max. value or 0...100% (related to the batching quantity) Factory setting: 0 [unit] (= deactivated)  Caution! When the batching quantity is adjusted (reduced/increased), (see function BATCH QUANTITY (7203) on Page 109) there is no automatic adjustment, i.e. this value must be determined again and re-entered, (see also notice message # 473 in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en, Trouble-shooting Chapter).  Note! - The function is not active if you enter 0 (factory setting). - This function can be output via the switch output. - The batching progress message remains active until batching ends.


10.1.5 Function group OPERATION

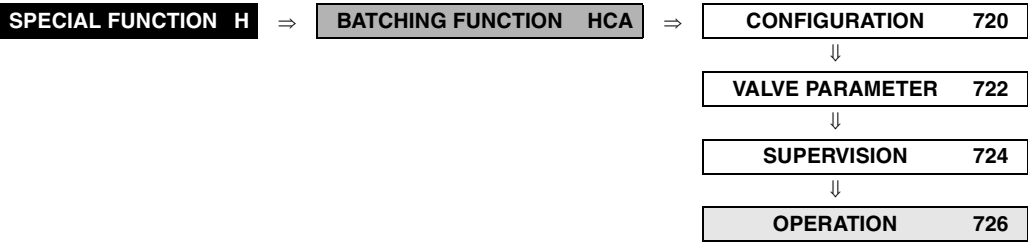

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → OPERATION	
BATCH PROCEDURE (7260)	Use this function to control a batching process. The batching can be started manually or a batching already running can be interrupted or stopped at any time. Options: STOP (Stop batching) START (Start batching) HOLD (Interrupt batching) GO ON (Continue batching) Factory setting: STOP  Note! • This function can also be controlled via the status input (see function ASSIGN STATUS INPUT (5000) onPage 89). • If the information line has been assigned to BATCHING MENU (see Page 39), the application-specific functions of the minus key (START-STOP) and the plus key (HOLD-GO ON / batching specification) are defined locally. In this way, a direct batching control station is available locally at the measuring device by means of the user interface (not access-protected). • In the event of a fault: – during the batching process, the batching is cancelled (STOP) and the local display alternates between displaying the batching menu and the fault message. • If the positive zero return is activated (see Page 103): – during the batching process, the batching is cancelled (STOP). – during a pause in the batching (option PAUSE), the batching cannot be restarted (see also notice messages # 571 and # 572 in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en, Trouble-shooting Chapter).
BATCH UPWARDS (7261)	In this function the batching progress can be read upwards, i.e. starting at 0 the quantity displayed increases until the batching process is complete. User interface Floating-point number incl. unit  Note! The value of this function can be output via the current output.

Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → OPERATION	
BATCH DOWNWARDS (7262)	In this function the batching progress can be read downwards, i.e. starting from the batching quantity, the quantity displayed decreases until the batching process is complete. User interface Floating-point number incl. unit  Note! The value of this function can be output via the current output.
BATCH COUNTER (7263)	Use this function to display the number of batchings carried out. User interface max. 7-digit floating-point number Factory setting: 0  Note! • The batching quantity totalizer can be reset to 0 via the function RESET SUM/COUNTER (7265). • This function is reset to 0 (zero) if a different batching specification is selected in the function BATCH SELECTOR (7200).
BATCH SUM (7264)	Use this function to display the effective overall total of all the batchings carried out. User Interface: max. 7-digit floating-point number [unit] Factory setting: 0 [unit]  Note! • E.g. in 2-stage batching the effective overall total is calculated from the coarse batching quantity, fine batching quantity and after run quantity. • The total batching quantity can be reset to 0 via the function RESET SUM/COUNTER (7265). • This function is reset to 0 (zero) if a different batching specification is selected in the function BATCH SELECTOR (7200).
RESET SUM/COUNTER (7265)	Use this function to reset the batch counter and the batch sum to zero. User input: NO YES Factory setting: NO  Note! The batch counter and the batch sum can also be reset via the batching menu (information line on the local display) .

10.1.6 Function group INFORMATION

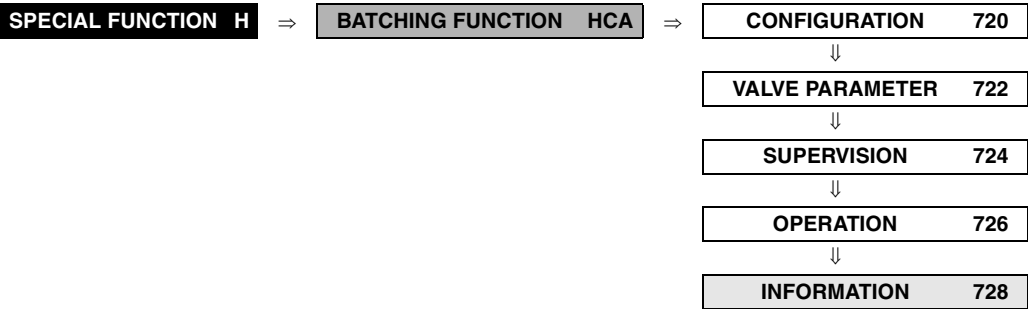


Function description	
SPECIAL FUNCTION → BATCHING FUNCTION → INFORMATION	
INTERNAL SWITCH POINT VALVE 1 (7280)	Use this function to display the internal switch point of valve 1 (see function CLOSE VALVE 1 (7221) on page 114). The value displayed takes the fixed correction quantity and / or the calculated after run quantity into account. User Interface: max. 7-digit floating-point number [unit]  Note! The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see Page 13).
DRIP QUANTITY (7281)	In this function the after run quantity calculated (averaged) internally is displayed and serves to optimize the internal switch point of valve 1. User Interface: max. 7-digit floating-point number [unit]  Note! The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see Page 13).
VALVE 1 CLOSING TIME (7282)	Use this function to display the valve closing time calculated internally. User Interface: max. 7-digit floating-point number [ms]  Note! • The valve closing time is the period between the switch point of valve 1 and the first undershooting of the low flow cut off. • The data can only be taken as a general trend as the accuracy of the time value is directly dependent on the measuring period.

10.2 Group ADVANCED DIAGNOSTICS

Electrode monitoring helps detect layer build-up on the electrodes at an early stage and also detects any damage to the electrodes which could be caused by corrosion or mechanical influences, for example.

Damaged electrodes are detected by monitoring the electrode potential. In the case of layer build-up detection, however, a defined voltage pulse U_B with a pulse width t_p (typically 1...20 ms) is applied periodically to an electrode and its decay time t_R to the detection threshold U_S is measured. The decay time represents a way of measuring the condition of the electrode.

The following graphic figure this process.

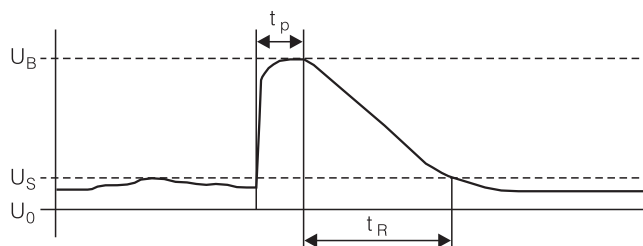

Schematic illustration of the decay time of a voltage pulse at the electrodes.

(U_0 = zero voltage, U_S = detection threshold, U_B = pulse voltage, t_p = pulse width, t_R = decay time)

By analysing an appropriate number of measuring values, you can obtain useful information on trends which indicate possible layer build-up on or damage to the electrodes.

Reference important for trend analysis

As the decay time and the electrode potential are dependent on the process conditions at the electrode (and therefore dependent on the fluid), it is essential to have a reference measurement for each process or each fluid at equilibrium as the starting point for trend analysis. The measuring values are then measured periodically (according to the client's requirements) and saved in the RAM.

In principle, information on the following four factors can be gathered at the device:

- Current value of the decay time or of the electrode potential
- Min./max. values since the last adjustment as control pointer
- History of the last 10 measured values, according to the FIFO principle.
- Current deviation of the current value from the reference value.



Note!

To switch on the advanced diagnosis, select "COATING" in the function ECC (6440), (see Page 99).

10.2.1 Function group ACQUISITION

SPECIAL FUNCTION H

⇒


ADVAN. DIAGNOSTICS HEA

⇒

ACQUISITION 750


Function description	
SPECIAL FUNCTION → ADVANCED DIAGNOSTICS → ACQUISITION	
RESET HISTORY (7504)	Use this function to delete the history and the minimum and maximum values. Options: NO YES Factory setting: NO

 10.2.2 Function group CONFIGURATION COATING




Function description	
SPECIAL FUNCTION → ADVANCED DIAGNOSTICS → CONFIGURATION COATING	
PULSE DURATION (7510)	Use this function to enter the pulse width (t_p) for measuring the decay time. User input: 1...100 ms Factory setting: 1 ms
PULSE INTERVAL (7511)	Use this function to enter the duration of the time interval between the individual voltage pulses for measuring the decay time. User input: 30...86400 s Factory setting: 3600 s (= 1 x per hour)
DETECTION LEVEL (7512)	Use this function to enter the detection threshold (U_S) to which the voltage pulse must decay in order to determine the decay time. The detection threshold is entered as a percentage of the voltage pulse amplitude ($U_B - U_O$). User input: 1...99% Factory setting: 10%
MAXIMUM RELAXATION TIME (7513)	Use this function to enter the maximum duration of decay time measurement. User input: 1...100 s Factory setting: 10 s

10.2.3 Function group OPERATION COATING

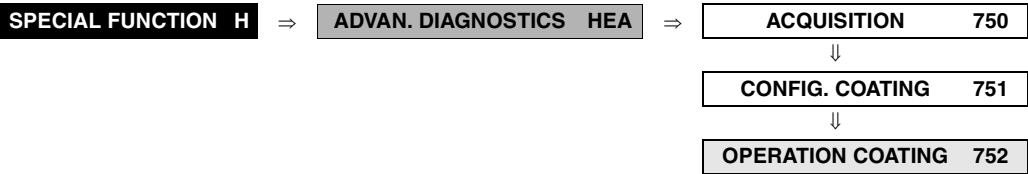


Function description	
SPECIAL FUNCTION → ADVANCED DIAGNOSTICS → CONFIGURATION COATING	
REFERENCE VALUE (7520)	Use this function to enter a reference value for the decay time. The reference value is essential as the starting point for trend analysis and should be taken for each process or fluid at equilibrium. User input: 0.001...100 s Factory setting: 0 s
ACTUAL VALUE (7521)	The current measured value (t_R) of the decay time is displayed.
MINIMAL VALUE (7522)	The smallest measured value of the decay time since the history was last reset or deleted appears on the display.
MAXIMUM VALUE (7523)	The largest measured value of the decay time since the history was last reset or deleted appears on the display.
HISTORY (7524)	The last 10 measured values of the decay time since the history was last reset or deleted appear on the display The history is updated after each PULSE INTERVAL (7511) has elapsed.
ACTUAL DEVIATION (7525)	The deviation between the current (last measured) value of the decay time and the reference value defined in function REFERENCE VALUE (7520) appears on the display.

10.2.4 Function group CONFIGURATION ELECTRODES

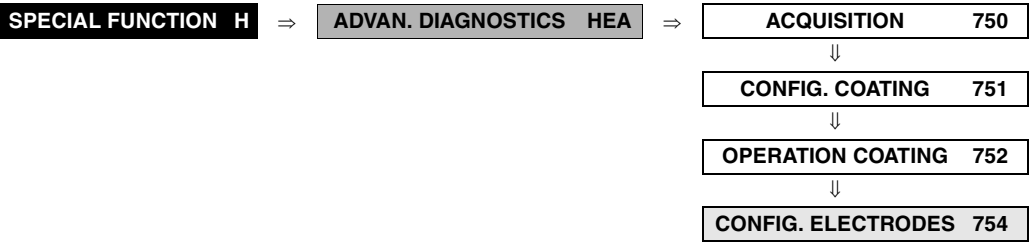


Function description	
SPECIAL FUNCTION → ADVANCED DIAGNOSTICS → CONFIGURATION ELECTRODES	
INTERVAL POTENTIAL HISTORY (7540)	Use this function to specify the time lapse after which the electrode potential measuring values are saved in the history. User input: 1...99999 s Factory setting: 3600 s (= 1 x per hour)

10.2.5 Function group OPERATION ELECTRODE POTENTIAL 1

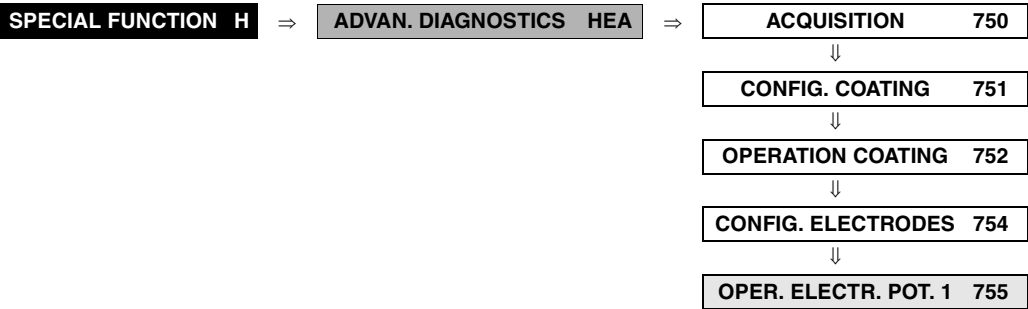

Function description	
SPECIAL FUNCTION → ADVANCED DIAGNOSTICS → OPERATION ELECTRODE POTENTIAL 1	
REFERENCE VALUE (7550)	Use this function to enter a reference value for the electrode potential of electrode 1. The reference value is essential as the starting point for trend analysis and should be taken for each process or fluid at equilibrium. User input: -1500...+1500 mV Factory setting: 0 mV
ACTUAL VALUE (7551)	The current measured value of the electrode potential of electrode 1 appears on the display.
MINIMAL VALUE (7552)	The smallest measured value of the electrode potential of electrode 1 since the history was last reset or deleted appears on the display.
MAXIMUM VALUE (7553)	The largest measured value of the electrode potential of electrode 1 since the history was last reset or deleted appears on the display.
HISTORY (7554)	The last 10 measured values of the electrode potential of electrode 1 since the history was last reset or deleted appear on the display. The history is updated after each time interval has elapsed.
ACTUAL DEVIATION (7555)	The deviation between the current (last measured) value of the electrode potential of electrode 1 and the reference value defined in the function REFERENCE VALUE (7550) appears on the display.

10.2.6 Function group OPERATION ELECTRODE POTENTIAL 2

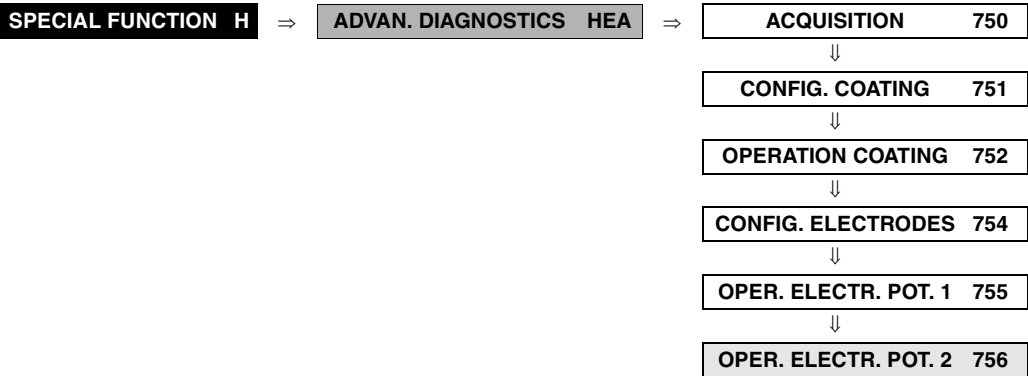

Function description	
SPECIAL FUNCTION → ADVANCED DIAGNOSTICS → OPERATION ELECTRODE POTENTIAL 2	
REFERENCE VALUE (7560)	Use this function to enter a reference value for the electrode potential of electrode 2. The reference value is essential as the starting point for trend analysis and should be taken for each process or fluid at equilibrium. User input: –1500...+1500 mV Factory setting: 0 mV
ACTUAL VALUE (7561)	The current measured value of the electrode potential of electrode 2 appears on the display.
MINIMAL VALUE (7562)	The smallest measured value of the electrode potential of electrode 2 since the history was last reset or deleted appears on the display.
MAXIMUM VALUE (7563)	The largest measured value of the electrode potential of electrode 2 since the history was last reset or deleted appears on the display.
HISTORY (7564)	The last 10 measured values of the electrode potential of electrode 2 since the history was last reset or deleted appear on the display. The history is updated after each time interval has elapsed.
ACTUAL DEVIATION (7565)	The deviation between the current (last measured) value of the electrode potential of electrode 2 and the reference value defined in the function REFERENCE VALUE (7550) appears on the display.

11 Block SUPERVISION

Block	Groups	Function groups	Functions						
SUPERVISION (J)	SYSTEM (JAA) p. 133	CONFIGURATION (800) p. 133	ASSIGN SYS. ERROR (8000) p. 133	ERROR CATEGORY (8001) p. 133	ASSIGN PROC. ERROR (8002) p. 133	ERROR CATEGORY (8003) p. 133	ACKNOWLEDGE FAULTS (8004) p. 134	ALARM DELAY (8005) p. 134	
		OPERATION (804) p. 135	ACT SYST. CONDITION (8040) p. 135	PREV. SYST. CONDITION (8041) p. 135	SIM. FAILSAFE MODE (8042) p. 135	SIM. MEASURED (8043) p. 135	VAL. SIM. MEASUREMENT (8044) p. 135	SYSTEM RESET (8046) p. 136	TROUBLE-SHOOTING (8047) p. 136
	VERSION INFO (JCA) p. 137	SENSOR (820) p. 137	SERIAL NUMBER (8200) p. 137	SENSOR TYPE (8201) p. 137	HW REV. NO. SENSOR (8202) p. 137	SW REV. NO. S-DAT (8205) p. 137			
		AMPLIFIER (822) p. 137	HW REV. NO. AMPLIFIER (8220) p. 137	SW REV. NO. AMPLIFIER (8222) p. 137	SW REV. NO. T-DAT (8225) p. 137				
		F-CHIP (824) p. 138	STATUS F-CHIP (8240) p. 138	HW REV. NO. F-CHIP (8242) p. 138	SW REV. NO. F-CHIP (8244) p. 138				
		I/O MODULE (830) p. 138	I/O MODULE TYPE (8300) p. 138	HW REV. NO. I/O MODULE (8301) p. 138	SW REV. NO. I/O MODULE (8303) p. 138				
		IN-/OUTPUT 1 (832) p. 139	I/O TYPE 1 (8320) p. 139	HW ID NO. I/O 1 (8322) p. 139					
		IN-/OUTPUT 2 (834) p. 139	I/O TYPE 2 (8340) p. 139	HW ID NO. I/O 2 (8342) p. 139					
		IN-/OUTPUT 3 (836) p. 139	I/O TYPE 3 (8360) p. 139	HW ID NO. I/O 3 (8362) p. 139					
		IN-/OUTPUT 4 (838) p. 139	I/O TYPE 4 (8380) p. 139	HW ID NO. I/O 4 (8382) p. 139					

11.1 Group SYSTEM


11.1.1 Function group CONFIGURATION

SUPERVISION	J	⇒	SYSTEM	JAA	⇒	CONFIGURATION	800
--------------------	----------	---	---------------	------------	---	----------------------	------------

Function description	
SUPERVISION → SYSTEM → CONFIGURATION	
ASSIGN SYSTEM ERROR (8000)	Use this function to view all system errors and the associated error categories (fault message or notice message). If you select a single system error you can change its error category. User Interface: CANCEL List of system errors with an icon preceding each entry.  Note! - Press the key [E] twice to call up the function ERROR CATEGORY (8001). - Use the [↵] key combination or select "CANCEL" in the system error list to exit the function. - A list of possible system errors is provided in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en
ERROR CATEGORY (8001)	Use this function to define whether a system error triggers a notice message or a fault message. If you select FAULT MESSAGES, all outputs respond to an error in accordance with their defined error response patterns. Options: NOTICE MESSAGES (display only) FAULT MESSAGES (outputs and display)  Note! Press the key [E] twice to call up the function ASSIGN SYSTEM ERROR (8000).
ASSIGN PROCESS ERROR (8002)	Use this function to view all process errors and the associated error categories (fault message or notice message). If you select a single process error you can change its error category. User Interface: CANCEL List of process errors with an icon preceding each entry.  Note! - Press the key [E] twice to call up the function ERROR CATEGORY (8003). - Use the [↵] key combination or select "CANCEL" in the process error list to exit the function. - A list of possible process errors is provided in the Operating Instructions <i>PROline promag 53</i>, BA 047D/06/en
ERROR CATEGORY (8003)	Use this function to define whether a process error triggers a notice message or a fault message. If you select FAULT MESSAGES, all outputs respond to an error in accordance with their defined error response patterns. Options: NOTICE MESSAGES (display only) FAULT MESSAGES (outputs and display)  Note! Press the key [E] twice to call up the function ASSIGN PROCESS ERROR (8002).

Function description	
SUPERVISION → SYSTEM → CONFIGURATION	
ACKNOWLEDGE FAULTS (8004)	Use this function to define the measuring device's response to fault messages. Options: OFF The measuring device resumes normal operation when the fault is rectified. ON The fault message always has to be acknowledged by pressing the  key on the local display before the measuring device can resume normal operation. Factory setting: OFF
ALARM DELAY (8005)	Use this function to define a time span in which the criteria for a fault have to be satisfied without interruption before a fault or notice message is generated. Depending on the setting and the type of fault, this suppression acts on: • Display • Relay output • Current output • Frequency output User input: 0...100 s (in steps of one second) Factory setting: 0 s  Caution! If this function is activated fault and notice messages are delayed by the time corresponding to the setting before being transmitted to the higher-order controller (process controller, etc.). It is therefore imperative to check in advance in order to make sure whether a delay of this nature could affect the safety requirements of the process. If fault and notice messages may not be suppressed, a value of 0 seconds must be entered here.

 11.1.2 Function group OPERATION



Function description	
SUPERVISION → SYSTEM → OPERATION	
ACTUAL SYSTEM CONDITION (8040)	Use this function to check the present system condition. User Interface: "SYSTEM OK" or the fault / notice message with the highest priority.
PREVIOUS SYSTEM CONDITIONS (8041)	Use this function to view the fifteen most recent fault and notice messages since measuring last started. User Interface: The 15 most recent fault or notice messages.
SIMULATION FAILSAFE MODE (8042)	Use this function to set all inputs, outputs and totalizers to their defined failsafe modes, in order to check whether they respond correctly. During this time, the words "SIMULATION FAILSAFE MODE" appear on the display. Options: ON OFF Factory setting: OFF
SIMULATION MEASURAND (8043)	Use this function to set all inputs, outputs and totalizers to their defined flow-response modes, in order to check whether they respond correctly. During this time, the words "SIMULATION MEASURAND" appear on the display. Options: OFF MASS FLOW VOLUME FLOW Factory setting: OFF  Caution! • The measuring device cannot be used for measuring while this simulation is in progress. • The setting is not saved if the power supply fails.
VALUE SIMULATION MEASURAND (8044)	 Note! The function is not visible unless the SIMULATION MEASURAND function (8043) is active. Use this function to specify a selectable value (e.g. 12 m³/s). This is used to test the associated functions in the device itself and downstream signal loops. User input: 5-digit floating-point number [unit] Factory setting: 0 [unit]  Caution! • The setting is not saved if the power supply fails. • The appropriate unit is taken from the function group SYSTEM UNITS (ACA), (see Page 13).

Function description	
SUPERVISION → SYSTEM → OPERATION	
SYSTEM RESET (8046)	Use this function to perform a reset of the measuring system. Options: NO RESTART SYSTEM (restart without interrupting power supply) Factory setting: NO
TROUBLESHOOTING (8047)	Use this function to rectify faults in the EEPROM. The EEPROM is divided into a number of blocks. Only blocks in which an fault has occurred are shown. To rectify the fault, select the block in question and press the  key to acknowledge the fault.  Caution! When you clear an fault in a block, the parameters of the block you select are reset to their factory settings. Options: CANCEL "Faulty Block"

11.2 Group VERSION INFO

11.2.1 Function group SENSOR

SUPERVISIONJ

⇒

SYSTEMJAA

↓

VERSION INFOJCA

⇒

SENSOR820

Function description	
SUPERVISION → VERSION INFO → SENSOR	
SERIAL NUMBER (8200)	Use this function to view the serial number of the sensor.
SENSOR TYPE (8201)	Use this function to view the sensor type.
HARDWARE REVISION NUMBER SENSOR (8202)	Use this function to view the hardware revision number of the sensor.
SOFTWARE REVISION NUMBER S-DAT (8205)	Use this function to view the software revision number of the software used to create the content of the S-DAT.

11.2.2 Function group AMPLIFIER

SUPERVISIONJ

⇒

SYSTEMJAA

↓

VERSION INFOJCA

⇒


SENSOR820

↓

AMPLIFIER822


Function description	
SUPERVISION → VERSION INFO → AMPLIFIER	
HARDWARE REVISION NUMBER AMPLIFIER (8220)	Use this function to view the hardware revision number of the amplifier.
SOFTWARE REVISION NUMBER AMPLIFIER (8222)	Use this function to view the software revision number of the amplifier.
SOFTWARE REVISION NUMBER T-DAT (8225)	Use this function to view the software revision number of the software used to create the content of the T-DAT.

11.2.3 Function group F-CHIP

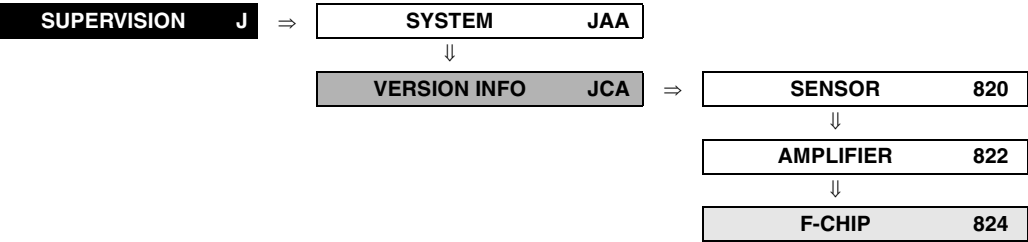


Function description	
SUPERVISION → VERSION INFO → F-CHIP	
STATUS F-CHIP (8240)	Use this function to check whether an F-CHIP is installed and which software options are available.
HARDWARE REVISION NUMBER F-CHIP (8242)	Note! This function is not available unless the measuring device is equipped an F-CHIP. Use this function to view the hardware revision number of the F-CHIP.
SOFTWARE REVISION NUMBER F-CHIP (8244)	Note! This function is not available unless the measuring device is equipped an F-CHIP. Use this function to view the software revision number of the F-CHIP.

11.2.4 Function group I/O MODULE

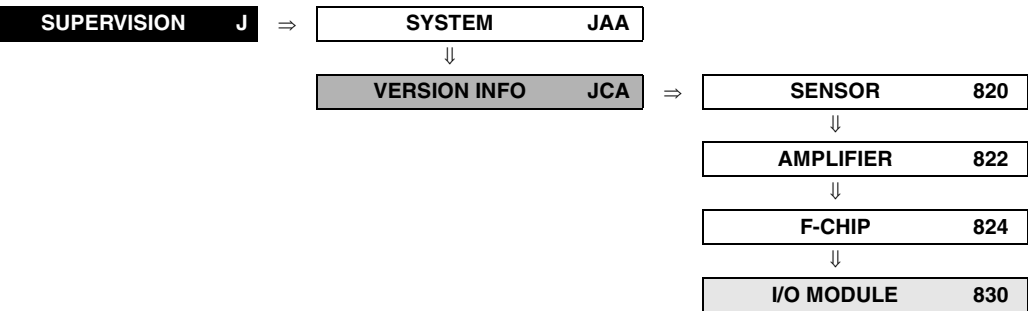

Function description	
SUPERVISION → VERSION INFO → I/O MODULE	
I/O MODULE TYPE (8300)	Use this function to view the configuration of the I/O module complete with terminal numbers.
HARDWARE REVISION NUMBER I/O MODULE (8301)	Use this function to view the hardware revision number of the I/O module.
SOFTWARE REVISION NUMBER I/O MODULE (8303)	Use this function to view the software revision number of the I/O module.

11.2.5 Function groups INPUT /OUTPUT 1...4

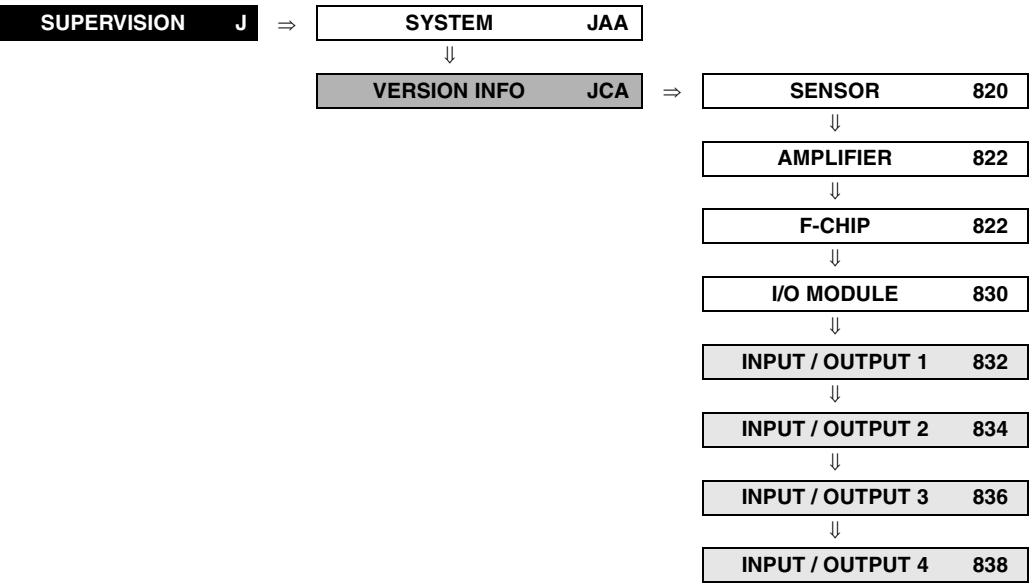

Function description	
SUPERVISION → VERSION INFO → INPUT / OUTPUT 1...4	
TYPE INPUT/OUTPUT: 1 = (8320), 2 = (8340), 3 = (8360), 4 = (8380)	Use this function to view the configuration complete with terminal numbers.
HARDWARE ID NUMBER INPUT / OUTPUT: 1 = (8322), 2 = (8342), 3 = (8362), 4 = (8382)	Use this function to view the hardware ID number.

12 Factory settings

12.1 SI units (not for USA and Canada)

12.1.1 Low flow cut off, full scale value, pulse value, totalizer

Nominal diameter		Low flow cut off (approx. v = 0.04 m/s)			Full scale value (approx. v = 2.5 m/s)			Pulse value (approx. 2 pulse/sec. at 2.5 m/s)			Totalizer	
[mm]	[inch]		Volume	Mass		Volume	Mass		Vol.	Mass	Vol.	Mass
2	1/12"	0.01	dm ³ /min	kg/min	0.5	dm ³ /min	kg/min	0.005	dm ³	kg	dm ³	kg
4	5/32"	0.05	dm ³ /min	kg/min	2	dm ³ /min	kg/min	0.025	dm ³	kg	dm ³	kg
8	5/16"	0.1	dm ³ /min	kg/min	8	dm ³ /min	kg/min	0.10	dm ³	kg	dm ³	kg
15	1/2"	0.5	dm ³ /min	kg/min	25	dm ³ /min	kg/min	0.20	dm ³	kg	dm ³	kg
25	1"	1	dm ³ /min	kg/min	75	dm ³ /min	kg/min	0.50	dm ³	kg	dm ³	kg
32	1 1/4"	2	dm ³ /min	kg/min	125	dm ³ /min	kg/min	1.00	dm ³	kg	dm ³	kg
40	1 1/2"	3	dm ³ /min	kg/min	200	dm ³ /min	kg/min	1.50	dm ³	kg	dm ³	kg
50	2"	5	dm ³ /min	kg/min	300	dm ³ /min	kg/min	2.50	dm ³	kg	dm ³	kg
65	2 1/2"	8	dm ³ /min	kg/min	500	dm ³ /min	kg/min	5.00	dm ³	kg	dm ³	kg
80	3"	12	dm ³ /min	kg/min	750	dm ³ /min	kg/min	5.00	dm ³	kg	dm ³	kg
100	4"	20	dm ³ /min	kg/min	1200	dm ³ /min	kg/min	10.00	dm ³	kg	dm ³	kg
125	5"	30	dm ³ /min	kg/min	1850	dm ³ /min	kg/min	15.00	dm ³	kg	dm ³	kg
150	6"	2.5	m ³ /h	t/h	150	m ³ /h	t/h	0.025	m ³	t	m ³	t
200	8"	5.0	m ³ /h	t/h	300	m ³ /h	t/h	0.05	m ³	t	m ³	t
250	10"	7.5	m ³ /h	t/h	500	m ³ /h	t/h	0.05	m ³	t	m ³	t
300	12"	10	m ³ /h	t/h	750	m ³ /h	t/h	0.10	m ³	t	m ³	t
350	14"	15	m ³ /h	t/h	1000	m ³ /h	t/h	0.10	m ³	t	m ³	t
400	16"	20	m ³ /h	t/h	1200	m ³ /h	t/h	0.15	m ³	t	m ³	t
450	18"	25	m ³ /h	t/h	1500	m ³ /h	t/h	0.25	m ³	t	m ³	t
500	20"	30	m ³ /h	t/h	2000	m ³ /h	t/h	0.25	m ³	t	m ³	t
600	24"	40	m ³ /h	t/h	2500	m ³ /h	t/h	0.30	m ³	t	m ³	t
700	28"	50	m ³ /h	t/h	3500	m ³ /h	t/h	0.50	m ³	t	m ³	t
–	30"	60	m ³ /h	t/h	4000	m ³ /h	t/h	0.50	m ³	t	m ³	t
800	32"	75	m ³ /h	t/h	4500	m ³ /h	t/h	0.75	m ³	t	m ³	t
900	36"	100	m ³ /h	t/h	6000	m ³ /h	t/h	0.75	m ³	t	m ³	t
1000	40"	125	m ³ /h	t/h	7000	m ³ /h	t/h	1.00	m ³	t	m ³	t
–	42"	125	m ³ /h	t/h	8000	m ³ /h	t/h	1.00	m ³	t	m ³	t
1200	48"	150	m ³ /h	t/h	10000	m ³ /h	t/h	1.50	m ³	t	m ³	t
–	54"	200	m ³ /h	t/h	13000	m ³ /h	t/h	1.50	m ³	t	m ³	t
1400	–	225	m ³ /h	t/h	14000	m ³ /h	t/h	2.00	m ³	t	m ³	t
–	60"	250	m ³ /h	t/h	16000	m ³ /h	t/h	2.00	m ³	t	m ³	t
1600	–	300	m ³ /h	t/h	18000	m ³ /h	t/h	2.50	m ³	t	m ³	t
–	66"	325	m ³ /h	t/h	20500	m ³ /h	t/h	2.50	m ³	t	m ³	t
1800	72"	350	m ³ /h	t/h	23000	m ³ /h	t/h	3.00	m ³	t	m ³	t
–	78"	450	m ³ /h	t/h	28500	m ³ /h	t/h	3.50	m ³	t	m ³	t
2000	–	450	m ³ /h	t/h	28500	m ³ /h	t/h	3.50	m ³	t	m ³	t

12.1.2 Language

Country	Language
Australia	English
Austria	Deutsch
Belgium	Francais
Denmark	Dansk
England	English
Finland	Suomi
France	Francais
Germany	Deutsch
Hong Kong	English
Hungary	English
India	English
Instruments International	English
Italy	Italiano
Japan	Japanese
Malaysia	English
Netherlands	Nederlands
Norway	Norsk
Singapore	English
South Africa	English
Spain	Espanol
Sweden	Svenska
Switzerland	Deutsch
Thailand	English

12.1.3 Density, length, temperature

	Unit
Density	kg/l
Length	mm
Temperature	°C

12.2 US units (only for USA and Canada)

12.2.1 Low flow cut off, full scale value, pulse value, totalizer

Nominal diameter		Low flow cut off (approx. v = 0.04 m/s)			Full scale value (approx. v = 2.5 m/s)			Pulse value (approx. 2 pulse/sec. at 2.5 m/s)			Totalizer	
[inch]	[mm]		Volume	Mass		Volume	Mass		Vol.	Mass	Vol.	Mass
1/12"	2	0.002	gal/min	lb/min	0.1	gal/min	lb/min	0.001	gal	lb	gal	lb
5/32"	4	0.008	gal/min	lb/min	0.5	gal/min	lb/min	0.005	gal	lb	gal	lb
5/16"	8	0.025	gal/min	lb/min	2	gal/min	lb/min	0.02	gal	lb	gal	lb
1/2"	15	0.10	gal/min	lb/min	6	gal/min	lb/min	0.05	gal	lb	gal	lb
1"	25	0.25	gal/min	lb/min	18	gal/min	lb/min	0.20	gal	lb	gal	lb
1 1/4"	32	0.50	gal/min	lb/min	30	gal/min	lb/min	0.20	gal	lb	gal	lb
1 1/2"	40	0.75	gal/min	lb/min	50	gal/min	lb/min	0.50	gal	lb	gal	lb
2"	50	1.25	gal/min	lb/min	75	gal/min	lb/min	0.50	gal	lb	gal	lb
2 1/2"	65	2.0	gal/min	lb/min	130	gal/min	lb/min	1	gal	lb	gal	lb
3"	80	2.5	gal/min	lb/min	200	gal/min	lb/min	2	gal	lb	gal	lb
4"	100	4.0	gal/min	lb/min	300	gal/min	lb/min	2	gal	lb	gal	lb
5"	125	7.0	gal/min	lb/min	450	gal/min	lb/min	5	gal	lb	gal	lb
6"	150	12	gal/min	lb/min	600	gal/min	lb/min	5	gal	lb	gal	lb
8"	200	15	gal/min	lb/min	1200	gal/min	lb/min	10	gal	lb	gal	lb
10"	250	30	gal/min	lb/min	1500	gal/min	lb/min	15	gal	lb	gal	lb
12"	300	45	gal/min	lb/min	2400	gal/min	lb/min	25	gal	lb	gal	lb
14"	350	60	gal/min	lb/min	3600	gal/min	lb/min	30	gal	lb	gal	lb
16"	400	60	gal/min	lb/min	4800	gal/min	lb/min	50	gal	lb	gal	lb
18"	450	90	gal/min	lb/min	6000	gal/min	lb/min	50	gal	lb	gal	lb
20"	500	120	gal/min	lb/min	7500	gal/min	lb/min	75	gal	lb	gal	lb
24"	600	180	gal/min	lb/min	10500	gal/min	lb/min	100	gal	lb	gal	lb
28"	700	210	gal/min	lb/min	13500	gal/min	lb/min	125	gal	lb	gal	lb
30"	–	270	gal/min	lb/min	16500	gal/min	lb/min	150	gal	lb	gal	lb
32"	800	300	gal/min	lb/min	19500	gal/min	lb/min	200	gal	lb	gal	lb
36"	900	360	gal/min	lb/min	24000	gal/min	lb/min	225	gal	lb	gal	lb
40"	1000	480	gal/min	lb/min	30000	gal/min	lb/min	250	gal	lb	gal	lb
42"	–	600	gal/min	lb/min	33000	gal/min	lb/min	250	gal	lb	gal	lb
48"	1200	600	gal/min	lb/min	42000	gal/min	lb/min	400	gal	lb	gal	lb
54"	–	1.3	Mgal/d	ton/h	75	Mgal/d	ton/h	0.0005	Mgal	ton	Mgal	ton
–	1400	1.3	Mgal/d	ton/h	85	Mgal/d	ton/h	0.0005	Mgal	ton	Mgal	ton
60"	–	1.3	Mgal/d	ton/h	95	Mgal/d	ton/h	0.0005	Mgal	ton	Mgal	ton
–	1600	1.7	Mgal/d	ton/h	110	Mgal/d	ton/h	0.00075	Mgal	ton	Mgal	ton
66"	–	2.2	Mgal/d	ton/h	120	Mgal/d	ton/h	0.00075	Mgal	ton	Mgal	ton
72"	1800	2.6	Mgal/d	ton/h	140	Mgal/d	ton/h	0.00075	Mgal	ton	Mgal	ton
78"	–	3.0	Mgal/d	ton/h	175	Mgal/d	ton/h	0.001	Mgal	ton	Mgal	ton
–	2000	3.0	Mgal/d	ton/h	175	Mgal/d	ton/h	0.001	Mgal	ton	Mgal	ton

12.2.2 Language, density, length, temperature

	Unit
Language	English
Density	kg/l
Length	mm
Temperature	°C

13 Index function matrix

Blocks

A = MEASURED VARIABLES	11
B = QUICK SETUP	19
C = USER INTERFACE	27
D = TOTALIZER	43
E = OUTPUT	48
F = INPUT	88
G = BASIC FUNCTION	92
H = SPECIAL FUNCTION	107
J = SUPERVISION	132

Groups

AAA = MEASURING VALUES	12
ACA = SYSTEM UNITS	13
AEA = SPECIAL UNITS	17
CAA = CONTROL	28
CCA = MAIN LINE	31
CEA = ADDITIONAL LINE	35
CGA = INFORMATION LINE	39
DAA = TOTALIZER 1	44
DAB = TOTALIZER 2	44
DAC = TOTALIZER 3	44
DJA = HANDLING TOTALIZER	47
EAA = CURRENT OUTPUT 1	49
EAB = CURRENT OUTPUT 2	49
ECA = PULSE/FREQUENCY OUTPUT 1	59
ECB = PULSE/FREQUENCY OUTPUT 2	59
EGA = RELAY OUTPUT 1	78
EGB = RELAY OUTPUT 2	78
FAA = STATUS INPUT	89
GAA = HART	93
GIA = PROCESS PARAMETER	95
GLA = SYSTEM PARAMETER	102
GNA = SENSOR DATA	104
HCA = BATCHING FUNCTION	108
HEA = ADVANCED DIAGNOSTICS	125
JAA = SYSTEM	133
JCA = VERSION INFO	137

Function groups

040 = CONFIGURATION	13
042 = ADDITIONAL CONFIGURATION	16
060 = ARBITRARY UNIT	17
070 = DENSITY PARAMETER	18
200 = BASIC CONFIGURATION	28
202 = UNLOCKING/LOCKING	29
204 = OPERATION	30
220 = CONFIGURATION	31
222 = MULTIPLEX	33
240 = CONFIGURATION	35
242 = MULTIPLEX	37
260 = CONFIGURATION	39
262 = MULTIPLEX	41
300 = CONFIGURATION	44
304 = OPERATION	46
400 = CONFIGURATION	49

404 = OPERATION	57
408 = INFORMATION	58
420 = CONFIGURATION	59
430 = OPERATION	74
438 = INFORMATION	77
470 = CONFIGURATION	78
474 = OPERATION	82
478 = INFORMATION	84
500 = CONFIGURATION	89
504 = OPERATION	90
508 = INFORMATION	91
600 = CONFIGURATION	93
604 = INFORMATION	94
640 = CONFIGURATION	95
642 = EPD PARAMETER	97
644 = ECC PARAMETER	99
648 = ADJUSTMENT	101
660 = CONFIGURATION	102
680 = CONFIGURATION	104
682 = OPERATION	105
720 = CONFIGURATION	108
722 = VALVE PARAMETER	114
724 = SUPERVISION	119
726 = OPERATION	122
728 = INFORMATION	124
750 = ACQUISITION	126
751 = LAYER CONFIGURATION	127
752 = OPERATION CODE	128
754 = CONFIGURATION ELECTRODES	129
755 = OPERATION ELECTRODE POTENTIAL 1	130
765 = OPERATION ELECTRODE POTENTIAL 2	131
800 = CONFIGURATION	133
804 = OPERATION	135
820 = SENSOR	137
822 = AMPLIFIER	137
824 = F-CHIP	138
830 = I/O MODULE	138
832 = INPUT/OUTPUT 1	139
834 = INPUT/OUTPUT 2	139
836 = INPUT/OUTPUT 3	139
838 = INPUT/OUTPUT 4	139

Functions 0...

0000 = CALCULATED MASS FLOW	12
0001 = VOLUME FLOW	12
0005 = DENSITY	12
0400 = UNIT MASS FLOW	13
0401 = UNIT MASS	13
0402 = UNIT VOLUME FLOW	14
0403 = UNIT VOLUME	15
0420 = UNIT DENSITY	16
0424 = UNIT LENGTH	16
0602 = TEXT ARBITRARY VOLUME	17
0603 = FACTOR ARBITRARY VOLUME	17
0700 = DENSITY VALUE	18

1...

1002 = QUICK SETUP COMMISSION	19
1003 = QUICK SETUP PULSATING FLOW	19
1005 = QUICK SETUP BATCHING/DOSING	19
1009 = T DAT SAVE/LOAD	20

2...

2000 = LANGUAGE	28
2002 = DISPLAY DAMPING	28
2003 = CONTRAST LCD	28
2020 = ACCESS CODE	29
2021 = DEFINE PRIVATE CODE	29
2022 = STATUS ACCESS	29
2040 = TEST DISPLAY	30
2200 = ASSIGN	31
2201 = 100% VALUE	31
2202 = FORMAT	32
2220 = ASSIGN	33
2221 = 100% VALUE	33
2222 = FORMAT	34
2400 = ASSIGN	35
2401 = 100% VALUE	36
2402 = FORMAT	36
2403 = DISPLAY MODE	36
2420 = ASSIGN	37
2421 = 100% VALUE	38
2422 = FORMAT	38
2423 = DISPLAY MODE	38
2600 = ASSIGN	39
2601 = 100% VALUE	40
2602 = FORMAT	40
2603 = DISPLAY MODE	40
2620 = ASSIGN	41
2621 = 100% VALUE	42
2622 = FORMAT	42
2623 = DISPLAY MODE	42

3...

3000 = ASSIGN	44
3001 = UNIT TOTALIZER	44
3002 = TOTALIZER MODE	45
3003 = RESET TOTALIZER	45
3040 = SUM	46
3041 = OVERFLOW	46
3800 = RESET ALL TOTALIZERS	47
3801 = FAILSAFE ALL TOTALIZERS	47

4...

4000 = ASSIGN CURRENT OUTPUT	49
4001 = CURRENT SPAN	49
4002 = VALUE 0_4 mA	50, 51
4003 = VALUE 20 mA	52
4004 = MEASURING MODE	53, 54
4005 = TIME CONSTANT	55
4006 = FAILSAFE MODE	56
4040 = ACTUAL CURRENT	57
4041 = SIMULATION CURRENT	57
4042 = VALUE SIMULATION CURRENT	57
4080 = TERMINAL NUMBER	58

4200 = OPERATION MODE	59
4201 = ASSIGN FREQUENCY	59
4202 = START VALUE FREQUENCY	60
4203 = END VALUE FREQUENCY	60
4204 = VALUE F LOW	61
4205 = VALUE-F HIGH	61
4206 = MEASURING MODE	63
4207 = OUTPUT SIGNAL	64
4208 = TIME CONSTANT	65
4209 = FAILSAFE MODE	65
4211 = FAILSAFE VALUE	65
4221 = ASSIGN PULSE	66
4222 = PULSE VALUE	66
4223 = PULSE WIDTH	67
4225 = MEASURING MODE	68
4226 = OUTPUT SIGNAL	69
4227 = FAILSAFE MODE	70
4241 = ASSIGN STATUS	71
4242 = ON VALUE	71
4243 = SWITCH-ON DELAY	72
4244 = OFF-VALUE	72
4245 = SWITCH-OFF DELAY	72
4246 = MEASURING MODE	73
4247 = TIME CONSTANT	73
4301 = ACTUAL FREQUENCY	74
4302 = SIMULATION FREQUENCY	74
4303 = VALUE SIMULATION FREQUENCY	75
4341 = ACTUAL STATUS	76
4342 = SIMULATION SWITCH POINT	76
4343 = VALUE SIMULATION SWITCH POINT	76
4380 = TERMINAL NUMBER	77
4700 = ASSIGN RELAY	78
4701 = ON-VALUE	79
4702 = SWITCH-ON DELAY	79
4703 = OFF-VALUE	79
4704 = SWITCH-OFF DELAY	80
4705 = MEASURING MODE	80
4706 = TIME CONSTANT	81
4740 = ACTUAL STATUS RELAY	82
4741 = SIMULATION SWITCH POINT	82
4742 = VALUE SIMULATION SWITCH POINT	83
4780 = TERMINAL NUMBER	84

5...

5000 = ASSIGN STATUS INPUT	89
5001 = ACTIVE LEVEL	89
5002 = MINIMUM PULSE WIDTH	89
5040 = ACTUAL STATUS INPUT	90
5041 = SIMULATION STATUS INPUT	90
5042 = VALUE SIMULATION STATUS INPUT	90
5080 = TERMINAL NUMBER	91

6...

6000 = TAG NAME	93
6001 = TAG DESCRIPTION	93
6002 = BUS ADDRESS	93
6003 = HART PROTOCOL	93
6004 = WRITE PROTECTION	93

6... (continued)

6040 = MANUFACTURER ID	94
6041 = DEVICE ID	94
6400 = ASSIGN LOW FLOW CUT OFF	95
6402 = ON-VALUE LOW FLOW CUT OFF	95
6403 = OFF-VALUE LOW FLOW CUT OFF	95
6404 = PRESSURE SHOCK SUPPRESSION	96
6420 = EPD/OED MODE	97
6425 = EPD/OED RESPONSE TIME	98
6440 = ECC	99
6441 = ECC DURATION	99
6442 = ECC RECOVERY TIME	100
6443 = ECC CLEANING CYCLE	100
6481 = EPD/OED ADJUSTMENT	101
6600 = INSTALLATION DIRECTION SENSOR	102
6603 = FLOW DAMPING	102
6604 = INTEGRATION TIME	102
6605 = POSITIVE ZERO RETURN	103
6801 = K-FACTOR POSITIVE	104
6802 = K-FACTOR NEGATIVE	104
6803 = ZERO POINT	104
6804 = NOMINAL DIAMETER	104
6820 = MEASURING PERIOD	105
6821 = OVERVOLTAGE TIME	105
6822 = EPD ELECTRODE	105
6823 = POLARITY ECC	106

7...

7200 = BATCH SELECTOR	108
7201 = BATCH NAME	108
7202 = ASSIGN BATCH VARIABLE	109
7203 = BATCH QUANTITY	109
7204 = FIX COMPENSATION QUANTITY	109
7205 = COMPENSATION MODE	110
7206 = CALCULATION MODE	112
7207 = AVERAGING DRIP	112
7208 = BATCH STAGES	113
7209 = INPUT FORMAT	113
7220 = OPEN VALVE 1	114
7221 = CLOSE VALVE 1	114
7222 = OPEN VALVE 2	115
7223 = CLOSE VALVE 2	115
7240 = MAXIMUM BATCHING TIME	119
7241 = MINIMUM BATCHING QUANTITY	120
7242 = MAXIMUM BATCHING QUANTITY	121
7243 = PROGRESS NOTE	121
7260 = BATCH PROCEDURE	122
7261 = BATCH UPWARDS	122
7262 = BATCH DOWNWARDS	123
7263 = BATCHING QUANTITY COUNTER	123
7264 = BATCH SUM	123
7265 = RESET TOTAL SUM/COUNTER	123
7280 = INTERNAL SWITCH POINT VALVE 1	124
7281 = DRIP QUANTITY	124
7282 = CLOSING TIME VALVE 1	124
7504 = RESET HISTORY	126
7510 = PULSE DURATION	127
7511 = PULSE INTERVAL	127

7512 = DETECTION VALUE	127
7513 = MAXIMUM RELAXATION TIME	127
7520 = REFERENCE VALUE	128
7521 = ACTUAL VALUE	128
7522 = MINIMAL VALUE	128
7523 = MAXIMAL VALUE	128
7524 = HISTORY	128
7525 = ACTUAL DEVIATION	128
7540 = INTERVAL POTENTIAL HISTORY	129
7550 = REFERENCE VALUE	130
7551 = ACTUAL VALUE	130
7552 = MINIMAL VALUE	130
7553 = MAXIMAL VALUE	130
7554 = HISTORY	130
7555 = ACTUAL DEVIATION	130
7560 = REFERENCE VALUE	131
7561 = ACTUAL VALUE	131
7562 = MINIMAL VALUE	131
7563 = MAXIMAL VALUE	131
7564 = HISTORY	131
7565 = ACTUAL DEVIATION	131

8...

8000 = ASSIGN SYSTEM ERROR	133
8001 = ERROR CATEGORY	133
8002 = ASSIGN PROCESS ERROR	133
8003 = ERROR CATEGORY	133
8004 = ACKNOWLEDGE FAULTS	134
8005 = ALARM DELAY	134
8040 = ACTUAL SYSTEM CONDITION	135
8041 = PREVIOUS SYSTEM CONDITIONS	135
8042 = SIMULATION FAILSAFE MODE	135
8043 = SIMULATION MEASURAND	135
8044 = VALUE SIMULATION MEASURAND	135
8046 = SYSTEM RESET	136
8047 = TROUBLESHOOTING	136
8200 = SERIAL NUMBER	137
8201 = SENSOR TYPE	137
8202 = HARDWARE REV. NO. SENSOR	137
8205 = SOFTWARE REV. NO. S-DAT	137
8220 = HARDWARE REV. NO. AMPLIFIER	137
8222 = SOFTWARE REV. NO. AMPLIFIER	137
8225 = SOFTWARE REV. NO. T-DAT	137
8240 = STATUS F-CHIP	138
8242 = HARDWARE REV. NO. F-CHIP	138
8244 = SOFTWARE REV. NO. F-CHIP	138
8300 = I/O MODULE TYPE	138
8301 = HARDWARE REV. NO. I/O MODULE	138
8303 = SOFTWARE REV. NO. I/O MODULE	138
8320 = TYPE INPUT/OUTPUT 1	139
8322 = HARDWARE ID. NO. INPUT / OUTPUT 1	139
8340 = TYPE INPUT/OUTPUT 2	139
8342 = HARDWARE ID. NO. INPUT / OUTPUT 2	139
8360 = TYPE INPUT/OUTPUT 3	139
8362 = HARDWARE ID. NO. INPUT / OUTPUT 3	139
8380 = TYPE INPUT/OUTPUT 4	139
8382 = HARDWARE ID. NO. INPUT / OUTPUT 4	139

14 Index key words

A

Access Code	29
Acknowledge faults	134
Active level	89
Actual	
Current (current output)	57
Frequency	74
Actual deviation	
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131
Actual status	
Relay output	82
Status input	90
Status (pulse/frequency output)	76
Actual system condition	135
Actual value	
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131
Additional configuration (system units)	16
Additional line	
Configuration	35
Multiplex	37
Adjustment	
EPD/EED	101
Alarm delay	134
Amplifier (version info)	137
Arbitrary unit	17
Assign	
Additional line	35
Additional line (Multiplex)	37
Batch variable	109
Current output	49
Frequency (Pulse/freq. output)	59
Information line	39
Information line (Multiplex)	41
Low flow cut off	95
Main line	31
Main line (Multiplex)	33
Process error	133
Pulse output	66
Relay (relay output)	78
Status input	89
Status (pulse/frequency output)	71
System error	133
Totalizer	44
Averaging drip	112

B

Basic configuration (user interface)	28
Basic function	92

Batch	
Counter	123
Downwards	123
Name	108
Procedure	122
Quantity	109
Selector	108
Stages	113
Sum	123
Upwards	122
Batching function	108
Block	
Basic function	92
Inputs	88
Measured variables	11
Outputs	48
Quick Setup	19
Special function	107
Supervision	132
Totalizer	43
User interface	27
Bus address	93

C

Calculated mass flow	12
Calculation mode	112
Close	
Valve 1	114
Valve 2	115
Closing time Valve 1	124
Commission	19
Compensation	
Mode	110
Quantity (fixed)	109
Configuration	
Additional line	35
Batching function	108
Coating	127
Current output	49
Electrodes	129
HART	93
Information line	39
Main line	31
Process parameter	95
Pulse/Frequency output	59
Relay output	78
Sensor data	104
Status input	89
System	133
System parameter	102
System units	13
Totalizer	44
Contrast LCD	28

C (continued)

Control	
Basic configuration	28
Operation	30
Unlocking/locking	29
Current output	
Configuration	49
Information	58
Operation	57
Current span	49

D

Define private code	29
Density	12
Parameter	18
Value	18
Detection value	127
Device ID	94
Diagram	
Batching Setup menu	25
Pulsating flow Setup menu	23
Setup Commissioning	21
Display	
Damping	28
Test	30
Display mode	
Additional line	36
Additional line (Multiplex)	38
Information line	40
Information line (Multiplex)	42
Drip quantity	124

E

ECC	
Cleaning cycle	100
Duration	99
Parameter	99
Polarity	106
Recovery time	100
Electrode cleaning (ECC)	99
Empty pipe detection (EPD)	97
End value frequency	60
EPD (empty pipe detection)	
Electrode	105
Parameter	97
EPD/OED	
Adjustment	101
Mode	97
Response time	98
Error category	
Process error	133
System error	133

F

Factor arbitrary volume	17
Factory settings	141
Failsafe mode	
All totalizers	47
Current output	56
Frequency output	65
Pulse output	70
Failsafe value	65
F-CHIP (version info)	138
Fix compensation quantity	109
Flow damping	102
Format	
Additional line	36
Additional line (Multiplex)	38
Information line	40
Information line (Multiplex)	42
Main line	32
Main line (Multiplex)	34
Function group	
Acquisition	126
Additional configuration (system units)	16
Adjustment	101
Amplifier	137
Arbitrary unit (special units)	17
Basic configuration (user interface)	28
Configuration	
Additional line	35
Batching function	108
Current output	49
HART	93
Information line	39
Main line	31
Process parameter	95
Pulse/Frequency output	59
Relay output	78
Sensor data	104
Status input	89
System	133
System parameter	102
System units	13
Totalizer	44
Configuration coating	127
Configuration electrodes	129
Density parameter	18
ECC parameter	99
EPD parameter	97
F-CHIP	138
Information	
Batching function	124
Current output	58
HART	94
Pulse/frequency output	77
Relay output	84
Status input	91
Input/output (1...4)	139

F (Function group continued)

I/O Module	138
Multiplex	
Additional line	37
Information line	41
Main line	33
Operation	
Batching function	122
Current output	57
Pulse/Frequency output	74
Relay output	82
Sensor data	105
Status input	90
System	135
Totalizer	46
User interface	30
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131
Sensor	137
Supervision	119
Unlocking/locking (user interface)	29
Valve parameter	114
Function matrix	
General layout	8
Identification code	9
Overview	10

G

Group	
Additional line	35
Advanced diagnostics	125
Batching function	108
Control (User interface)	28
Current output	49
Handling Totalizer	47
HART	93
Information line	39
Main line	31
Measuring values	12
Process parameter	95
Pulse/Frequency output	59
Relay output	78
Sensor data	104
Special units	17
Status input	89
System	133
System parameter	102
System units	13
Totalizer	44
Version info	137

H

Handling Totalizer	47
Hardware ID number	
Input/output 1...4	139
Hardware revision number	
Amplifier	137
F-CHIP	138
I/O Module	138
Sensor	137
HART	
Configuration	93
Information	94
History	
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131

I

Information	
Batching function	124
Current output	58
Pulse/frequency output	77
Relay output	84
Status input	91
Information line	
Configuration	39
Multiplex	41
Input format	113
Inputs	88
Input/output 1...4 (version info)	139
Installation direction sensor	102
Integration time	102
Internal switch point Valve 1	124
Interval potential history	129
I/O Module	138

K

K-Factor	
Negative	104
Positive	104

L

Language	28
Low flow cut off	95

M

Main line	
Configuration	31
Multiplex	33
Manufacturer number	94
Mass flow (calculated)	12
Maximal value	
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131
Maximum	
Batching quantity	121
Batching time	119
Relaxation time	127
Measured variables (block A)	11
Measuring mode	
Current output	53,54
Frequency (pulse/frequency output)	63,64
Pulse output	68
Relay output	80
Status (pulse/frequency output)	73
Measuring period	105
Measuring values	12
Minimal value	
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131
Minimum	
Batching quantity	120
Pulse width	89
Multiplex	
Additional line	37
Information line	41
Main line	33

N

Nominal diameter	104
------------------	-----

O

OED (open electrode detection)	97
Off value	
Low flow cut off	95
Relay output	79
Status (pulse/frequency output)	72
On value	
Low flow cut off	95
Relay output	79
Status (pulse/frequency output)	71
Open	
Valve 1	114
Valve 2	115
Open electrode detection (OED)	97

Operation	
Batching function	122
Coating	128
Current output	57
Electrode potential 1	130
Electrode potential 2	131
Pulse/frequency output	74
Relay output	82
Sensor data	105
Status input	90
System	135
Totalizer	46
User interface	30
Operation mode (Pulse/frequency output)	59
Output signal	
Frequency output	64
Pulse output	69
Outputs	48
Overflow	46
Overvoltage time	105

P

Polarity ECC	106
Positive zero return	103
Pressure shock suppression	96
Previous system conditions	135
Process parameter	
Adjustment	101
Configuration	95
ECC parameter	99
EPD parameter	97
Progress note	121
Pulsating flow	19
Pulse	
Duration (advanced diagnosis)	127
Interval (advanced diagnosis)	127
Value	66
Width	67
Pulse/frequency output	
Configuration	59
Information	77
Operation	74

Q

Quick Setup	
Batching/Dosing	19
Commission	19
Pulsating flow	19

R

Reference value	
Operation coating	128
Operation electrode potential 1	130
Operation electrode potential 2	131
Relay output	
Configuration	78
Flow direction	85
General	85
Information	84
Limit value	85
Operation	82
Switching response	86
Reset	
All totalizers	47
History	126
Total sum/counter	123
Totalizer	45

S

Sensor data	
Configuration	104
Operation	105
Sensor type	137
Sensor (version info)	137
Serial number sensor	137
Simulation	
Current (current output)	57
Failsafe mode	135
Frequency	74
Measurand	135
Relay output switch point	82
Status input	90
Status (pulse/frequency output)	76
Software revision number	
Amplifier	137
F-CHIP	138
I/O Module	138
S-DAT	137
T-DAT	137
Special units	
Arbitrary unit	17
Density parameter	18
Start value frequency	60
Status	
Access	29
F-CHIP	138
Status input	
Configuration	89
Information	91
Operation	90
Sum (Totalizer)	46
Supervision	
Batching function	119
Block Supervision	132

Switching response of the relay output	86
Switch-off delay	
Relay output	80
Status (pulse/frequency output)	72
Switch-on delay	
Relay output	79
Status (pulse/frequency output)	72
System	
Configuration	133
Operation	135
Parameter	102
Reset	136
System condition	
Actual	135
Previous	135
System units	
Additional configuration	16
Configuration	13

T

Tag	
Description	93
Name	93
T-DAT Save/Load	20
Terminal number	
Current output	58
Pulse/frequency output	77
Relay output	84
Status input	91
Text arbitrary volume	17
Time constant	
Current output	55
Frequency output	65
Relay output	81
Status (pulse/frequency output)	73
Totalizer	43
Configuration	44
Mode	45
Operation	46
Reset	45
Troubleshooting	136
Type	
Input/output 1...4	139
I/O Module	138

U

Unit

Density	16
Length	16
Mass	13
Mass flow	13
Totalizer	44
Volume	15
Volume flow	14
Unlocking/locking (user interface)	29
User interface	27

V

Value

F High	61
F Low	61
0_4 mA	50
20 mA	52

Value Simulation

Frequency	75
Relay output switch point	83
Switch point status (pulse/frequency output)	76

Value simulation

Current (current output)	57
Measurand	135
Status input	90

Valve parameter

Batching function	114
-------------------	-----

Version info

Amplifier	137
F-CHIP	138
Input/output 1...4	139
I/O Module	138
Sensor	137

Volume flow

	12
--	----

W

Write protection	93
------------------	----

Z

Zero point	104
------------	-----

Numbers

100% value flow

Additional line	36
Additional line (Multiplex)	38
Information line	40
Information line (Multiplex)	42
Main line	31
Main line (Multiplex)	33

Europe	
Austria	□ Endress+Hauser Ges.m.b.H. Wien Tel. (01) 88056-0, Fax (01) 88056-35
Belarus	□ Belorgsintez Minsk Tel. (0172) 263166, Fax (0172) 263111
Belgium / Luxembourg	□ Endress+Hauser N.V. Brussels Tel. (02) 2480600, Fax (02) 2480553
Bulgaria	INTERTECH-AUTOMATION Sofia Tel. (02) 664869, Fax (02) 9631389
Croatia	□ Endress+Hauser GmbH+Co. Zagreb Tel. (01) 6637785, Fax (01) 6637823
Cyprus	□ I+G Electrical Services Co. Ltd. Nicosia Tel. (02) 484788, Fax (02) 484690
Czech Republic	□ Endress+Hauser GmbH+Co. Praha Tel. (026) 6784200, Fax (026) 6784179
Denmark	□ Endress+Hauser A/S Søborg Tel. (70) 131132, Fax (70) 132133
Estonia	ELVI-Aqua Tartu Tel. (7) 441638, Fax (7) 441582
Finland	□ Endress+Hauser Oy Espoo Tel. (09) 8676740, Fax (09) 86767440
France	□ Endress+Hauser S.A. Huningue Tel. (389) 696768, Fax (389) 694802
Germany	□ Endress+HauserMesstechnik GmbH+Co. Weil am Rhein Tel. (07621) 975-01, Fax (07621) 975-555
Great Britain	□ Endress+Hauser Ltd. Manchester Tel. (0161) 2865000, Fax (0161) 9981841
Greece	I & G Building Services Automation S.A. Athens Tel. (01) 9241500, Fax (01) 9221714
Hungary	Mile Ipari-Elektro Budapest Tel. (01) 2615535, Fax (01) 2615535
Iceland	BIL ehf Reykjavik Tel. (05) 619616, Fax (05) 619617
Ireland	Flomeaco Company Ltd. Kildare Tel. (045) 868615, Fax (045) 868182
Italy	□ Endress+Hauser S.p.A. Cernusco s/N Milano Tel. (02) 92921921, Fax (02) 92107153
Latvia	Rino TK Riga Tel. (07) 312897, Fax (07) 312894
Lithuania	UAB "Agava" Kaunas Tel. (07) 202410, Fax (07) 207414

Netherland	□ Endress+Hauser B.V. Naarden Tel. (035) 6958611, Fax (035) 6958825
Norway	□ Endress+Hauser A/S Tranby Tel. (032) 859850, Fax (032) 859851
Poland	□ Endress+Hauser Polska Sp. z o.o. Warszaw Tel. (022) 7201090, Fax (022) 7201085
Portugal	Tecnisis - Tecnica de Sistemas Industriais Linda-a-Velha Tel. (21) 4165920, Fax (21) 4185278
Romania	Romconseng S.R.L. Bucharest Tel. (01) 4101634, Fax (01) 4101634
Russia	□ Endress+Hauser Moscow Office Moscow Tel. (095) 1587564, Fax (095) 1589871
Slovakia	Transcom Technik s.r.o. Bratislava Tel. (7) 44888684, Fax (7) 44887112
Slovenia	□ Endress+Hauser D.O.O. Ljubljana Tel. (061) 1592217, Fax (061) 1592298
Spain	□ Endress+Hauser S.A. Sant Just Desvern Tel. (93) 4803366, Fax (93) 4733839
Sweden	□ Endress+Hauser AB Sollentuna Tel. (08) 55511600, Fax (08) 55511655
Switzerland	□ Endress+Hauser AG Reinach/BL 1 Tel. (061) 7157575, Fax (061) 7111650
Turkey	Intek Endüstriyel Ölçü ve Kontrol Sistemlerlis-tanbul Tel. (0212) 2751355, Fax (0212) 2662775
Ukraine	Photonika GmbH Kiev Tel. (44) 26881, Fax (44) 26908
Yugoslavia Rep.	Meris d.o.o. Beograd Tel.(11) 4441966, Fax (11) 4441966

Africa

Egypt	Anasia Heliopolis/Cairo Tel. (02) 4179007, Fax (02) 4179008
Morocco	Oussama S.A. Casablanca Tel. (02) 241338, Fax (02) 402657
South Africa	□ Endress+Hauser Pty. Ltd. Sandton Tel. (011) 4441386, Fax (011) 4441977
Tunisia	Contrôle, Maintenance et Regulation Tunis Tel. (01) 793077, Fax (01) 788595

America

Argentina	□ Endress+Hauser Argentina S.A. Buenos Aires Tel. (01) 145227970, Fax (01) 145227909
------------------	--

Bolivia	Tritec S.R.L. Cochabamba Tel. (042) 56993, Fax (042) 50981
Brazil	□ Samson Endress+Hauser Ltda. Sao Paulo Tel. (011) 50313455, Fax (011) 50313067
Canada	□ Endress+Hauser Ltd. Burlington, Ontario Tel. (905) 6819292, Fax (905) 6819444
Chile	□ Endress+Hauser Chile Ltd. Santiago Tel. (02) 2088608, Fax (02) 2088608
Colombia	Colsein Ltda. Bogota D.C. Tel. (01) 2367659, Fax (01) 6104186
Costa Rica	EURO-TEC S.A. San Jose Tel. (02) 961542, Fax (02) 961542
Ecuador	Insetec Cia. Ltda. Quito Tel. (02) 269148, Fax (02) 461833
Guatemala	ACISAAutomatizacionYControlIndustrial S.A. Ciudad de Guatemala, C.A. Tel. (03) 345985, Fax (03) 327431
Mexico	□ Endress+Hauser S.A. de C.V. Mexico City Tel. (5) 5682405, Fax (5) 5687459
Paraguay	Incoel S.R.L Asuncion Tel. (021) 213989, Fax (021) 226583
Uruguay	Circular S.A. Montevideo Tel. (02) 925785, Fax (02) 929151
USA	□ Endress+Hauser Inc. Greenwood, Indiana Tel. (317) 535-7138, Fax (317) 535-8498
Venezuela	Controlval C.A. Caracas Tel. (02) 9440966, Fax (02) 9444554

Asia

China	□ Endress+Hauser Shanghai Instrumentation Co. Ltd. Shanghai Tel. (021) 54902300, Fax (021) 54902303
	□ Endress+Hauser Beijing Office Beijing Tel. (010) 68344058, Fax: (010) 68344068
Hong Kong	□ Endress+Hauser HK Ltd. Hong Kong Tel. 25283120, Fax 28654171
India	□ Endress+Hauser India Branch Office Mumbai Tel. (022) 8521458, Fax (022) 8521927
Indonesia	PT Grama Bazita Jakarta Tel. (21) 7975083, Fax (21) 7975089
Japan	□ Sakura Endress Co. Ltd. Tokyo Tel. (0422) 540613, Fax (0422) 550275
Malaysia	□ Endress+Hauser (M) Sdn. Bhd. Petaling Jaya, Selangor Darul Ehsan Tel. (03) 7334848, Fax (03) 7338800

Pakistan	Speedy Automation Karachi Tel. (021) 7722953, Fax (021) 7736884
Papua-Neuguinea	SBS Electrical Pty Limited Port Moresby Tel. 3251188, Fax 3259556
Philippines	□ Endress+Hauser Philippines Inc. Metro Manila Tel. (2) 3723601-05, Fax (2) 4121944
Singapore	□ Endress+Hauser (S.E.A.) Pte., Ltd. Singapore Tel. 5668222, Fax 5666848
South Korea	□ Endress+Hauser (Korea) Co., Ltd. Seoul Tel. (02) 6587200, Fax (02) 6592838
Taiwan	Kingjarl Corporation Taipei R.O.C. Tel. (02) 27183938, Fax (02) 27134190
Thailand	□ Endress+Hauser Ltd. Bangkok Tel. (02) 9967811-20, Fax (2) 9967810
Vietnam	Tan Viet Bao Co. Ltd. Ho Chi Minh City Tel. (08) 8335225, Fax (08) 8335227
Iran	PATSA Co. Tehran Tel. (021) 8754748, Fax(021) 8747761
Israel	Instrumetrics Industrial Control Ltd. Tel-Aviv Tel. (03) 6480205, Fax (03) 6471992
Jordan	A.P. Parpas Engineering S.A. Amman Tel. (06) 4643246, Fax (06) 4645707
Kingdom of Saudi Arabia	Anasia Ind. Agencies Jeddah Tel. (02) 6710014, Fax (02) 6725929
Lebanon	Network Engineering Jbeil Tel. (3) 944080, Fax (9) 548038
Sultanate of Oman	Mustafa & Jawad Sience & Industry Co.L.L.C. Ruwi Tel. 602009, Fax 607066
United Arab Emirates	Descon Trading EST. Dubai Tel. (04) 2653651, Fax (04) 2653264
Yemen	Yemen Company for Ghee and Soap Industry Taiz Tel. (04) 230664, Fax (04) 212338

Australia + New Zealand

Australia	ALSTOM Australia Limited Milperra Tel. (02) 97747444, Fax (02) 97744667
New Zealand	EMC Industrial Group Limited Auckland Tel. (09) 4155110, Fax (09) 4155115

All other countries

□ Endress+Hauser GmbH+Co. Instruments International D-Weil am Rhein Germany Tel. (07621) 975-02, Fax (07621) 975345

For more Endress+Hauser product please visit: www.ainstru.com
http://www.endress.com
Mail: Sales@ainstru.com

