

Retractable Assembly *CleanFit CUA 451*

**Manually operated stainless steel assembly
with ball valve
for the turbidity sensors CUS 31, CUS 41 and CUS 65**



Application

- Primary sludge and return activated sludge in sewage treatment plants
- Sludge centrifuge monitoring
- Filter monitoring and filter backwash
- Monitoring of phase break processes
- Cooling water monitoring

Your benefits

- Safety:
 - Safe and reliable process termination possible under nearly all conditions
 - Process pressure up 10 bar (145 psi), manually operated up to 2 bar (29 psi)
- Comfortable operation:
 - Cleaning possible in every operation mode due to rinse water connection and external cleaning system
 - Rinse water connection can be used as sealing water inlet
 - Sensor monitoring and cleaning without process interrupt

Function and system design

Function

The assembly is manually operated.



Caution!

The air relief valve and the rinse connections (if used) are in open contact with the medium in the measuring position, or at least when moving, and are thus exposed to the process pressure. Make sure that, the air relief valve and the rinse connections (if used) are closed when moving the assembly .

General sequence when moving the retractable assembly


- from position "Service" to position "Measure"
 - Open the ball valve: hand lever (see fig. below, pos. 1) vertical to the process connection
 - Move the sensor into the process: press down the handle (pos. 6) of the sensor holder (pos.3)
 - Close the bayonet joint (pos. 5)
 - Fasten the fastening screws (pos. 4)
- from position "Measure" to position "Service"
 - Loosen the fastening screws
 - Open the bayonet joint
 - Move the sensor off the process: pull up the sensor holder by means of the handle
 - Close the ball valve: hand lever 90° to the process connection.

In the "Service" status (sensor moved back into the assembly and **ball valve closed**), the ball valve seals the assembly off from the process. This means that cleaning and calibration can take place and electrodes can be changed without interrupting the process.



Caution!

Manually moving the assembly under process conditions is only possible at a process pressure up to 2 bar (29 psi).

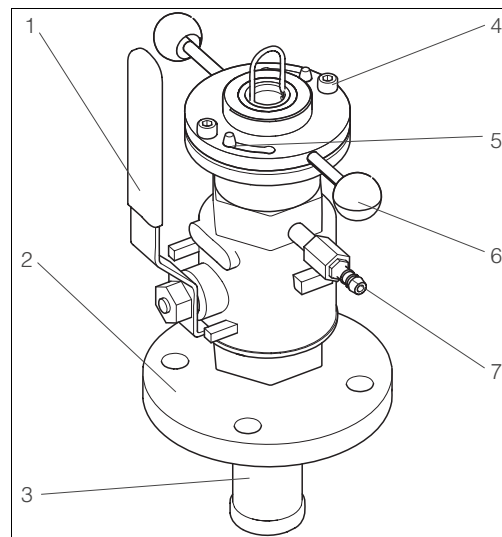


- 1 Hand lever for ball valve open/close
- 2 Process connection (Flange DN 50 / PN 16)
- 3 Sensor holder
- 4 Fastening screws
- 5 Bayonet joint
- 6 Handle
- 7 Air relief valve resp. rinse water connection

Assembly in measuring mode

Measuring system

A complete measuring system comprises:


- CleanFit CUA 451 assembly
- TurbiMax W CUS 41/CUS 31 or TurbiMax W CUS 65 (with CUM 740 only) turbidity sensor
- Liquisys M CUM 223/253 or CUM 740 (with CUS 65 only) transmitter

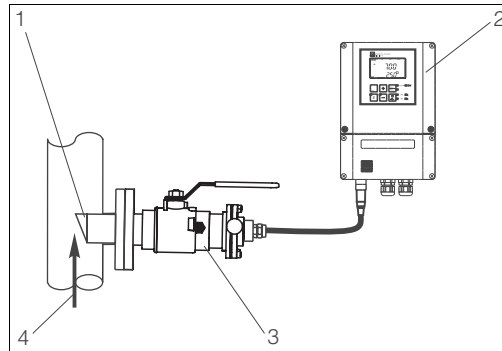

C07-CUA451xx-14-05-00-xx-001.eps

Measuring system with CUS 31 resp. CUS 41

- 1 CUS 31 or CUS 41
- 2 Liquisys M CUM 253
- 3 CUA 451
- 4 Medium flow direction

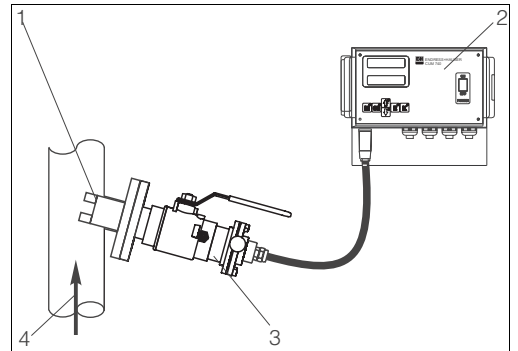

C07-CUA451xx-14-05-00-xx-002.eps


Measuring system with CUS 65

- 1 CUS 65
- 2 CUM 740
- 3 CUA 451
- 4 Medium flow direction

Installation

Installation conditions

Install the assembly at places with constant flow. The minimum pipe diameter is DN 80.

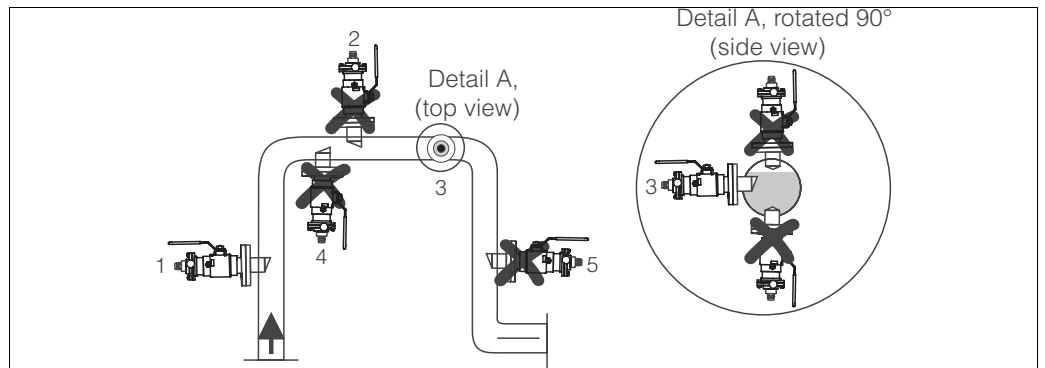

C07-CUA451xx-11-07-00-de-001.eps

Permissible and impermissible sensor installation positions


- 1 Ascending pipe, best position
- 2 Horizontal pipe, sensor top down, impermissible due to air cushion or foam bubble forming
- 3 Horizontal pipe, installation with permissible emitting angles (acc. to sensor version)
- 4 Overhead installation, impermissible due to suspended particle settling on the sensor optics
- 5 Down pipe, impermissible



Note!

- Do not install the assembly at places, where air cushions or foam bubbles can be formed or where suspended particles can settle on the sensor optics (→ Fig.).
- Measuring errors can occur, if:
 - the sensor is not immersed into the medium
 - suspended particles are settled on the sensor optics.

Orientation

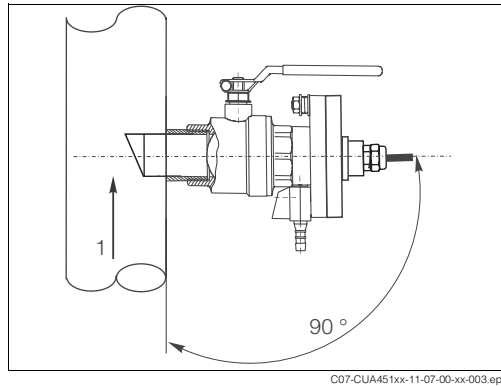


Orientation with CUS 41

1 Medium flow direction

Orientation acc. to sensor version:

- | | |
|-----------------------------|----------------------|
| - CUS 31, CUS 41, CUS 65-B: | $\alpha = 90^\circ$ |
| - CUS 65-A: | $\alpha = 80^\circ$ |
| - CUS 65-C, E: | $\alpha = 100^\circ$ |
| - CUS 65-D: | $\alpha = 110^\circ$ |

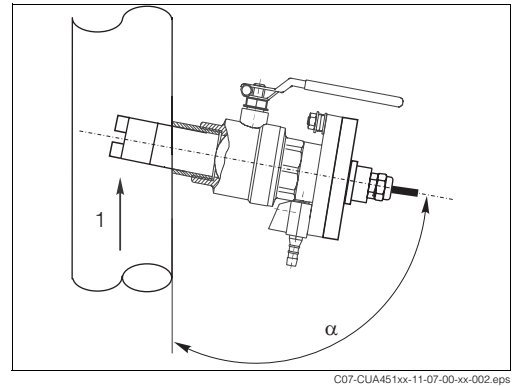

Orientation with CUS 65

α depending on sensor version, see below
1 Medium flow direction

Environment

Ambient temperature 0 ... 50 °C (32 ... 122 °F)

Process

Medium pressure



max. 10 bar (145 psi)

Caution!

- The maximum process pressure is 2 bar (29 psi) for manual assembly operation!
- Please consider the sensor process conditions!

Medium temperature




max. 80 °C (176 °F)

Caution!

Please consider the maximum sensor process temperature!

Pressure-temperature diagram

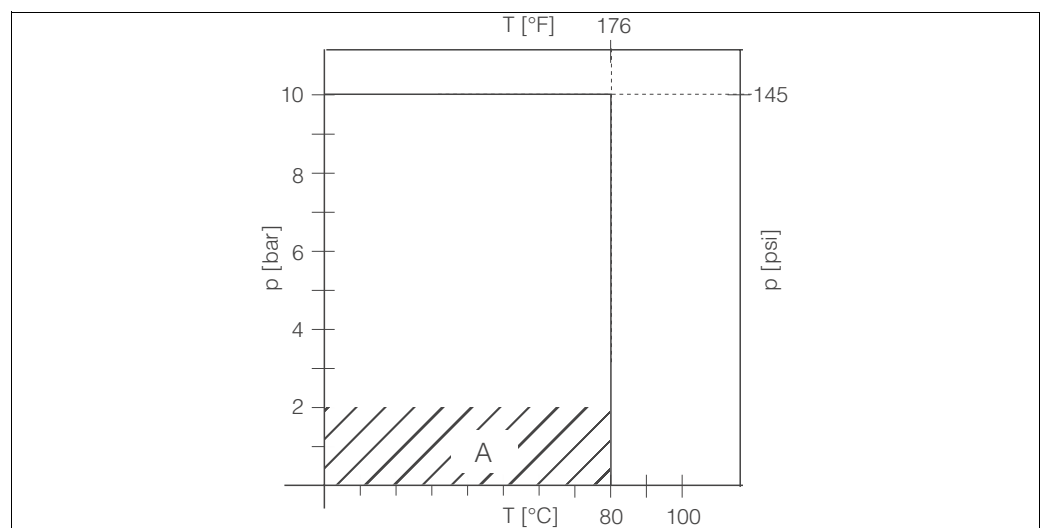


Pressure-temperature diagram

A Manual operation range


Mechanical construction

Design, dimensions

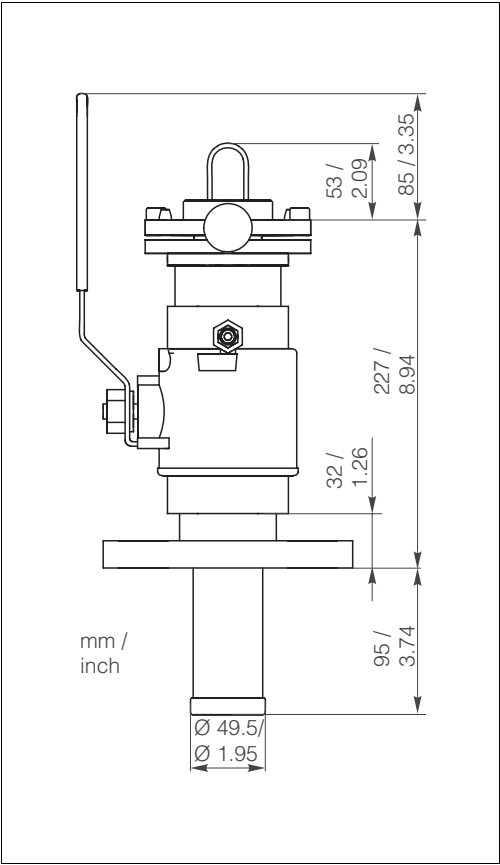

C07-CUA451xx-06-07-00-en-002.eps

Assembly in operating position

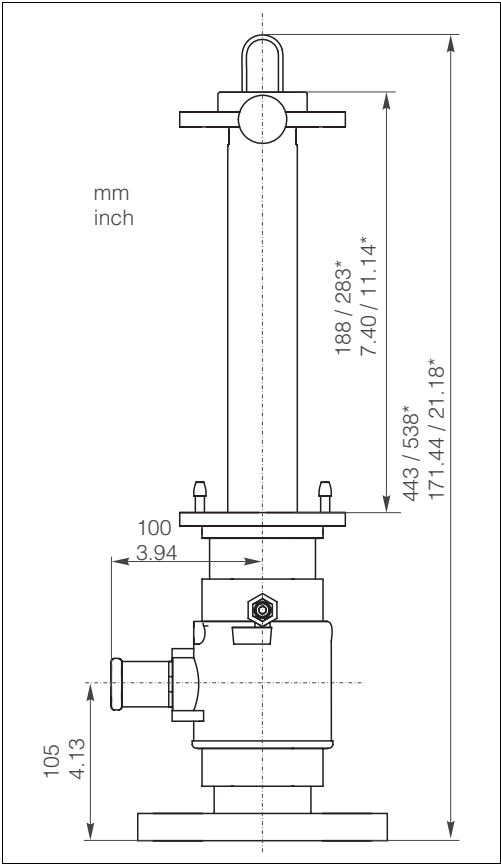

C07-CUA451xx-06-07-00-en-001.eps

Assembly in service position

* Assembly version CUA 451-BXX
(see product structure)


Weight

8 - 11 kg (17.6 ... 24.3 lb) depending on the assembly version

Materials

In contact with medium:	Viton (seals) stainless steel 1.4404 (AISI 316L) nickel brass (air relief valve resp. rinse connection)
Not in contact with medium:	stainless steel 1.4404 (AISI 316L)

Process connections

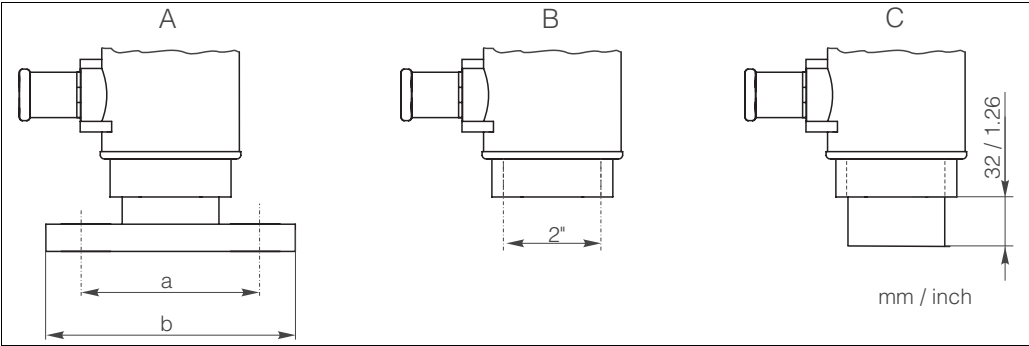

C07-CUA451xx-04-07-00-en-001.eps

Process connections

A Flange DN 50 / PN 16 and Flange ANSI 2" / 150 lbs
a: DN 50: Ø 125 (4.92"), ANSI 2": Ø 120.7 (4.75")
b: DN 50: Ø 165 (6.50"), ANSI 2": Ø 152.4 (6.00")
B Internal thread G2
C Internal thread G2 with welded fitting

Rinse connection fitting	2 x G1/8 (internal)
	Connection options:
	– 2 x ball valve with hose connection OD 9 mm (0.35"), see accessories (One ball valve is in the scope of delivery. When used alone, it is an air relief valve.)
	– customer specific solution, rinse connections with G1/8 external thread

Air relief valve	Hose connection OD 9 mm (0.35")
-------------------------	---------------------------------

Ordering information

Product structure

Sensor lift / Immersion depth			
	A	Short lift, Immersion depth approx. 170 mm / 6.69" (process connections A and B only)	
	B	Long lift, Immersion depth approx. 270 mm / 10.63"	
Sensor type / Connection			
	1	For CUS 31/41 with G1, Sensor length approx. 200 - 220 mm / 7.87 - 8.66"	
	2	For CUS 65 with G1, Sensor length approx. 140 - 160 mm / 5.51 - 6.30"	
Process connection			
	A	G2 internal thread	
	B	G2 internal thread with welded fitting h = 50 mm / 1.97"	
	C	Flange DN 50 / PN 16 acc. to EN 1092/1	
	D	Flange ANSI 2" / 150 lbs	
CUA 451-			complete order code


Accessories

Assembly

- ☐ Ball valve for rinse connection; order no. 51512982
- ☐ O-ring set, Viton; order no. 51512981

Process connection adapter

- ☐ Welded fitting for pipe diameters of more than 80 mm (3.15"), with combination flange DN 50 / ANSI 2":
 - Bore holes for DN 50 flange: 4 x 90° Ø18 (0.71") on hole circle Ø125 (4.92")
 - Bore holes for ANSI 2" flange: 4 x 90° Ø19 (0.75") on hole circle Ø121 (4.76")
 Flange seal, 4 screws M16x60, 4 nuts M16 incl. washers, stainless steel 1.4571 (AISI 316Ti); order no. 50080249

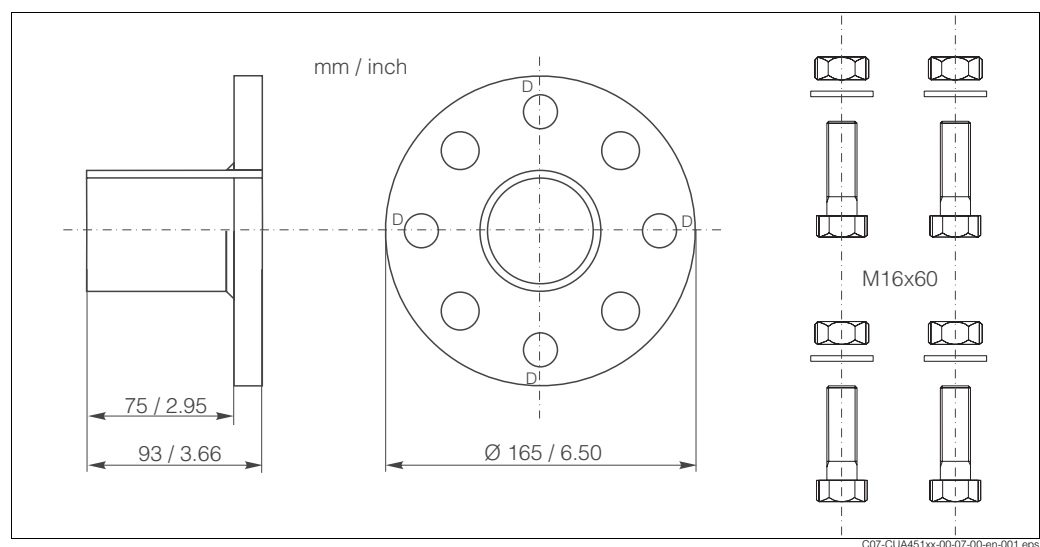

Welded fitting

D: Marks for the bore holes of the DN 50 flange

Sensors☐ TurbiMax W CUS 31




Turbidity sensor for drinking water and waste water applications, 90 ° scattered light method
ordering acc. to product structure, see Technical Information

☐ TurbiMax W CUS 41

Turbidity sensor for waste water and solid content measurements, multi-channel technology
acc. to the 90 ° scattered light method
ordering acc. to product structure, see Technical Information

☐ TurbiMax W CUS 65

Turbidity and solid content sensor for wide measuring range applications,
backscatter-light method
ordering acc. to product structure, see Technical Information

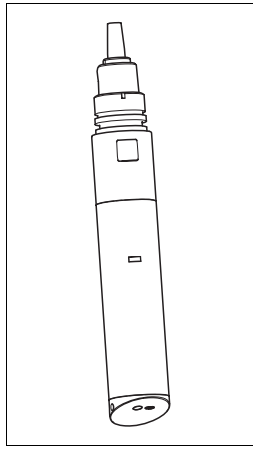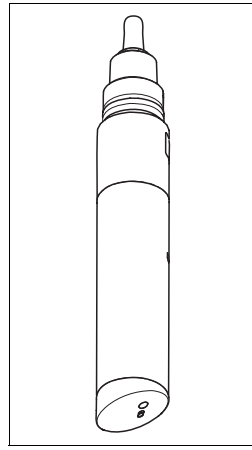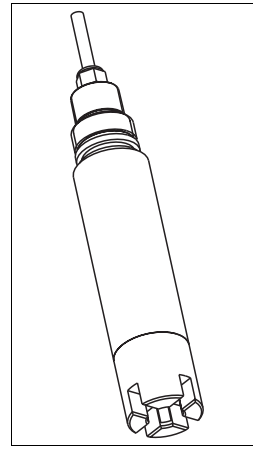*TurbiMax W CUS 31**TurbiMax W CUS 41**TurbiMax W CUS 65***Documentation**

- ☐ Operating Instructions CleanFit CUA 451, BA 369C/07 (order no. 51512838)
- ☐ Technical Information TurbiMax W CUS 31, TI 178C/07 (order no. 50088400)
- ☐ Technical Information TurbiMax W CUS 41, TI 177C/07 (order no. 50088402)
- ☐ Technical Information TurbiMax CUS 65, TI 370C/07 (order no. 51512873)

For more Endress+Hauser product please visit: www.ainstru.com
Mail: Sales@ainstru.com

Endress+Hauser GmbH+Co. KG

Instruments International
P.O. Box 2222
D-79574 Weil am Rhein
Germany

Tel. (07621) 975-02
Tx 773926
Fax (07621) 975 345
e-mail: info@ii.endress.com

Internet:

<http://www.endress.com>

Endress + Hauser
The Power of Know How

